

# A47 Wansford to Sutton Dualling

**Scheme Number: TR010039**

**Volume 6**

## **6.3 Environmental Statement Appendices** Appendix 6.1 – Cultural heritage information

APFP Regulation 5(2)(a)

Planning Act 2008

Infrastructure Planning (Applications: Prescribed  
Forms and Procedure) Regulations 2009

July 2021

Infrastructure Planning

Planning Act 2008

**The Infrastructure Planning  
(Applications: Prescribed Forms and  
Procedure) Regulations 2009**

A47 Wansford to Sutton  
Development Consent Order 202[x]

---

**ENVIRONMENTAL STATEMENT APPENDICES**  
**Appendix 6.1 - Cultural heritage information**

---

<b>Regulation Number:</b>	Regulation 5(2)(a)
<b>Planning Inspectorate Scheme Reference</b>	TR010039
<b>Application Document Reference</b>	TR010039/APP/6.3
<b>BIM Document Reference</b>	HE551494-GTY-EHR-000-RP-LE-30001
<b>Author:</b>	A47 Wansford to Sutton Project Team, Highways England

<b>Version</b>	<b>Date</b>	<b>Status of Version</b>
Rev 0	July 2021	Application Issue

### **Table of contents**

6.1.	Study area and limitations	1
6.2.	Background History and Archaeology	2
6.3.	Methodology for Impact Assessment	28
6.4.	Assessment of Value/Sensitivity	31
6.5.	Assessment of Impact Before Site-Specific Mitigation	80

### **Tables**

Table 1: Criteria for assessing Value/Sensitivity	28
Table 2: Criteria for assessing magnitude of impact	29
Table 3: Criteria for assessing Significance of Effect	30
Table 4: Assessment of Value/Sensitivity	31
Table 5: Assessment of impact	81

### **Figures**

Figure 1 1886-92 1st Edition County Series Mapping (1:10,560)	22
Figure 2 1896-1999 1st Edition County Series Mapping (1:2,500)	23
Figure 3 1901-1902 1st revision County Series Mapping (1:10,560)	24
Figure 4 1900-1902 1st revision County Series Mapping (1:2,500)	25
Figure 5 1958 1st imperial Edition (1:10,560)	26

## Appendix 6.1 Cultural heritage information

### 6.1. Study area and limitations

#### Study area

- 6.1.1. In line with Design Manual for Roads and Bridges, (DMRB), LA 106 Cultural Heritage, the Proposed Scheme does not rely on a traditional buffer to determine the study area. It is made up of assets within or outside the footprint of the Proposed Scheme, that may experience physical effects and assets within the Zone of Visual Influence (ZVI) which may have effects on their settings and assets potentially affected by noise. Information has been gathered from a wider area to inform the context of the assets within the study area and assess their potential.
- 6.1.2. The ZVI is defined by the procedurally generated Zone of Theoretical Visibility (ZTV, see Figure 6.1) which is modified based on-site observations to account for vegetation or other factors not procedurally accounted for (see section 6.4.6). The ZVI does not have a mappable output, as it is based partly on professional judgement and will change with season and weather.

#### Limitations

- 6.1.3. Data collection was limited due to the COVID-19 outbreak. No visits to archives and other sources of physical data were possible and therefore remotely accessible data had to be used. The main sources lacking in this regard were historic mapping and aerial photographic sources, however online resources such as Google Earth and available online historic mapping mitigated this issue greatly.
- 6.1.4. Information provided by the HER can be limited due to its dependence on random opportunities for historic and archaeological research, fieldwork, and discovery. Where nothing of historic interest is shown in a particular area, this can be down to a lack of research or investigation, rather than no heritage assets being present.
- 6.1.5. Documentary sources are rare before the medieval period, and many historic documents are inherently biased. Older primary sources often fail to accurately locate sites and interpretation can be subjective.

## 6.2. Background History and Archaeology

### Soils and Geology

- 6.2.1. Superficial deposits are of the River Terrace Deposits, formed up to three million years ago in the Quaternary Period. These are primarily found in a north-south band to the east of Sacrewell farm, with a narrow band of Alluvium - Clay, Silt, Sand and Gravel to the east. Another area of river terrace deposits runs from Sutton Heath Road and extends eastwards, beyond the Proposed Scheme boundary. Underlying bedrock geology consists of Upper and Lower Lincolnshire Limestone Member in the west of the Proposed Scheme area, with a band of Lower Member in running approximately parallel with Sutton Heath Road. Beyond this to the east is Rutland Formation - Argillaceous Rocks With Subordinate Sandstone And Limestone (BGS 2020). The soils are a mix of Shallow lime-rich soils over chalk or limestone and freely draining slightly acid but base-rich soils (Cranfield Soil and Agrifood Institute 2018).

### Designated Heritage Assets

- 6.2.2. Designated assets are shown on Figure 6.1 and are listed in a gazetteer of all assets below.
- 6.2.3. Listed buildings within the ZTV are assessed to determine the impact of the Proposed Scheme, including both direct and indirect physical impacts and setting impacts. The settings of heritage assets will be taken into account where there is a visual link to or historic relationship with the Proposed Scheme.
- 6.2.4. There are no world heritage sites, registered battlefields, registered park and gardens, or listed buildings within the Proposed Scheme boundary.
- 6.2.5. 13 scheduled monuments are located within the study area. These are:
- The cropmark site of a barrow cemetery and quadrilateral ditched enclosure with pits and a pit alignment (List entry 1006796), comprises various circles and enclosures theorised to be of prehistoric and Roman date which are visible on aerial photographs. This asset is located directly north of the A47 towards the centre of the Proposed Scheme, it shares a boundary with the Proposed Scheme along its southern edge and the Proposed Scheme encroaches on its south-eastern corner;
  - The Shrunkon village at Upton (List entry (1006810) is a scheduled monument generated from an 'old county number' (OCL) scheduling record with no descriptive information available in the listing description. It is located approximately 245m to the east of the Upton improvement location;

- The Sutton Heath Romano-British site (List entry 1006880) is also an OCL scheduling record with no descriptive information available in the listing description. It is located approximately 435m to the north of the Proposed Scheme Boundary and 840m west of the Upton improvement location;
- The Roman fort and enclosure at Sutton Cross (List entry 1006837) is a scheduled monument generated from an 'old county number' (OCL) scheduling record with no descriptive information available in the listing description. It is located beyond the eastern end of the Proposed Scheme.
- Wansford Roman site (List entry 1006836) is an OCL scheduling record. It is located approximately 480m south of the Proposed Scheme Boundary, to the south-east of the village of Wansford;
- Two scheduled monuments relate to the Cambridge and Peterborough sides of Wansford Bridge (List entry 1003810, 1006836) and are also OCL scheduling records.
- Moated Site, Castor Manor Farm (List entry 1006847) is also an OCL scheduling record with no descriptive information available in the listing description. It is located approximately 1.5km to the east of the Proposed Scheme Boundary
- Roman Site in Normangate Field (List entry 106864) is also an OCL scheduling record with no descriptive information available in the listing description. It is located approximately 1.1km to the south-east of the eastern end of the Proposed Scheme boundary
- Site of Roman Villa NE of Sibson Hollow (List entry 106863) is also an OCL scheduling record with no descriptive information available in the listing description. It is located approximately 1.1km to the south of the eastern end of the Proposed Scheme boundary
- Roman Villa SW of Castor Station (List entry 106862) is also an OCL scheduling record with no descriptive information available in the listing description. It is located approximately 1.1km to the south of the eastern end of the Proposed Scheme boundary
- Bowl Barrow 450m North East of Water Newton Mill (List entry 1020124) is also an OCL scheduling record with no descriptive information available in the listing description. It is located approximately 1.2km to the south of the eastern end of the Proposed Scheme boundary
- The Fort and Roman Walled Town of Durobrivae and its South, West and East Suburbs, Immediately South and East of Water Newton Village (List entry 1021429) is also an OCL scheduling record with no descriptive information available in the listing description. It is located approximately 1.8km to the south of the eastern end of the Proposed Scheme boundary

- 6.2.6. None of the scheduled monuments have upstanding remains or readily visible earthworks and have been identified from a mix of aerial photography and recovery of surface artefacts.
- 6.2.7. 182 listed buildings are located within the study area; eight are grade I listed, nine are grade II\* listed, and the remaining 165 are grade II listed.
- 6.2.8. The grade I listed buildings within the study area are:
- The Church of St Andrew (List entry 1225298), located in the village of Thornhaugh, approximately 255m west of the Proposed Scheme;
  - The Church of John the Baptist (List entry 1127440), located in the far north-east of the Proposed Scheme, approximately 435m east of the Upton improvement location;
  - The Church of St Mary the Virgin (List entry 1127442), located within Wansford, approximately 335m south-west of the Proposed Scheme;
  - The Church of St Michael (List entry 1127517), located within the village of Sutton, approximately 475m to the south of the Proposed Scheme;
  - Two grade I listed buildings are the Cambridge and Peterborough sides of Wansford Bridge (List entry 1127445, 1274654). These are not separate from the schedule Wansford Bridge noted above, the asset has four separate designations;
  - The remaining two grade I listed buildings are Stibbington Hall and its associated gateway and boundary wall
- 6.2.9. The majority of the designated assets centre around the settlements of Thornhaugh, Sibberton, Wansford, Stibbington, Sutton, Upton, Yarwell, Water Newton and Ailsworth. The exception to this is Sacrewell farm and mill, which is discussed separately. Designated assets have been formed into groups relating to their settlement in order to better inform the heritage character of the study area.
- 6.2.10. Thornhaugh, Wansford and Sutton also contain conservation areas, the character of which will be discussed in their relevant sections below.

## Thornhaugh

- 6.2.11. Thornhaugh was designated as a conservation area in 1979. The area constitutes the majority of the village and contains the eight listed buildings within the settlement. The character of the settlement is portrayed by buildings of sandstone and ashlar with a small number of surviving thatched roofs throughout. The conservation area begins approximately 90m to the west of the Proposed Scheme.

- 6.2.12. The Church of St Andrew (List entry 1225298) is a grade I listed parish church originally dating to the 12<sup>th</sup> century. The building was restored in 1889 and is built of stone rubble and ashlar with Collyweston stone roofs. The oldest surviving architecture in the church is the four-bay north arcade which dates to the late 12<sup>th</sup> century. This is followed by the early to mid-13<sup>th</sup> century chancel, perpendicular south window, and east window. The tower was originally erected in the 13<sup>th</sup> century, and was rebuilt during the 1889 restoration. The nave and chancel roofs and tiebeams are dated to the 15<sup>th</sup> century, along with the braced collars and wind braces and the crenelated wall plates. Around 1500CE the original church spire collapsed, destroying the south arcade in the process. The south transept with battlements and the south porch all date to the 16<sup>th</sup> century, and the large south windows, north aisle, and clerestory windows all date to the 19<sup>th</sup> century. The above elements contribute to the high evidential and aesthetic value of this heritage asset and inform the heritage asset's high level of heritage significance. The heritage asset also holds historic and communal value as it is the local parish church of Thornhaugh and is still open to worshippers, positively contributing to the sense of spiritual value associated with the heritage asset and positively informing the significance of the heritage asset.
- 6.2.13. Associated with the Church of St Andrew is The Old Rectory (List entry 1127496). This large mid-17<sup>th</sup> century stone house is constructed in stone with freestone dressings and a Collyweston stone roof. The building has numerous 19<sup>th</sup> century additions, with the original house being two storeys with an attic and the later additions consist of an extension to the north-east, built in stone with a hipped Collyweston slate roof to match the original building. This heritage asset contributes to the heritage value of St Andrews Church, along with positively contributing to the rural character of the settlement and conservation area.
- 6.2.14. The five remaining designated heritage assets within Thornhaugh are the Conduit Head Immediately South of No's 5 and 7 (List entry 1127456); the Thornhaugh and Wansford War Memorial (List entry 1428204); The Former Thornhaugh County Primary School (List entry 1127460); 2, 4 and 6, Russel Hill (List entry 1331254); and Stone Cottage (List entry 1225258).
- 6.2.15. These assets contribute to the historic character of the surrounding area, with similar building styles and appearances to those throughout the local area. They identify Thornhaugh as an established settlement with a medium overall heritage significance which has been well preserved with the passage of time.

## Sibberton

- 6.2.16. Sibberton, located approximately 390m to the west of the Proposed Scheme Boundary, is identified on OS mapping as a medieval village, however the only surviving aspects of this settlement relate to Sibberton Lodge.



- 6.2.17. The Sibberton Lodge complex contains five designated assets; Sibberton Lodge (List entry 1331255); Sibberton Lodge Cottage (List entry 1127462); Stables to the west of Sibberton Lodge (List entry 1331256); Barn to the south-east of Sibberton Lodge (List entry 1266207); and Barn to the south of Sibberton Lodge (List entry 1127463).
- 6.2.18. Sibberton Lodge (List entry 1331255) is a grade II\* listed building and consists of a 17<sup>th</sup> century house with a medieval wing that possibly originated as a chapel. The later part of the building contains a datestone engraved with '1657', and the building is constructed in coursed stone and ashlar with a steeply pitched Collyweston stone roof. The medieval section of the building dates to the 13<sup>th</sup> century and has a hipped roof with buttresses on the north side.
- 6.2.19. The remaining designated assets date to the 17<sup>th</sup> century onwards and form the group identity of the lodge. They are constructed in coursed stone with either modern or Collyweston stone roofs and have been designated for their group value with Sibberton Lodge. These assets add to the heritage value of the area in that they are in keeping with other contemporary buildings, and aid in demonstrating the traditional land use as agricultural and pastoral land with small dispersed settlements.

## Wansford

- 6.2.20. Wansford was designated as a conservation area in 1975. It encompasses the historic core of the village, north of the river, and is principally an area of housing but also includes the grade I listed Church of St Mary the Virgin (List entry 1127442) and the Peterborough side of Wansford Bridge (List entry 1127445). Aside from the grade I listed buildings within the conservation area, there are a further 13 grade II listed buildings.
- 6.2.21. 44 of the listed buildings within the Study Area can be found in the village of Wansford. Of these, three assets are grade I listed and form the Cambridge and Peterborough sides of Wansford Bridge (List entries 1127445, 1274654), and the Church of St Mary the Virgin (List entry 1127442). The above elements contribute to the high evidential and aesthetic value of this heritage asset and inform the asset's high level of heritage significance. The heritage asset also holds historic and communal value as it is the local parish church of Wansford and is still open to worshippers, positively contributing to the sense of spiritual value associated with the heritage asset and positively informing the significance of the heritage asset.
- 6.2.22. Wansford Bridge spans the common boundary of the parishes of Sibson Cum Stibbington (Cambridgeshire) and Wansford (Peterborough). Built in 1577, it constitutes a fine ashlar bridge over the River Nene with a total of 12 arches.

The south end was rebuilt in 1795, with the date in an oval panel above the keyblock. The next 3 arches are dated between 1672 and 1674, and the remainder are dated 1577 in the parapet with the initials "P.If". This asset holds a very high significance within the heritage record as it signifies a long-established crossing point that is likely pivotal to the existence of Wansford itself. It is highly likely that a crossing point has existed near this point of the river since much earlier than the 16<sup>th</sup> century, as the Nene Way has likely been a well-used travelling route since the prehistoric period. The above factors contribute to the high functional and aesthetic value of this heritage asset and inform the asset's high level of heritage significance.

- 6.2.23. The earliest surviving architecture of the Church of St Mary the Virgin (List entry 1127442) dates to the 12<sup>th</sup> century and can be found within the south doorway of the nave. The west tower is attributed to the 13<sup>th</sup> century, with the spire dated to the 14<sup>th</sup> century. numerous additions and renovations during the 17<sup>th</sup> to 20<sup>th</sup> centuries have brought the church to the state it survives in today. The church is built of coursed stone with freestone dressings and has lead and Collyweston stone roofs.
- 6.2.24. The remaining assets are mainly domestic dwellings within the village. These are: Church house (List entry 1127443); Goss Cottage (List entry 1222046); Riverside (List entry 1222417); Number 4 (Waters Edge) and wall and outbuilding (List entry 1222418); 18 20, London Road (List entry 1222420);; Fielding House (List entry 1225934); Drayton Place (List entry 1274512); The Old House and rear boundary wall (List entry 1274652); 6 8, Elton Road (List entry 1274685); Templar House (List entry 1222419); Barnaby House and outbuilding and garden boundary wall to rear (List entry 1237717); 17 Elton Road (List entry 1274865); 13 and 15, Elton Road (List entry 1222044); 1-11 Elton Road (List entry 1274864); 6 8, London Road (List entry 1274607); 30 London Road (List entry 1237793); 32 London Road (List entry 1274653); Stable Range attached to east of Number 34 (List entry 1222422); 34 London Road (List entry 1237799); 36, 38, 40, London Road (List entry 1237832); Bridge Cottage Downderry House (List entry 1127444); Sydney House (List entry 1222412); Barn and Stables adjoining rear (East) of Wharf House (List Entry 1225965); Wharf House (List entry 1331288); 7, Bridge End (List entry 1225937); Greystone (List entry 1266086); The Corner House (List entry 1331287); Meadow Cottage (List entry 1225917); Hillside and former workshop to south (List entry 1331249). A particular group lies to the south-west of the main village core, Stibbington House and its associated workshop, lodge and Gatepiers (List entry 1222415, 1274688, 1222526 and 1222414).
- 6.2.25. Exceptions to this are the Butchers Shop (List entry 1222421), the Haycock Hotel (List entry 1222045); Barn circa 50m north-east of the Haycock Inn (List entry 1222423); Forge and stable range circa 40m north of the Haycock Inn (List

entry 1237907); and Bedford Row Morva Bass Post Office (List entry 1222045). These assets are to be expected in a settlement of this size located at a crossing point in a river. The settlement will have seen a lot of traffic from the medieval period onwards, and amenities would naturally have been required within the village.

- 6.2.26. These assets emphasise the character of Wansford as a historic settlement and as one of the more established villages within the surrounding area. Although the grade I listed buildings date to the medieval period, the designated assets of Wansford date to the 17<sup>th</sup> century onwards, with the vast majority of the above dwellings having been built during the 18<sup>th</sup> century. This demonstrates the availability and lower cost of building stone during this period, and it also demonstrates a degree of affluence within the settlement during the post medieval to modern periods. Overall, these factors contribute to both the high heritage value of each individual asset individually, and the group heritage value that the village of Wansford holds as a settlement.

## Stibbington

- 6.2.27. There is no appraisal information available for this conservation area. However, the settlement dates to at least the early medieval period, as it is listed within the parish of Upton in the Domesday Book of 1086 (Open Domesday 2018a). The grade II\* parish church of St John the Baptist (list entry 1274862) stands about a quarter of a mile east of the Great North Road near the old ford to Sutton. The church has several associated listed tombs in its cemetery (List entry 1222042, 1222315 and 1274863) as well as a grade II\* rectory (List entry 1222331). Stibbington Hall is a grade I listed 17<sup>th</sup>-century house (List entry 1222241) with associated grade I gateway and boundary wall, as well as a grade II stable block, coach house and further wall and gate piers (List entry 1274861, 1274712 and 1222040). Other listed buildings within the conservation area are the grade II Stibbington Manor (List entry 1274697), Granary and Stables (List entry 1274697) and Old Castle Farmhouse (List entry 1222339). The earliest parts of the church may date to the Norman conquest while the hall and manor date to around the 16<sup>th</sup> and 17<sup>th</sup> centuries.
- 6.2.28. The character of the village is strongly inward-focused with large walls effectively separating the Hall and grounds from the rest of the village. There is an historic link to Sutton, across a former fording point of the Nene. The ford is no longer extant but there is a small working marina there now. There is a large amount of mature tree planting within the village, contributing to the inward focus experienced during the site visit. Somewhat bypassed by the Great North Road, this settlement may have served as a secondary crossing point of the Nene, for east-bound traffic as well as an access point for local river craft following improvement of the river in the post-medieval period. Given its earlier start in

history than Wansford, it is possible that it was more important to travel before the construction of reliable bridges.

- 6.2.29. The above strong character and time depth, combined with the group value of the listed buildings, gives this conservation area a Medium heritage value, principally derived from its architectural and historic value. Its setting making a moderate positive contribution to its significance.

## Sutton

- 6.2.30. Sutton was designated as a conservation area in 1990. It encompasses the main body of the settlement and a small parcel of land to the west, and it contains the 11 listed buildings located within the settlement. The character of this conservation area is much the same as the others within the Study Area, centring on an established medieval settlement, demonstrated by the Medieval Church of St Michael, with the remainder of the built heritage in the settlement comprising medieval to post-medieval buildings with various renovations during the 18<sup>th</sup>-20<sup>th</sup> centuries.
- 6.2.31. The only grade I listed building within Sutton is the Church of St Michael (List entry 1127517). This church dates to the 12<sup>th</sup> century but was heavily restored in 1867-8. It is built of coursed stone rubble and arches, with a Collyweston stone chancel roof and a lead knave roof. It is likely that the nave was rebuilt in the early 15<sup>th</sup> century and further raised in the late 15<sup>th</sup> century in the perpendicular style. The church retains its 12<sup>th</sup> century chancel arch, and the chancel itself was rebuilt or enlarged in the late 12<sup>th</sup> century. Other surviving 12<sup>th</sup> century features include the south aisle and parts of the south chapel. The church was restored or expanded at some point in the 13<sup>th</sup> century, evidenced by a number of windows, parts of the south chapel, and ornamentation on the east wall of the building. The above elements contribute to the high evidential and aesthetic value of this heritage asset and inform the asset's high level of heritage significance. The heritage asset also holds historic and communal value as it is the local parish church of Sutton and is still open to worshippers, positively contributing to the sense of spiritual value associated with the heritage asset and positively informing the significance of the heritage asset.
- 6.2.32. The 10 remaining listed buildings within the settlement of Sutton are: Village Pound (List entry 1127514); 19 Graeme Road (List entry 1127515); Manor House (List entry 1127516); Dovecot east north-east of The Grange (List entry 1127518); 1 Nene Way (List entry 1224316); The Grange; (List entry 1224371); 12 Nene Way (List entry 1224408); 1 Lovers Lane (List entry 1238018); 2 Graeme Road (List entry 1274413); and Graeme House (List entry 1331243).

- 6.2.33. The remaining designated assets date to the 17<sup>th</sup> century onwards and form the group identity of the settlement highlighted by the conservation area. They are mainly constructed in coursed stone with either modern or Collyweston stone roofs. These assets add to the heritage value of the area in that they are in keeping with other contemporary buildings, and aid in demonstrating the traditional land use as agricultural and pastoral land with small dispersed settlements.

## Upton

- 6.2.34. Upton lies approximately 1.3km to the north-east of the main part of the Proposed Scheme, however the Proposed Scheme involves a road improvement to the north-east to accommodate further traffic, and the main body of Upton is located directly east of this.
- 6.2.35. A total of 10 listed buildings are located within Upton, with one of these within the smaller Proposed Scheme boundary for the road improvement. This is a Wall to the east of Model Farmhouse fronting road and turning westwards at road junction (List entry 1127438). This wall is located directly adjacent to the southern side of the road, preventing any work on the south side of the road near the junction without major impacts. The wall is probably 18<sup>th</sup> century and is a tall coursed stone rubble boundary wall on two sides of the garden of Model Farmhouse (List entry 1331283). This asset has been included for its group value with the farmhouse and the village itself.
- 6.2.36. One asset within Upton is grade I listed, the Church of St John the Baptist (List entry 1127440). The church originally dates to the 12<sup>th</sup> century but has been largely rebuilt in 17<sup>th</sup> century Gothic with a chancel dated to 1842. The only surviving 12<sup>th</sup> century aspects of the church are the north arcade and parts of the chancel arch. The font dates to the 15<sup>th</sup> century, and the remainder of the building dates to the 17<sup>th</sup>-19<sup>th</sup> centuries. The above elements contribute to the high evidential and aesthetic value of this heritage asset and inform the asset's high level of heritage significance. The heritage asset also holds historic and communal value as it is the local parish church of Upton and is still open to worshippers, positively contributing to the sense of spiritual value associated with the heritage asset and positively informing the significance of the heritage asset.
- 6.2.37. The remaining 8 listed buildings within Upton are: Model Farmhouse (List entry 1331283); Dovecot east south-east of Manor House (List entry 1127439); Manor House (List entry 1331284); Sundial in paddock immediately west of Manor House (List entry 1331285); Keepers Cottage (List entry 1127441); Elizabethan Cottage (List entry 1225898); Primrose Cottage (List entry 1331286); and a K6 telephone kiosk (List entry 1394044).



- 6.2.38. The remaining designated heritage assets within Upton date to the 17<sup>th</sup>-19<sup>th</sup> centuries. They follow similar characteristics to the other listed buildings within the Study Area; built with coursed stone and ashlar with Collyweston stone roofs, however thatching is also common among the listed buildings in Upton. This demonstrates the significance of the assets as they are in keeping with other contemporary buildings, and aid in demonstrating the traditional land use as agricultural and pastoral land interspersed with small settlements throughout the landscape.

### Yarwell

- 6.2.39. This village lies between 1.6 and 2km south-west of the eastern end of the Proposed Scheme and has been included in the study area due to partial overlap with the ZTV. There are 22 listed buildings, 21 of which are grade II and one Grade II\*, arrayed along a single street. The grade II\* building is the Church of St Mary Magdalene (List entry 1225879), which has associated listed tombs (List entry 1266129, 1225879) and monument (List entry 1266143). The remaining listed buildings mostly date to the 18<sup>th</sup> and 19<sup>th</sup> centuries and characterise a fairly typical spread of residential, farming and rural industry. Details of all buildings can be found in table 6.4 below. The grade II\* church is of high value, due to its historical and architectural interest as well as its listing status. The remainder of the settlement is between medium and high value, deriving from its historical interest and group value.

### Water Newton

- 6.2.40. First designated as a conservation area in 1990, Water Newton Conservation Area is located approximately 1.7km south of the eastern end of the Proposed Scheme at its closest point. The conservation area lies on a north-facing slope overlooking the River Nene, north of the A1 and encompasses almost all of the settlement.
- 6.2.41. The main part of the conservation area comprises a large open field, the curtilage to the grade II listed Hall Cottages (list entry 1237957). There are a total of 15 listed properties, focussed around the Parish Church of St Remigus (grade II\* list entry 12375953) including the old rectory (list entry 1274435) and a number of grade II tombstones (list entry 1237955, 1237954, 1274436), and the grade II Manor House on Old Great North Road including a stable range number 2, and a milepost (list entry 1274401, 1237958, 1237956). Along Mill Lane is the former mill (grade II List entry 1274435) and a number of grade II cottages (list entry (1274428, 1274655), a farmhouse and its gazebo, barns and stables (list entry 1274645, 1222424). At the junction of Old Great North Road and Mill Lane are a number of lower value non-designated buildings.

- 6.2.42. Water Newton is a very well-kept village, with a noticeable inward focus on the Old North Road and the River Nene. There is road noise present throughout the village, which is dominant at the east and west ends, closest to the junctions with the A1. The majority of the village is screened from the road by trees and hedgerows. The land-form drops away to the north, towards the river, which provides significant noise damping in the area of the mill and church.
- 6.2.43. In the north of the conservation area, around the church and mill, the dominant noise is that of the weir and locks on the River Nene. There is significant screening from trees north of the river and along its banks, creating a very insulated feeling in the settlement.
- 6.2.44. The high level of heritage significance of the conservation area lies primarily in its group values, comprising the listed buildings and the open spaces between. The historic value demonstrates a relatively unchanged example of a medieval (Open Domesday 2018c) village layout with post medieval additions, including the economic input from the mill, agriculture, and associated buildings. Individually the listed buildings display various architectural values, and collectively display aesthetic value.

## Ailsworth

- 6.2.45. The existing Ailsworth Conservation Area was designated by Peterborough City Council in 1969 and is located 1.2km from the eastern end of the Proposed Scheme at its closest point.
- 6.2.46. Ailsworth is mentioned in 8th and 9th century church manuscripts and the village name has its origins in the Anglo Saxon language. As late as the 5th century a Saxon settlement was said to have existed on the site of the present villages of Ailsworth and Castor, potentially re-using Roman foundations. In the Domesday Book, Ailsworth is recorded as a Manor in its own right; however, it appears to have been subsidiary to the neighbouring settlement of Castor (Open Domesday 2018c).
- 6.2.47. The surviving historic buildings in the conservation area are made up of 21 cottages (list entry 1126864-8, 1126897-905, 1161345, 1161364, 1331540-2, and 1331561-3), a public house (list entry 1126868) and a manor house (list entry 1331539), all dating from the 17th and 18th centuries. The buildings are arrayed on two streets north of the Peterborough Road, with some along the road. This is the former course of the Roman road and main thoroughfare until the existing A47 carriageway was built, bypassing the settlement. Most of the older buildings in the town were demolished and replaced in the 1960s and the character of the settlement has shifted to be quite focused on the individual streets and Peterborough Road. Principal elevations all face either west or north

and long views have been heavily restricted, but not eliminated, by tree planting and modern buildings.

- 6.2.48. Approaching the village from the existing Sutton roundabout, there are open arable fields either side of the road leading to a line of 20<sup>th</sup> century houses which effectively buffers the older buildings from the formerly rural wider setting.
- 6.2.49. The medium heritage significance of the conservation area derives from the architectural interest and group value of the surviving buildings as well as the historical value in contextualising other settlements, such as Castor, along the former main road.

## Castor

- 6.2.50. The Castor conservation area was designated in 1969 and is located 1.6km east of the eastern end of the Proposed Scheme at its closest point. There are over 50 listed buildings within the conservation area, only five of which are within the study area, all grade II and dated to the 18<sup>th</sup> and 19<sup>th</sup> centuries. These consist of two cottages (list entry 1126863, 1131579), Two farmhouses (list entry 1126807, 1331548) and a dovecote (list entry 1163093).
- 6.2.51. The settlement has early evidence dating to the Bronze Age and Iron Age, becoming an important location in the Roman period due to its proximity to the crossing point of Ermine Street Roman road over the Nene. Roman brickwork has been incorporated into some of the surviving buildings. During the Saxon and later medieval periods, the centre of the village occupied much the same position, shifting gradually to the east as Milton park rose in prominence at the western edge.
- 6.2.52. Castor is centred around the streets bounded by The Green, Church Hill, Stocks Hill and Peterborough Road, with a somewhat open feeling within the village provided by longer views down streets, ending in pinch points which restrict long distance views. The settlement is screened to the west by Ailsworth.
- 6.2.53. The high heritage value of the settlement is principally derived from its historic and architectural interest, given its long time-depth. There is also substantial group value within the listed buildings and between the buildings and the Roman archaeology surrounding the village.

## Sacrewell Farm and Mill

- 6.2.54. The Sacrewell Farm complex contains two designated assets, the grade II listed Sacrewell Farmhouse (List entry 1266496) and the grade II\* listed Sacrewell Mill and Mill House and Stables (List entry 1127493).



- 6.2.55. The farmhouse dates to the mid-18<sup>th</sup> century and is built in coursed stone with a steeply pitched Collyweston stone roof with gabled ends. The main body of Sacrewell Mill slightly pre-dates this, having been constructed in the early 18<sup>th</sup> century, and the adjoining watermill is dated to 1755. This building is also constructed in coursed stone with steeply pitched Collyweston stone roofs. The Mill and attached buildings form an L-shape in plan, with the stables adjoining at a right angle to the north-west. The mill contains complete mill machinery in working order, with a cast iron overshot wheel and pit wheel, and a great spur wheel with a timber main drive and crown wheel. Two of the three original sets of stones remain, along with a chain hoist operated by the main drive on a windlass principle. The storage bins, chutes and hopper are all intact, and the stable has since been converted into a garage.
- 6.2.56. These assets are a fantastic example of rural industry within the region, and demonstrate how industry and agriculture could exist side-by-side during the post-medieval period onwards. The assets form a part of the Sacrewell Farm tourist attraction and hold a high community value, along with their high standalone heritage value.

### Non-Designated Heritage Assets

- 6.2.57. There are a total of 228 non-designated heritage assets within the study area for the Proposed Scheme, and a gazetteer of these assets can be found below and shown on Figure 6.2 (note that a number of the previously discussed designated assets also appear within the Historic Environment Record data).
- 6.2.58. 17 non-designated assets can be found within the Proposed Scheme Boundary for the scheme. These include; the site of a former smithy (53699); a royal observer corps site (50635); a stretch of dismantled railway line (53529); 2 findspots (01976, 50596); 6 previous archaeological excavations (01991, 11038, 08474, 08465, 08472, 08468); and 6 archaeological features (00190b, 00227, 10044, 00230, 08368, 08359) indicating agricultural land use. These assets are discussed within their relevant sections below.
- 6.2.59. 79 of the assets within the study area are findspots of individual artefacts dating from the Paleolithic to the Modern period. These are of limited value to a heritage assessment, as they indicate a human presence within an area during a time period but little more. The remainder of the assets have been separated into separate sections for ease of interpretation.

### Built Heritage

- 6.2.60. 42 of the non-designated assets recorded within the study area are built heritage rather than archaeological remains. These include duplications of various designated assets, and the remainder mainly constitute 17<sup>th</sup>-19<sup>th</sup> century

structures akin to the local landscape character indicated by the designated assets discussed above.

- 6.2.61. Exceptions to this are various assets dated to World War II (discussed below) and a selection of public buildings one would expect within a settlement of any size. These include schools, churches, smithies, and various farm buildings.
- 6.2.62. These assets are all slightly significant in that they inform us of past life throughout the area. Their value increases as a group, as together they grant a 'big picture' view of the region which reinforces the hypotheses that can be drawn from the previously discussed designated assets.
- 6.2.63. A stretch of the now dismantled Stamford to Wansford railway line (53529) is located in the central section of The Scheme. The railway line is oriented north-west to south-east, with approximately 235m of the railway within the Proposed Scheme Boundary. The railway was opened in February 1857 and was originally 8.5 miles long between Stamford East Station and Wansford, on the Northampton to Peterborough line of the London and North Western Railway. The stations along the route were Barnack, Ufford, Wansford Road and Wansford. The branch was locally known as The Bread and Onion Line and due to its limited traffic potential, the line was closed to passengers in 1929 and goods in 1931. This asset holds local significance as a historic travel route across the area, and the path of the railway intersects with numerous settlements along its route, meaning many bridges and embankments resulting from the construction of the railway can be seen throughout the area. Within the Proposed Scheme Boundary, the asset is not particularly visible as it is screened by woodland and runs beneath the modern road.
- 6.2.64. There are four locally listed buildings within the Study Area. These are the Former Wansford Road Railway station (WAN1); Bridge No. 6 carrying the A47 over the Wansford to Sutton Railway Line (WAN2); Heath House (WAN10) former station masters house) and the ArchHaus, a former 'Knights on the Road' roadhouse (WAN11 – expected to be removed from ZTV).
- 6.2.65. The former Wansford Road Railway Station (WAN1) was constructed alongside the Stamford to Wansford railway in 1867 and is a single storey central stone building with smaller side extensions to each gable and set forward to the platform. The building has since been converted into a residential dwelling but is now unoccupied. As signified by its recognition as a locally listed building, the old station is of local importance and of a medium significance, being a fine example of 19<sup>th</sup> century architecture in the area and holds group value with the railway and other associated assets. The station with its associated structures, as well as the bridge (WAN2) and Heath House (WAN11) are discussed in detail in ES Chapter 6 (Cultural Heritage) (**TR010039/APP/6.1**). A full assessment of

the group, conducted by Historic England, is included as ES Appendix 6.7 (TR010039/APP/6.3).

- 6.2.66. The ArcHaus (WAN13) was constructed in 1932 and is one of six former 'Knights of the Road' roundhouses. These were constructed from the late 1920s in order to house and refresh long distance motorists within the midlands. The other locations of these roadhouses are Nottingham, Hinckley, Leicester, and Coventry. The 'Wansford Knight' was designed by Davies & Knight architects in the "BauHaus" style, which aimed to combine art and craft in an Avant-guard modern form. The building is rendered and has two storeys with a flat roof, and has been altered and extended during the past eight decades to accommodate its uses as the New Mermaid public house and Little Chef restaurant. It is now owned by Harris McCormack Architects Ltd, who have heavily refurbished the building since their purchase of it in 2013, and who have given it the new name 'ArcHaus'. This building is locally listed due to its uniqueness within the Landscape. It is very well known locally and is considered to be a prominent landmark for commuters along the A1. Due to this, the asset is moderately significant as it holds regional value but it has been altered to the point where listing would be unviable.

### Archaeological Features

- 6.2.67. 174 of the non-designated assets within the Study Area are of an archaeological nature. As noted above, 79 of these assets are archaeological findspots. These are of limited use to the archaeological record as they indicate human presence and activity but little else. They do however indicate that the area has been continuously inhabited by humans since the Palaeolithic period, which aids in determining the archaeological risk of The Scheme.
- 6.2.68. 12 archaeological non-designated assets are located within the current Proposed Scheme Boundary. Six of these assets identify areas of previously undertaken archaeological survey (01991, 50596, 08474, 08465, 08472, 08468).
- 6.2.69. In 1963, work was conducted towards the western end of The Scheme by the Peterborough Museum Society's Archaeological Field Section to excavate a Roman building with a hypocaust and quarry (01991) marked on historic OS mapping. Finds included painted wall plaster, fine pottery, coloured glass and possible cremated human remains. These finds indicate a level of status to the occupiers of said building, and while the site does not hold further archaeological value or significance itself, if other examples exist in the area they would be of moderate significance to the archaeological record.
- 6.2.70. Also in 1963, work was carried out on land adjacent to the service station central to the scheme in order to gauge archaeological potential (11038, 50596). These

excavations revealed little of note aside from a large mound which was found to contain large quantities of unopened freshwater mussels, coal, bone, 17<sup>th</sup> century pottery, river silts and gravels. This has been attributed to periodic river dredging activity and is of no archaeological significance. The act of dredging the river however may have disturbed and displaced or destroyed any archaeological finds within the river.

- 6.2.71. Three assets are three of ten trial/borehole pits excavated during construction of the Castor/Ailsworth bypass (08474, 08465, 08472). The finds for this work have yet to be processed, however no major or significant discoveries were documented.
- 6.2.72. The remaining archaeological assets within the Proposed Scheme Boundary consist of the site of a former smithy, Great North Road (53699); a selection of surface finds from Wagon Hovel (01976); and six cropmarks or topographic features identified by aerial photography or casual observation (00190b, 00227, 10044, 00230, 00368).
- 6.2.73. The site of a former smithy on Great North Road (53699) is recorded on the 1886 OS mapping and remained extant until at least 1959. The site has no earliest attributed date; however a blacksmith was registered in Thornhaugh in 1876. This asset is located in the north western area of the scheme, directly east of Thornhaugh and alongside the A1. The asset is of a low archaeological significance, although survivability and age of the asset may increase this to a moderate significance.
- 6.2.74. The various cropmarks within the Proposed Scheme boundary are located in the central and east sections of The Scheme. These include an unidentified linear feature (00190b) located adjacent to the northern edge of the A47; a ring ditch with a diameter of approximately 20m (00227) and a field system and pit alignment (10044) located north of the A47 in fields to the east of Sutton Heath Road; a post hole revealed by a contractor's slip trench (00230) in the same fields; and a pit alignment running for approximately 250 yards from the A47 in a south-eastern direction (08368), ending near the south-west side of a double ring ditch.
- 6.2.75. While the date of these features cannot be ascertained from aerial photography alone, they do signify at least a moderate level of human habitation of the area due to their scale. Unlike findspots, assets of this nature survive in context within the archaeological record and can be helpful in aiding our interpretation of the past.

## World War I and World War II

- 6.2.76. One asset within the study area directly relates to World War I, and a further 11 assets are attributed to World War II.
- 6.2.77. The single asset relating to World War I is a churchyard cross located within the grounds of St Andrews Church, Thornhaugh (53916). This monument commemorates the fallen of the First World War and was designed by Stamford architect H.F Traylen and subsequently built by stonemasons Belton and Goddard of Great Casterton.
- 6.2.78. The assets dated to World War II consist of 9 aircraft crash sites (50594, 50595, 52456, 52318, 52319, 52360, 52361, 52369, 52378), two of which are located within the Proposed Scheme Boundary (52360, 52361); one Royal Observer Corps bunker site (50635) located within the Proposed Scheme Boundary alongside the access road to Sacrewell Farm; and a memorial plaque at St Andrews Church in Thornhaugh (53917). It should be noted that aircraft crash sites are very inaccurately located, usually to within several kilometres.

## Historic Landscape Character

- 6.2.79. The Peterborough Historic Landscape Characterisation (HLC) project identifies 137 character areas across the study area (figures showing the location of these areas are within Annex 6.3). The dominant HLC in the study area is one of rural working agricultural countryside with dispersed settlements, farmsteads, enclosure and prairie fields. Much of the land is historically enclosed between the 18th and 19th centuries, with subsequent 20th century boundary loss as a result of arable expansion throughout the modern period. There are a small number of ancient and 19th-20th century woodland areas scattered throughout the study area. The presence of the A47 has had limited impact on the historic landscape as it mostly follows the line of a road in existence since the Roman period, and the widening and realigning of the A47 has truncated individual fields and character areas, rather than demonstrating a wholesale removal of landscape character.

## Archaeological and Historic Development

### Prehistoric (500,000 BCE – 43 ACE)

- 6.2.80. The Palaeolithic period (800,000-10,000 BCE) saw alternating warm and cold phases and intermittent, perhaps seasonal occupation. It is probably during the Upper Palaeolithic (40,000-10,000 BCE) when further climate warming took place that Britain first saw continuous occupation. Erosion has removed much of the Palaeolithic land surfaces and finds are typically residual.

- 6.2.81. The Mesolithic hunter-gatherer communities of the post-glacial period (10,000-4,000 BCE) inhabited a still largely wooded environment. The river valleys, such as that of the River Nene directly south of the Proposed Scheme Boundary and within the study area would have been favoured in providing a dependable source of food and water, as well as means of transport and communication. Evidence of activity dating to the Mesolithic period is generally characterised by flint tools rather than structural remains. Within the study area, 2 Mesolithic findspots have been recorded (00130, 52242).
- 6.2.82. The Neolithic (4,000-2,000 BCE), Bronze Age (2,000-600 BCE) and Iron Age (600 BCE-43 ACE) are traditionally seen as the time of technological change, settled communities and the construction of communal monuments. Farming became established and forest cleared for cultivation. An expanding population put pressure on available resources and necessitated the utilisation of previously marginal land (Bradley, 2007). Within the study area, 11 Neolithic findspots have been recorded within the ZTV. 10 have been attributed to the Neolithic or Bronze Age; 7 have been attributed to the Bronze Age; and 6 have been attributed to the Iron Age.
- 6.2.83. Cropmarks of ring ditches, barrows and tools have been identified across the study area which date from the Bronze Age onwards, evidencing the presence of active communities in the landscape from this period. Similarly, cropmarks of earthworks including enclosures and field boundaries, as well as evidence of metal working, has been recorded within the study area which likely date from the Iron Age. These demonstrate the establishing of settled communities within the local landscape, with records largely concentrated on the north of the River Nene.

### **Roman (43 ACE – 409 ACE)**

- 6.2.84. During the Roman period, archaeological evidence indicates that the area surrounding the Site was rural and understood to be dotted with small farmsteads or villas, with various roads interspersed through the area. Aerial survey across the study area has identified a number of cropmarks of possible enclosures and field boundaries of Roman date, suggesting Roman activity within local landscape. Metal detecting surveys, fieldwalking surveys, and river finds dispersed through the study area have identified various items dating to the Roman period, including, coins, metal vessels and tankards, large amounts of pottery including high quality samian ware, and building remains indicative of a well settled population. Production can also be observed, with findings such as roman era slag (02134, 01590) indicative of metalworking taking place within land surrounding the Site. All of these records are indicative of a relatively high Roman presence within the local landscape surrounding the Site, and areas of



excavation such as a Roman villa to the south of the A47 (01991) within the Proposed Scheme Boundary reinforce this theory.

### **Early Medieval (410 ACE – 1066 ACE)**

- 6.2.85. Records of Anglo-Saxon activity within the study area consist of dispersed evidence of small-scale settlement identified by scatters of datable pottery mostly discovered by fieldwalking or small-scale watching brief excavation.
- 6.2.86. A moot (11837) is theorised to have existed on the southern fringes of modern Wansford according to documentary evidence (Meaney 1994, 67-92). This supports theories of a dispersed but collectively governed community across the local landscape, maintaining that much of the land would be under pastoral or agricultural use. However, very limited inhumation evidence has been recovered, with the sole example being a singular burial with an iron spearhead discovered in 1888 (02003).
- 6.2.87. By the end of the Saxon period, the site would have fallen within the ancient Hundred of Upton. It had a recorded population of 18 households in 1086 (Open Domesday 2018), and the majority of the local economy was supported by farming as evidenced by the presence of smallholders and plough teams. A church is also recorded, along with a total of 17 acres of meadow, 50 \* 15 perches of woodland, and 1 mill valued at 8 shillings. This mill was likely located on the current site of Sacrewell farm and mill.

### **Medieval (1066 – 1550)**

- 6.2.88. Aerial and walkover survey alongside previous archaeological excavation has identified cropmarks and earthworks which likely date from the medieval period and which evidence field boundaries and local track network within the study area. This coupled with the presence of parish churches dating to the medieval period across the study area points to an established medieval landscape and community. These combined with findspots scattered throughout the study area total 30 sites of a medieval date.
- 6.2.89. A degree of land abandonment does appear to have occurred during the medieval period. The deserted medieval village of Sibberton (00040) is located to the west of The Scheme, along the route of the A47, and is commemorated by the name of Sibberton Lodge (00116). The reason for this desertion is unknown, but factors could include landscape change or population decline due to factors such as the black death.

## Post-Medieval (1550 – 1900)

- 6.2.90. The landscape appears to have remained rural agricultural from the Roman period onwards and historical maps show little alteration to the landscape from the 19<sup>th</sup> century onwards.
- 6.2.91. Much of the built heritage within the ZTV dates to this period, with a strong theme in the building materials and methods used. This period is when the region as we see it today came to fruition, and land use has remained relatively unchanged through this period, especially within the area surrounding Sacrewell Farm to the north of the Proposed Scheme.
- 6.2.92. The Peterborough Unitary Authority Historic Landscape Characterisation Programme (Lock 2003) identified the majority of land within the study area as working agricultural countryside with dispersed settlements, farmsteads, enclosure and prairie fields dating to the later part of the Post-Medieval period, with a small amount of ancient woodland within small sections of the study area.
- 6.2.93. The map regression section below provides analysis of the post medieval to modern development of the local landscape within the study area.

## Modern (AD 1900 – Present)

- 6.2.94. The Peterborough Unitary Authority Historic Landscape Characterisation Programme (Lock 2003) describes a landscape which has remained relatively unchanged throughout the modern period. settlements have expanded somewhat, but the character of the region on the whole has been untouched by this.
- 6.2.95. Modern undesignated heritage assets mostly relate to World War II and comprise defensive systems or the crash sites of military aircraft, and these defences demonstrate a small part of the multiple lines of defence spanning the English countryside from the 1940s onwards.
- 6.2.96. The map regression section below provides analysis of the post medieval to modern development of the local landscape within the study area.

## Map regression

### 1886-92 1<sup>st</sup> Edition County Series Mapping (1:10,560)

- 6.2.97. 8 previously unidentified assets were identified during this map regression and can be found within *table X: Assessment of Value/Sensitivity* under the WAN reference.



6.2.98. The 1<sup>st</sup> edition 1886-1892 County Series mapping (1:10,560 Figure 1) demonstrates the rural nature of the landscape, with the small nucleated settlements of Wansford, Thornaugh, Sibbington, Sutton and Upton visible in their respective modern locations. The land within the Proposed Scheme boundary consisted of pastoral and agricultural fields with roads throughout adhering to their modern locations. The construction of the A47 for the most part followed the footprint of the main east-west road visible on the 1<sup>st</sup> edition mapping, with the exception of following the river along the route of what is now access for a picnic site.

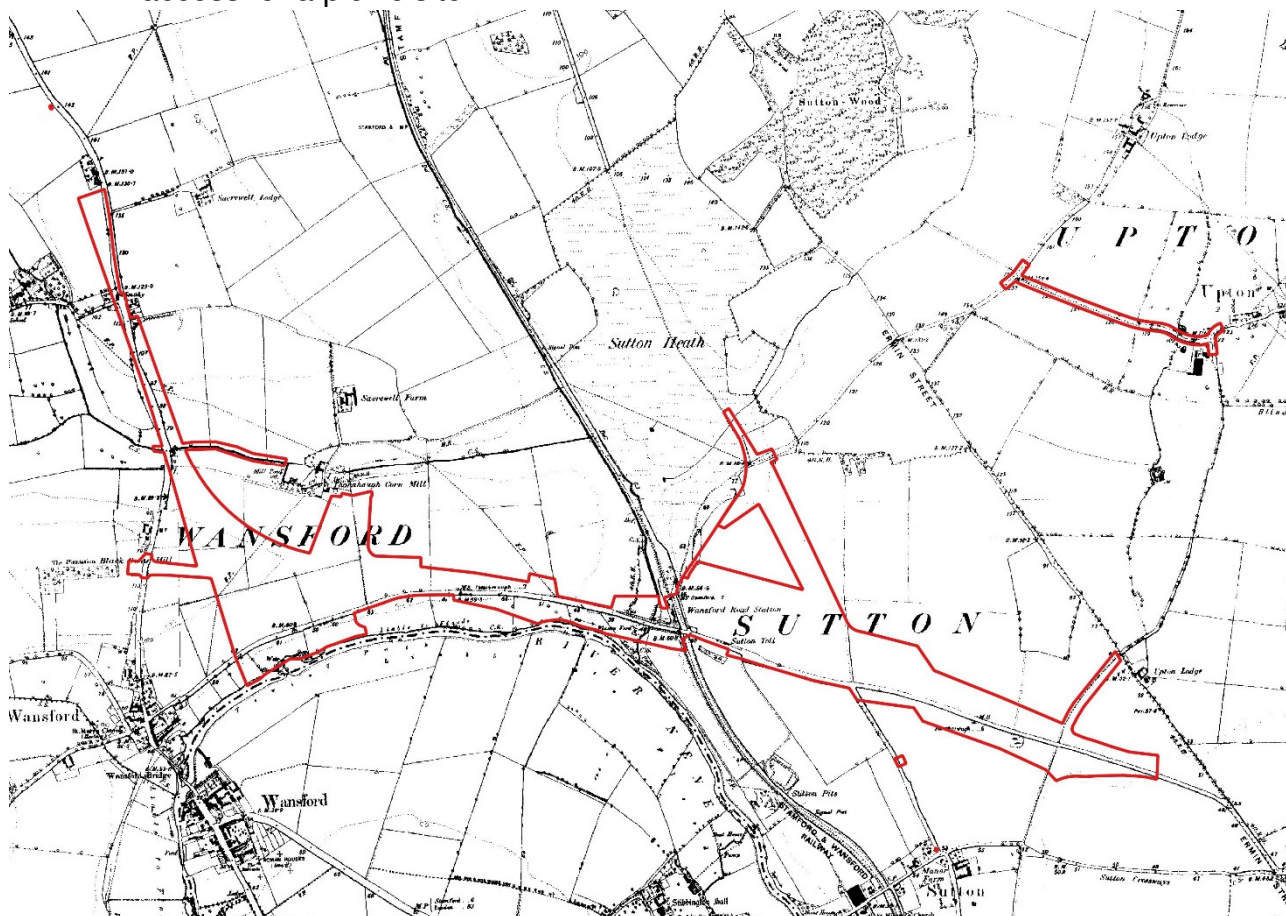


Figure 1 1886-92 1st Edition County Series Mapping (1:10,560)

6.2.99. The former smithy (53699) is visible at the north of the Scheme, with a guidepost (WAN3) adjacent. The weir (WAN4) is shown at the River Nene, potentially linking to the towing path. A former milestone “Peterborough 7” is shown on the north side of the road (WAN5) and another (WAN7) is shown close to Wansford Road Station (WAN1) and an un-named building, the station masters house (WAN10). Details around the station are vague, given the scale of the map but, the bridge (WAN2) is clearly shown and a structure is shown which is probably the linesmans’ hut.

6.2.100. To the east of the station, a small structure (WAN8) is labelled “Sutton Toll”, with what appear to be small yards to the either side. Another milestone

“Peterborough 6” (WAN9) at the eastern end of the Proposed Scheme. Just beyond this, a small square pond is shown (WAN12)

6.2.101. The road at Upton is shown on its present layout, with the listed wall and farmhouse shown but not labelled.

6.2.102. Of the assets noted from this map, only the station buildings and heath house are still extant.

### 1896-1899 1st edition County Series Mapping (1:2,500)

6.2.103. Very little difference is shown between the above map and this one. However, the station buildings and Sutton Toll are more clearly depicted (Figure 2 below).

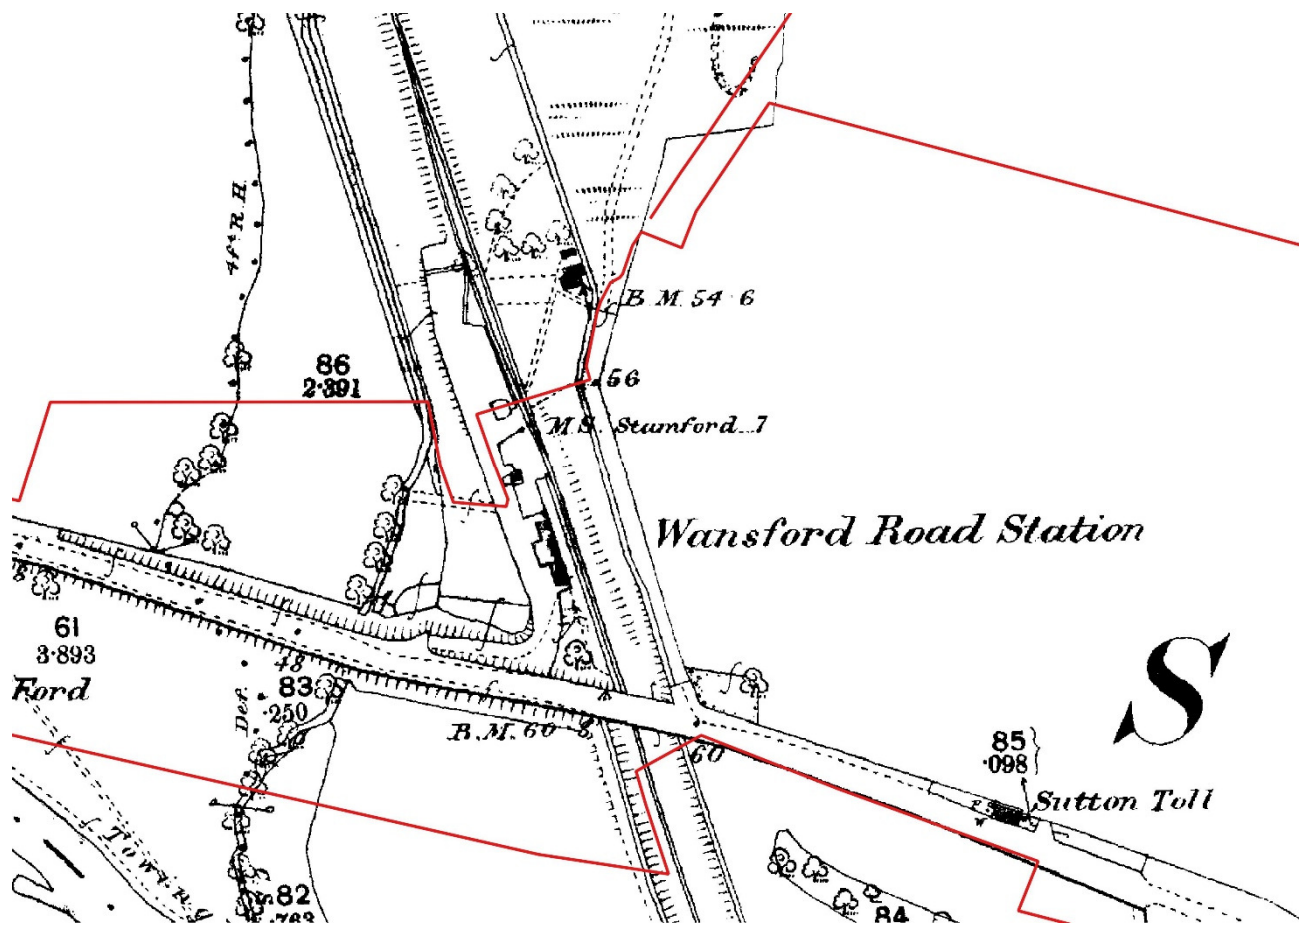


Figure 2 1896-1899 1st Edition County Series Mapping (1:2,500)

6.2.104. Here, the link between the station and the station masters house is shown in the several footpaths between the track and house. The platform is shown clearly, extending from the south side of the station and approximately 10m further north. The hut is shown surrounded with presumably walls or fencing, and a single-track siding is depicted to the north, just outside the Proposed Scheme boundary.

## 1901-1902 1st Revision County Series Mapping (1:10,560)

6.2.105. The 1<sup>st</sup> revision 1901-1902 County Series mapping (1:10,560 Figure 3) shows very little change in the landscape during this period, save for a newly labelled footbridge at the weir and a signal post at the station.

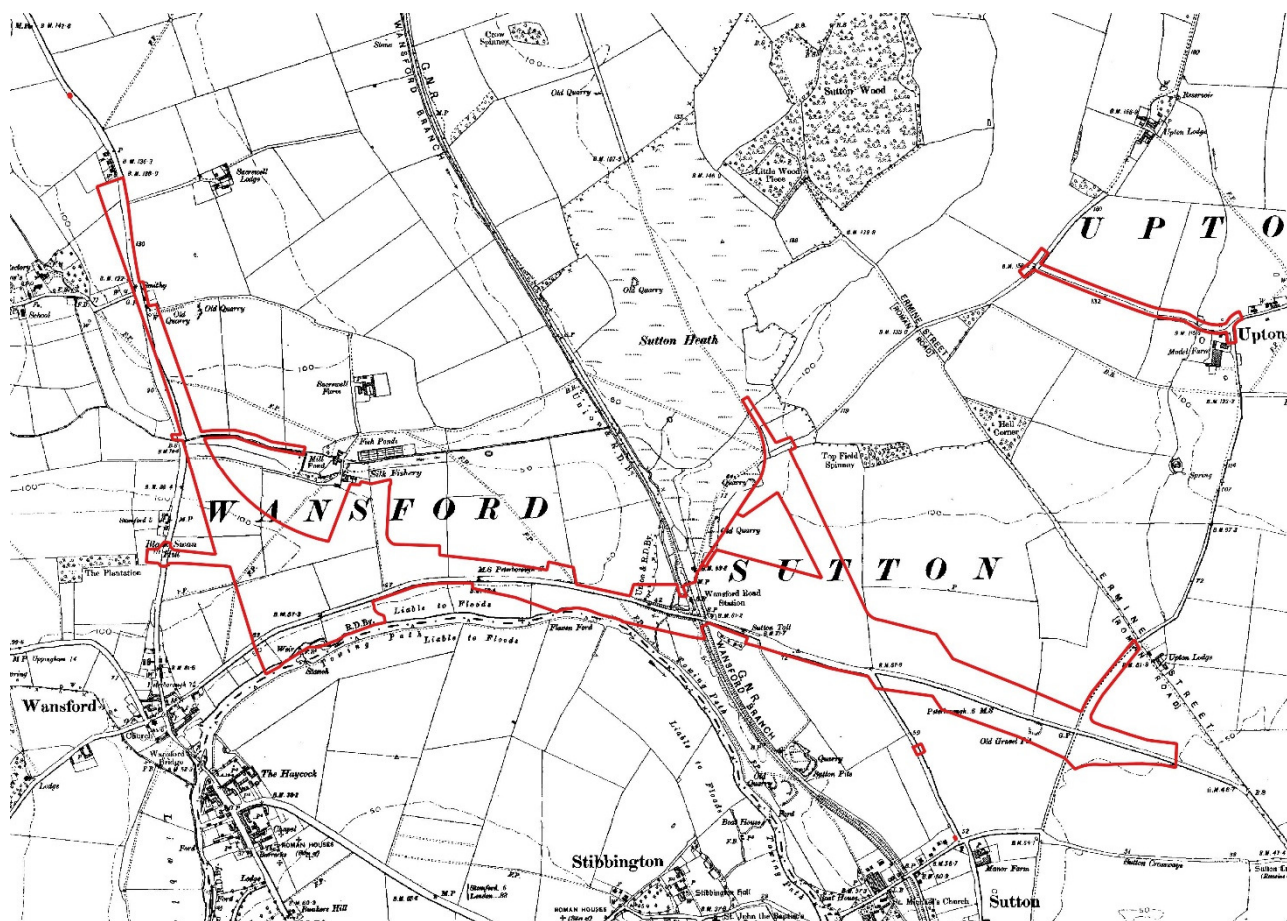


Figure 3 1901-1902 1st revision County Series Mapping (1:10,560)

## 1900-1902 1<sup>st</sup> Revision County Series Mapping (1:2,500)

6.2.106. The mapping for the 1<sup>st</sup> revision 1900-1902 County Series mapping (1:2,500) again shows little change other than: previously quite vague boundary lines in the north of the scheme (WAN10) now labelled as “old quarry” and the square pond (WAN12) is now labelled as “old gravel pit”.

6.2.107. Figure 4 shows the clearest depiction of the layout of the Wansford Road Station (WAN1) and related features of any mapping before or since. The sidings have been extended south and a cattle pen is now labelled. The linesmans hut is now shown adjacent to a square enclosure or platform and the label “W.M” here is likely to stand for “weighing machine”. A signal box is labelled (“S.B”) but no



location is indicated. The footpaths linking the station master's house (WAN11) to the tracks are no longer depicted.

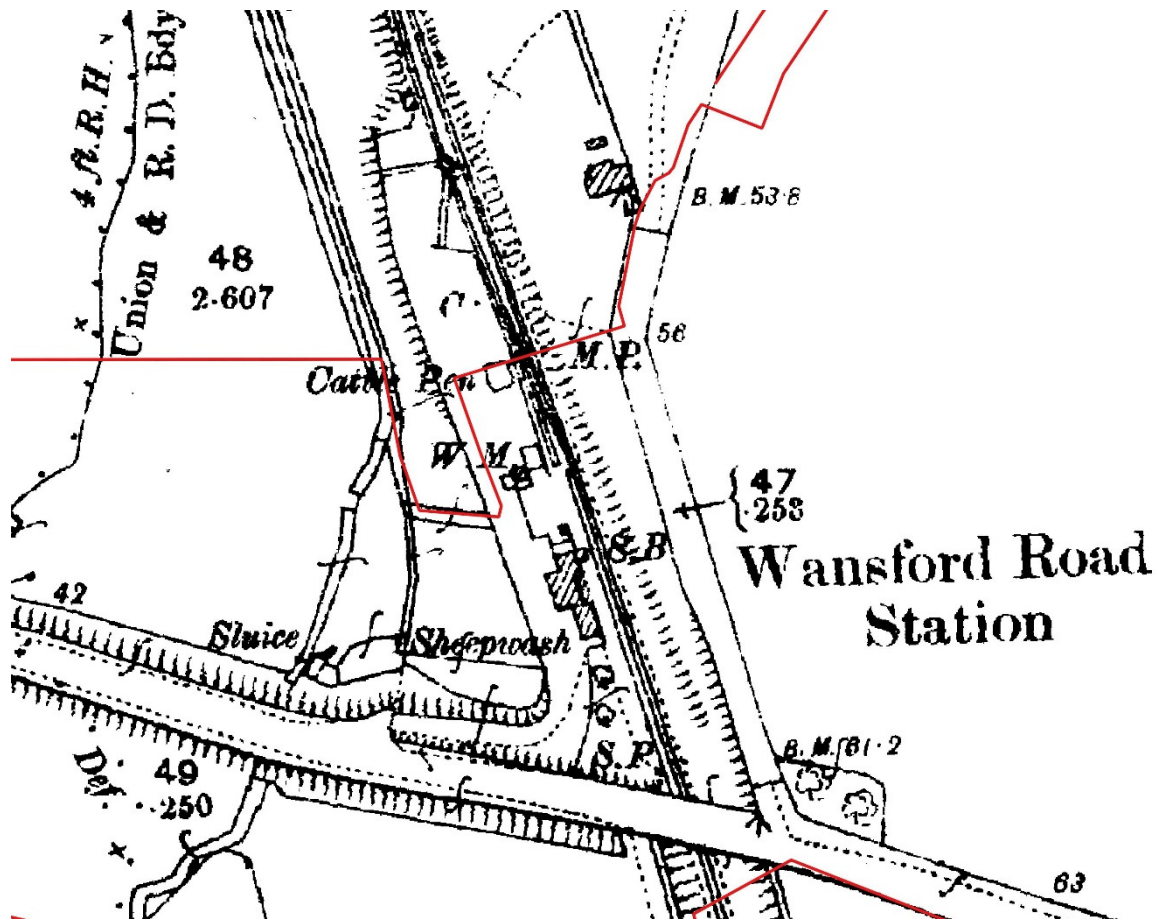


Figure 4 1900-1902 1st revision County Series Mapping (1:2,500)

### 1958 1<sup>st</sup> Imperial Edition (1:10,560)

6.2.108. The area within the scheme footprint does not appear on any updated mapping until 1958 (Figure 5). The changes of note are the absence of the weir (WAN4) and the re-routing of the Great North Road to Bypass Wansford. The station is no longer labelled, as it had fallen out of use, and the track is shown as an earthwork rather than a railway line. Sutton heath road had been extended north, past the station masters house. The label "Roman building (site of)" (00131) is shown for the first time.

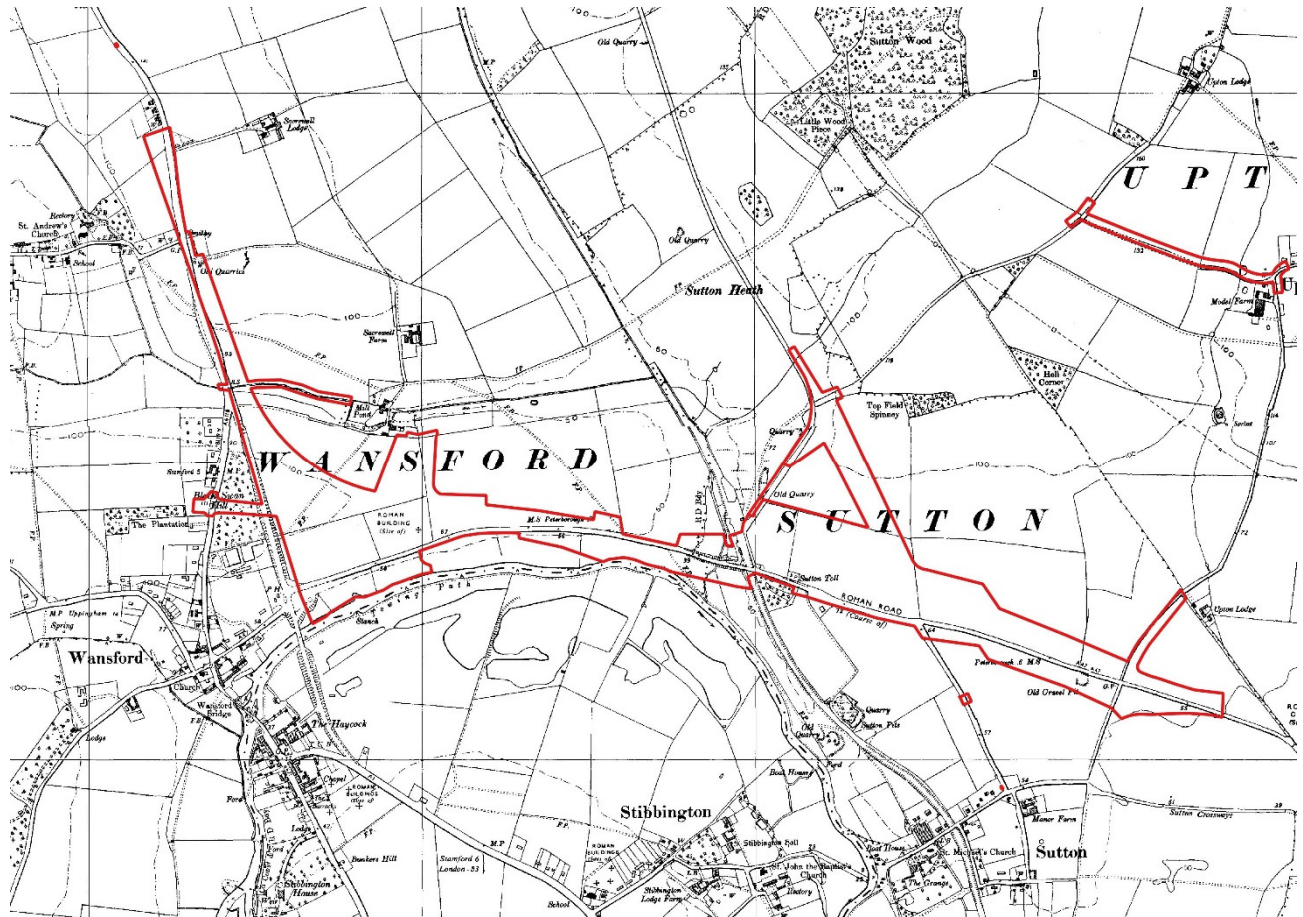


Figure 5 1958 1st imperial Edition (1:10,560)

## 1975 National Grid 1<sup>st</sup> Edition (1:2,500)

6.2.109. The Great North Road and the A47 are shown to have had significant upgrades, shifting to their current configuration (Figure 6). This included construction of the current access road to Sacrewell Farm. A small, unlabelled structure is shown adjacent to the access road, which could be the Royal Observer Corps site (50635). The smithy (53699) is no longer shown, presumably removed by road construction. WAN3,10, 7 and 8 are also absent.

## Site visit

6.2.110. Site visits were conducted in May of 2020 to visit recorded assets and potentially identify any previously known heritage assets. This included “windshield” survey of the wider area to verify the suitability of the study area and ensure no potentially significant impacts were missed. Conditions were clear and bright good visibility. Two additional windshield surveys were undertaken over the course of early 2020, taking advantage of unrelated opportunities to visit the area. The assessors were also fortunate to be able to draw on experience from site visits for previous, unrelated, heritage projects in and around Wansford between 2018 and 2019.

6.2.111. The results are discussed along with the relevant assets and assessment of impacts below and in ES Chapter 6 (Cultural Heritage) (**TR010039/APP/6.1**).

## Results of Fieldwork

6.2.112. A programme of archaeological evaluation was undertaken between 2018 and 2020 to inform scheme design options and the need for further mitigation within the Proposed Scheme. Summaries and full reports are provided in separate appendices. Additional survey and assessment undertaken by third parties has also been included as appendices, with permission, where directly relevant to the Proposed Scheme. In brief these consisted of:

- Appendix 6.2 – Wansford to Sutton Dualling Geophysical Survey (WYAS 2018. Report No: 3135) (**TR010039/APP/6.3**)
  - Large amounts of disturbance noted related to utilities and construction south of the existing A47. Large numbers of rectilinear and curvilinear and anomalies indicative of possible prehistoric and later activity, mostly north of the existing A47.
- Appendix 6.3 – Geophysical and Metal Detector Survey (Magnitude Surveys 2020) (**TR010039/APP/6.3**)
  - Poor results due to ground conditions and small survey size, but broadly in line with earlier survey interpretation. No significant anomalies.
- Appendix 6.4 Archaeological observation during geotechnical investigations (MOLA 2018. Report No: 18/149) (**TR010039/APP/6.3**)
  - Late medieval and post-medieval nails were recovered, along with indications of an in-filled post-medieval pond.
- Appendix 6.5 – Geophysical survey of the scheduled monument (Headland Archaeology 2017. Report No: WSRS/01) (**TR010039/APP/6.3**)
  - Survey of the scheduled barrow cemetery cropmarks (1006796). Identified more extensive anomalies indicative of prehistoric activity, as well as possible later quarrying
- Appendix 6.6 – Archaeological trial trenching survey (Cotswold Archaeology 2020) (**TR010039/APP/6.3**)
  - Identified remains indicative of prehistoric, Roman, early, late and post-medieval activity. Trenching identified some features that were not detected by geophysical survey.
- Appendix 6.7 – Former Wansford Road Station Building Advice Report (Historic England 2018) (**TR010039/APP/6.3**)
  - Factual report, assessment of significance and decision-making rationale for the determination not to add the station buildings to the list.

### 6.3. Methodology for Impact Assessment

- 6.3.1. In addition to DMRB criteria, the following methodology has been used as a guide for professional judgement.
- 6.3.2. The assessment of value/sensitivity derives from a combination of designated status and professional judgement. The Secretary of State's non-statutory criteria for the scheduling of ancient monuments assessment criteria adopted by Historic England as part of the Monument Protection Programme (MPP), and the Secretary of State's Principles of Selection for Listing Buildings (DCMS 2018), are considered as part of this assessment.
- 6.3.3. Within national planning policy and guidance, the value attributed to a heritage asset is referred to as its "significance". To prevent confusion with Environmental Impact Assessment (EIA) terminology regarding "significance of effect" this assessment will use the phrase "heritage value" in place of "significance" when referring to heritage assets. The definition attributed to "heritage value" remains unchanged from that attributed to "significance" in national planning policy and guidance.
- 6.3.4. The assessment has also considered that occasionally some heritage assets have a lower or higher than normal value/sensitivity within a local context. In addition, the assessment process has considered the component of the heritage asset that is being affected and the ability of the heritage asset to absorb change without compromising the understanding or appreciation of the resource.
- 6.3.5. It is worth clarifying that the terminology of "Value/Sensitivity" is a measure of the relative importance of an asset and should not be confused with the sensitivity to change or certain types of change within any one asset. For instance, a particular (theoretical) grade I listed building where its importance is bound up with a small amount of ancient fabric but, where its wider setting is relatively unimportant, might not be highly sensitive to change in the surrounding landscape. This kind of sensitivity is addressed as part of the assessment of magnitude of impact.

Table 1: Criteria for assessing Value/Sensitivity

Value/Sensitivity	Typical criteria
Very high	World Heritage sites, assets of acknowledged international importance, assets that can contribute significantly to acknowledged international research objectives.
High	Scheduled monuments, grade I and II* listed buildings, grade I and II* registered parks and gardens, registered battlefields, undesignated assets of schedulable quality, undesignated monuments, sites or landscapes that can be shown to have specific nationally important qualities and assets that can contribute significantly to national



Value/Sensitivity	Typical criteria
	research objectives. Grade II listed buildings can also be of high value and are assessed on an individual basis
Medium	Grade II listed buildings, grade II registered parks and gardens, conservation areas, undesignated sites of high importance identified through research or survey, monuments or sites that can be shown to have important qualities in their fabric or historical association. Locally listed buildings can be of medium or low value and are assessed on an individual basis
Low	Undesignated assets - buildings, structures, monuments or archaeological sites with a local importance for education or cultural appreciation, and which add to local archaeological and historical research. Very badly damaged assets that are of such poor quality that they cannot be classed as high or medium, parks and gardens of local interest. Locally listed buildings can be of medium or low value and are assessed on an individual basis
Negligible	Heritage resources identified as being of little historic, evidential, aesthetic or communal interest, resources whose importance is compromised by poor preservation or survival or by contextual associations to justify inclusion into a higher grade.

6.3.6. The assessment of the degree of impact on the heritage asset from the Proposed Scheme has been guided by the criteria outlined in Table 2.

Table 2: Criteria for assessing magnitude of impact

Magnitude	Criteria
Major adverse	Total loss or fundamental alteration to heritage asset's significance or setting. Addition of new features that substantially alter the setting of a heritage asset.
Moderate adverse	Partial loss or alteration to a heritage asset's significance or its setting. Addition of new features that partially alter setting of a heritage asset to the extent where the significance is impacted.
Minor adverse	Minor loss of an element of a heritage asset or its setting. Addition of new features that form largely inconspicuous elements in the setting of a heritage asset to the extent that its significance is slightly impacted.
Negligible adverse	Very minor loss of elements of a heritage asset or its setting. Addition of new features that do not alter the setting of a heritage asset.
No change	No change to the heritage asset.
Negligible beneficial	Very minor enhancements to the heritage asset or its setting that help slightly better reveal the assets heritage value.
Minor beneficial	Changes that have a limited benefit to the heritage value of the asset.  Changes to the setting of the asset which have a slight beneficial impact on heritage value and enhance the ability to understand the asset its historic context and setting.
Moderate beneficial	Changes that are beneficial to the heritage value of the asset.



	Changes that result in the setting of the asset being noticeably enhanced and improving the ability to understand the asset and its historic context and setting.
Major beneficial	Changes that are extremely beneficial to the value of the asset.  Comprehensive changes to the setting of the asset which greatly reveal and enhance its heritage value.

- 6.3.7. The significance of effect will be established by combining the assessment of both the value/sensitivity of a heritage asset with the magnitude of the impact as described in DMRB LA104. In accordance with DMRB, moderate, large or very large effects are considered significant.

Table 3. Criteria for assessing Significance of Effect

Heritage Value	Very High	Neutral	Slight	Moderate/Large	Large/Very Large	Very large
	High	Neutral	Slight	Moderate/Slight	Moderate/Large	Large/Very Large
	Medium	Neutral	Neutral/Slight	Slight	Moderate	Moderate/Large
	Low	Neutral	Neutral/Slight	Neutral/Slight	Slight	Slight/Moderate
	Negligible	Neutral	Neutral	Neutral/Slight	Neutral/Slight	Slight
		No Change	Negligible	Minor	Moderate	Major
Magnitude of Impact						

- 6.3.8. The assessment has considered both designated and non-designated heritage assets, including listed buildings, non-designated below-ground archaeological remains, locally recorded historically important buildings, locally important buildings or structures identified during survey work, and historic landscapes. There were no scheduled monuments, registered parks and gardens or conservation areas located within the study area.
- 6.3.9. Both temporary and permanent construction and operational effects on heritage assets have been considered in this assessment. Temporary effects will be from construction related activities and could include effects on an asset's setting through increased noise or visual intrusion, whereas permanent effects can be either physical effects on the integrity of the asset or effects on their setting.
- 6.3.10. The following impact assessments review any potential impact of the Proposed Scheme on both designated and non-designated heritage assets above and below ground within the ZTV. New information regarding some of the heritage assets as well as new assets may be identified through the planned trial trenching evaluation which is to be undertaken as part of the Proposed Scheme. The assessments will need to be updated once the results have been received.

## 6.4. Assessment of Value/Sensitivity

Table 4 Assessment of Value/Sensitivity

NHLE/HER/ WAN Ref	Designation	Name	Description	NGR	Value / Sensitivity
1006835 / 1127445 / 00126	Scheduled Monument, Grade I listed Building	Wansford Bridge	Built from 1577. Fine ashlar bridge over River Nene. Total of 12 arches. The south end rebuilt in 1795 has small round arch and wide elliptical rusticated arch with date in oval panel above key block.	507467,299141	High
1006880	Scheduled Monument	Sutton Heath, Romano-British site	Identified by aerial photography. No further info. No upstanding remains	509011,300964	High
1006836	Scheduled Monument	Wansford Roman site	Identified by aerial photography. No further info. No upstanding remains	507763 298834	High
1006796	Scheduled Monument	Cropmark site of a barrow cemetery and a quadrilateral ditched enclosure, together with pits and a pit alignment, approximately 837m south-east of Sacrewell Farmhouse	Identified from aerial photography and subject to geophysical survey (appendix 6.5) (TR010039/APP/6.3). No upstanding remains.	508669,299842	High
1006837 / 00267	Scheduled Monument	Roman fort and enclosure at Sutton Cross	Small rectangular fort 250 feet x 400 feet; also a 300 feet x 350 feet enclosure to the NW. This only shows on air photos. The land is under crops. The site lies immediately adjacent to Ermine Street, where the Ro Road is now the A47. Under wheat.	510716,299088	High
1006810	Scheduled Monument	Shrunken Village at Upton	Identified by aerial photography. No further info. No upstanding remains	510924,300534	High
1006847	Scheduled Monument	Moated Site, Castor Manor Farm	No further info. No upstanding remains	511895 298476	High
1006864	Scheduled Monument	Roman Site in Normangate Field	Identified by aerial photography. No further info. No upstanding remains	511269 298173	High
1006863	Scheduled Monument	Site of Roman Villa NE of Sibson Hollow	Identified by aerial photography. No further info. No upstanding remains	510443 297856	High
1006862	Scheduled Monument	Roman Villa SW of Castor Station	No further info. No upstanding remains	511022 297731	High
1020124	Scheduled Monument	Bowl Barrow 450m North East of Water Newton Mill	No further info. No upstanding remains	511260 297705	High

# A47 WANSFORD TO SUTTON DUALLING

## Appendix 6.1 Cultural Heritage Information

NHLE/HER/ WAN Ref	Designation	Name	Description	NGR	Value / Sensitivity
1021429	Scheduled Monument	The Fort and Roman Walled Town of Durobrivae and its South, West and East Suburbs, Immediately South and East of Water Newton Village	Identified through Aerial photography and archaeological investigations. Upstanding earthworks are not within the study area	511873 297057	High
1126807	Listed Building Grade II	Village Farmhouse	Probably C15/16 origin, with C16/17 alterations. Coursed stone rubble house with Collyweston stone roof. H-shaped on plan with gabled wings with stone coping, the left hand gable has apex stone and kneelers. Two storeys. 1:3:1 bays. One and 3-light casements with glazing bars. Glazed door off centre. Two brick ridge stacks over centre. Depressed chamfered arch doorway in east side with small cusped window above. Interior: stone ogee arch in passage. East wing has moulded ceiling beams. Stopped and chamfered ceiling beam in centre room.	512056 298670	High
1126866	Listed Building Grade II	Spring Cottage	Dated 1811. Coursed stone rubble cottage. Pantile roof with gabled ends. Two storeys. Three windows of 3:2:3-lights, casements with glazing bars. On the ground floor 2 windows of 3-lights, stone flat arches with triple keystone. Similar head to doorway with modern door. Two brick chimneys at gable ends.	511742 298751	Medium
1126867	Listed Building Grade II	115 Peterborough Road	Late C18 house. White painted brick. Roof concealed behind parapet which has 5 blank panels. Two storeys. Five windows. Three are two-light casements with glazing bars, 2 have modern windows. Ground floor modern fenestration. Tudor arch carriageway is now a doorway	511742 298751	Medium
1126868	Listed Building Grade II	Wheatsheaf Public House	Early C19 house. Stone with dressed stone front and with Welsh slate roof with gabled ends. Stone band at first floor level. Two storeys. Three windows. Later sashes without glazing bars in original openings with plain stone lintels. Reeded doorcase with plinth blocks, small pediment, rectangular fanlight with ornamental glazing and double half glazed doors. To left, a single storey rubble extension with stone slate roof, three irregular modern casement windows, wooden lintels, and modern door.	511701 298776	Medium
1126897	Listed Building Grade II	Thatchcroft	C17/18 cottage. Coursed rubble, rusticated quoins. Thatched roof with gabled ends. Inscription CS and date in south end gable. Rendered end stack. One storey and attics. One dormer at eaves. One ground floor window. Modern casements. Ledged door. Rendered lintels. Early C19 left hand (north) wing with modern brick stack at north end. Modern lean-to extension at rear. Sun fire insurance plaque.	511843 299005	Medium
1127436	Listed Building Grade II	Sutton Cross	Sutton Cross TL 19 NW 17/718 14.11.74 II 2. Base stone of medieval cross at junction of Sutton Crossways and Ermine Street	510768,298839	High
1126863	Listed Building Grade II	12 Allotment lane	C17/18 cottage. Coursed stone rubble. Thatched roof with gabled ends. Rebuilt brick and stacks. One storey and attics. Two dormers. Two ground floor windows with chamfered wooden lintels, 2-light casements with glazing bars, and one small window to right. Plain central doorway with plank door	512184 298708	Medium

# A47 WANSFORD TO SUTTON DUALLING

## Appendix 6.1 Cultural Heritage Information

NHLE/HER/ WAN Ref	Designation	Name	Description	NGR	Value / Sensitivity
1126864	Listed Building Grade II	Kek cottage	Early C18 cottage. White painted rubble, rendered to side. Thatched roof with gabled ends. One storey and attics. Two gabled dormers at eaves. Three windows, casements with glazing bars and wooden lintels. Two rebuilt brick chimney stacks at gable ends. At south end a modern single storey one window wing with steeply pitched slate roof	511778 299149	Medium
1126865	Listed Building Grade II	51 Main Street	C17 cottage at right angles to road. Whitewashed rubble. Steeply pitched thatched roof with coped gabled ends. One storey and attics. Three window range. Two dormers at eaves. Casements and plain doorway with wooden lintels. Central ridge chimney stack. Exterior with slate roof to left.	511749 299157	High
1126898	Listed Building Grade II	South View	C18 cottage. Coursed rubble with stone quoins. At right angles to road. Thatched roof with gabled ends. One storey and attics. Two dormers at eaves. Two windows and 2 doors under continuous wooden lintel. C19 casements. Pantiled lean-to extension to rear. Two rendered chimneys at gable ends.	511851 299015	Medium
1126899	Listed Building Grade II	44 main Street	C17 range of cottages at right angles to road. Random rubble with stone dressings. Thatched roof with gabled ends. One storey and attic. Three dormers. Two small casement windows under wooden lintels. Left hand one storey extension. Some modern windows to rear. Brick ridge chimney stacks	511786 299066	High
1126900	Listed Building Grade II	The Cottage	C17 house remodelled in 1863 (datestone in gable). Long coursed stone rubble range. Now tile roofs with stone coped gable ends. South end has lower roof. Two storeys. Four/five window range, gabled at north end and with gabled first windows. C19 two- and three-light mullion windows. C19 splayed bay and stone porch at north end. Brick chimney stacks. Modern extensions at rear. Interior stopped chamfer ceiling beams	511811 299153	High
1126901	Listed Building Grade II	Walnut House	Probably C17. Stone rubble house with large quoins. Steeply pitched wood shingle roof with gabled ends. Stone end chimney stacks with brick tops and brick ridge stack off centre. Two storeys. Three window range. Three-light casements and modern central door. One buttress on front wall Circa C18 wing to right at right angles forming L-shaped plan; with lower pantile roof, two storeys, two windows, casements.	511740 299032	High
1126902	Listed Building Grade II	19 Main Street	C17 cottage at right angles to road. Coursed rubble with ashlar dressings. Thatched roof with stone coping to gable ends. One storey and attics. Two dormers at eaves. Two window range. Modern casements with glazing bars under wooden lintels. Two doors, one with trellis porch, one plain with wooden lintel. Stone quoins. One central modern brick chimney stack	511754 299044	High
1126903	Listed Building Grade II	39 Main Street	C18 house with early C19 wing forming L-shaped plan. Low pitched hipped and gabled ended roofs. Two storeys. The C18 part has metalframe casements with glazing bars and has modern extension to north in similar style. The early C19 wing has modern casements and lintels with keyblocks. Rendered and brick chimney stacks. House contains disused bakery ovens	511760 299093	Medium
1126904	Listed Building Grade II	43 Main Street	C18 cottage. Coursed stone rubble. New thatched roof with 2 large dormers, and coped gable ends. One storey and attic. Ground floor 4 casements with glazing bars and modern plank door. Rebuilt brick chimney stacks	511755 299117	Medium

# A47 WANSFORD TO SUTTON DUALLING

## Appendix 6.1 Cultural Heritage Information

NHLE/HER/ WAN Ref	Designation	Name	Description	NGR	Value / Sensitivity
1126905	Listed Building Grade II	47 Main Street	C18 cottage. Coursed stone rubble. Low pitched new pantile roof with gabled ends. Two wedge-shaped dormers. One storey and attic. Two casements with glazing bars. Wooden trellis porch. Rebuilt brick chimney stack at end	511742 299119	Medium
1127437	Listed Building Grade II	Top Lodge Farmhouse	Late C18/early C19 house. Coursed stone with ashlar dressings. Collyweston stone roof with coped gable ends. Two storeys and attic. Three window range. First floor, modern 2-and 3- light casements. Ground floor, 2 modern bay windows and central doorway with stone basket arch with keyblock and fanlight. Two gabled dormers with ornate pierced bargeboards. Ashlar internal end chimney stacks. C18 stone wing at rear with lower Collyweston stone roof. Situated at right angles to road with outbuildings adjoining north-west end.	510339,301064	Medium
1127438	Listed Building Grade II	Wall to East of Model Farmhouse Fronting Road and Turning Westwards at Road Junction	Wall to east of Model Farmhouse fronting road and turning westwards at road junction TF 10 SW 10/665 II GV 2. Probably C18. Tall coursed stone rubble boundary wall on 2 sides of garden. String course near top with about 6 diminishing courses above with stone capping. Stone quoins. Included for group value	510567,300421	Medium
1127439	Listed Building Grade II	Dovecot East South East of Manor House	Dovecot east-south-east of Manor House TF 10 SW 10/670 II GV 2. C18 square building with pyramidal Collyweston stone roof. Lantern missing. Two storeys. First floor loft has resting holes. Ground floor stables have central stable door and windows either side.	511100,300484	Medium
1127440	Listed Building Grade I	Church of St John The Baptist	C12 but largely rebuilt in C17 Gothic, and with chancel of 1842. Nave and north chapel have triple gable to west end, the small centre gable has louvred bell-openings and there is a central buttress with set-offs. Round-arched doorway impost dated "WC(D) 1767" at west end of nave, and 2 large straight-headed west windows with 4 round-headed lights. The north and south windows are similar but of 3-lights. Chancel, rebuilt in 1842, has straight-headed south window with 2 ogee arched lights. Interior: chancel arch has early C12 shafts with scalloped capitals and C17 round arch. Two bay, late C12, north arcade with circular pier and capital with leaves and crockets, and C17 arches. The north aisle was rebuilt to receive the monument to Sir William Dove, 1633, and his 2 wives. He was lord of the manor and son of the Bishop of Peterborough. North aisle has raised floor with large stone balustrade to arcade and steps with panelled newels with ball finials. The monument has 4 columns supporting open segmental pediments, and with 3 recumbent effigies, his second wife in wood, 1667. C17 communion rail with pierced balusters. C17 polygonal pulpit in corner with tester and decorated arched panelled sides. C15 octagonal font with C17 cover. Built of dressed stone and ashlar with Collyweston stone and slate roofs	511022,300583	High
1127441	Listed Building Grade II	Keepers Cottage	Keepers Cottage (formerly listed as Three Cottages 265 yds west of Manor House) TF 10 SW 10/666 2.12.57 II GV 2. C17/18 cottage range. Coursed stone rubble. Thatched roof with half hipped gable ends. One storey and attic. Five attic windows in thatch above eaves level, 2 gabled. Attic windows, 2-light casements with glazing bars. Ground floor, 3 modern casements and modern glazed door. Brick chimney stack off centre.	510826,300522	High

# A47 WANSFORD TO SUTTON DUALLING

## Appendix 6.1 Cultural Heritage Information

NHLE/HER/ WAN Ref	Designation	Name	Description	NGR	Value / Sensitivity
1127442 / 00127	Listed Building Grade I	Church of St Mary The Virgin	The church is N, the village S of the Nene. In the W wall a Saxon window which now investigates the C13 tower.	507342,299258	High
1127443	Listed Building Grade II	Church House	C18 house. Coursed stone with ashlar quoins and window surrounds. Steeply pitched Collyweston stone roof with coping to end gables. Two storeys and attic. Five bays. Sashes with glazing bars, and keyblocked lintels. Central doorway with panelled door, rectangular fanlight and moulded cantilevered hood. Two old hipped dormers with casements with glazing bars. Ashlar end stacks.	507385,299262	Medium
1127456	Listed Building Grade II	Conduit Head Immediately South of Nos 5 And 7	Conduit head immediately south of Nos 5 and 7 TR 0600 44/611 II GV 2. Dated 1839. Small ashlar structure with raised parapet with date in panel and arched recess beneath with iron lion's head fountain with basin below.	506960,300547	Medium
1127457	Listed Building Grade II	Apple Acre Cottage	C17 range of cottages converted into one house. Coursed stone rubble. East end has Collyweston stone roof, the rest has tiles which replace thatch. Two storeys. Three window range. Old casements with leaded panes at right hand end, the rest modern casements. Modern plank door and porch to left. End and ridge stacks. One storey thatched roof addition at west end. Lean- to at rear.	506879,300546	High
1127458 / 00043	Listed Building Grade II*	Manor House	C17 house. Coursed stone with steeply pitched Collyweston stone roof with coped gable ends. Two storeys and attic. Five bays. First floor 2-light wood mullion/transom casements, ground floor 2-light stone mullion windows with cornice over. Moulded string course below eaves and raised over first floor windows. Central doorway with moulded stone architrave and entablature with pulvinated frieze. One small hipped dormer. Internal end stacks with cornices. Two 3 and 4-light stone mullion windows in end wall. Long C19 stone wing at rear with stone mullion windows. Staircase wing at rear with open well stairs with heavy moulded balusters, moulded rail and square reveals. Ovolo moulded chamfers to ceiling beams in hall.	506729,300533	High
1127459	Listed Building Grade II	Thorn Haugh Post Office	Circa 1840-50 estate workers cottage. Stone rubble with steeply pitched Collyweston stone roof with gabled ends. Two storeys. Right hand gabled semi-dormer. Two window range. Moulded stone mullion/transom windows, first floor 2-lights ground floor 3-lights. Central doorway with depressed arch and plank door. Stone end chimney stacks with brick shafts with stone caps	506547,300557	Medium
1127460	Listed Building Grade II	The Former Thornhaugh County Primary School	Mid C19 school converted from earlier building. Single storey stone range with ashlar front and half hipped thatched roof. Seven bays. Two porches with hipped thatched roof and double recessed square headed doorways and boarded doors. Plain 2-light casements with glazing bars. External stone stack on front left, and ridge stack off centre. Rear (west) catslide roof with 2 C19 dormers with timber framing in the gables. And with pierced bargeboards.	506937,300505	Medium
1127463	Listed Building Grade II	Barn to South of Sibberton Lodge	Large C17/18 barn. Coursed stone. Steeply pitched roof with coping to end gables, modern slates. Large barn doors at centre. Small square ventilation holes. Included for group value	506300,299874	Medium
1127493 / 50791	Listed Building Grade II*	Sacrewell Mill and Mill House and Stables	Sacrewell Mill and Mill House [formerly listed as Sacrewell Mill and Mill House (south of village) and stables TF 00 SE 9/604 II 2. Early C18 mill house and water mill dated 1755. Adjoining at right angles. All coursed stone with steeply pitched	507890,300063	High



# A47 WANSFORD TO SUTTON DUALLING

## Appendix 6.1 Cultural Heritage Information

NHLE/HER/ WAN Ref	Designation	Name	Description	NGR	Value / Sensitivity
			Collyweston stone roofs. The house has coped gable ends, and is a 2 storey and attic 3 window range. C18 3-light casements with wooden lintels. Left hand C19 door. Three small C18 hipped dormers with moulded cornices. Centre and end stacks, tops rebuilt in brick. Outshut at rear with hipped dormer. C18 wing to south-west forming L-shaped plan, one storey and attic, 2 small gabled dormers and steeply pitched Collyweston stone roof with coped gable end. Water mill and stables adjoining at right angles to north-west. Very steeply pitched hipped Collyweston stone roof, 2 storeys and attic, 3 gabled dormers, loft door above ground floor door. Contains complete mill machinery in working order with a cast iron overshot wheel and pit wheel. There is great spur wheel and a timber main drive shaft and crown wheel. Two of the original 3 sets of stones remain. There is also a chain hoist operated by the main drive on a windlass principle. Storage bins, shutes and hopper all intact. Including stable wing, now a garage, adjoining north of mill, a long one storey and attic range, also stone, with Collyweston stone roof.		
1127494	Listed Building Grade II	1-7, Meadow Lane	Circa 1830-40 range of cottages, now 2 dwellings. Coursed stone, one storey and attic, 8 window range, stone mullion windows with glazing bars, ledged doors. Nos 5 and 7 possibly earlier origin, has slate roof and 4 gabled dormers with pierced bargeboards. Nos 1 and 3 have thatched roofs with stone coping to gable ends, gabled dormers, 2 stone and 2 wooden with ornate pierced bargeboards. Large end stacks with octagonal square shafts.	506716,300477	Medium
1127495	Listed Building Grade II	Croft Farmhouse	C18 house. Coursed stone. Steeply pitched Collyweston stone roof with stone coping to gable ends. Internal ashlar end stacks. Two storeys and attic. Three window range. Modern casements. Modern central door. Two old hipped dormers with casements.	506758,300438	Medium
1127496 /00224	Listed Building Grade II	The Old Rectory	2 storeys and attics probably built in 2nd half of C16. Long rectangular. C17 additions, flat fronts with old stone mullioned and transomed windows, stone slate roof.	507008,300616	High
1127514 / 00223	Listed Building Grade II	Village Pound	Probably C19. Small rectangular enclosure with "radiused" (sic) angles and gateway to road. Coursed stone walls about 5 feet high, modern gate. On 'The Drift'.	509720,298949	Medium
1127515	Listed Building Grade II	19, Graeme Road	Late C17 cottage with early/mid C19 west wing. Coursed stone rubble with steeply pitched Collyweston stone roof with gabled ends. L-shaped on plan with wing to north-west. One storey and attic. Two and 3-light ovolo moulded stone mullion windows with drip moulds. Central stone stack with cornice	509791,298660	High
1127516	Listed Building Grade II	Manor House	Dated 1700, date of restoration 1900. Coursed stone house with steeply pitched hipped Collyweston stone roof. Moulded string course at ground floor windowhead level. Two storeys and attic. H-shaped on plan. Five bays, end bays project. Two-light moulded stone mullion windows. Moulded stone doorway to right of centre. Centre ground floor Victorian splayed bay window. Two hipped dormers with cornices. Ashlar ridge chimney stacks with shafts and cornices. Interior modernised and few features remain - some chamfered ceiling beams. Bishop Dove lived here in C17	509801,298868	High

# A47 WANSFORD TO SUTTON DUALLING

## Appendix 6.1 Cultural Heritage Information

NHLE/HER/ WAN Ref	Designation	Name	Description	NGR	Value / Sensitivity
1127517 / 00222	Listed Building Grade I	Church of St Michael	Built in the early C12 with the responds of the chancel arch being the only features surviving from that period. The southern aisle was added at the end of the C12 and in the C13 the chancel was enlarged or rebuilt, and a southern chapel added. Further alterations from C15 onwards.	509523,298728	High
1127518 / 00225	Listed Building Grade II	Dovecot East North East of The Grange	Dovecote ENE of The Grange (RN 00221) & S of the church, on the south side of the Nene Way. Probably C18 / C19 coursed stone dovecote with ashlar quoins. Steeply pitched asbestos sheet roof with gabled ends. Later hipped roof lantern on ridge at centre.	509538,298718	Medium
1222046	Listed Building Grade II	Goss Cottage	Mid to late C19 for the Duke of Bedford, possibly by S. S. Teulon. Hammer dressed coursed limestone with freestone dressings. Collyweston stone slated roofs. Ashlar ridge stack and end stacks with moulded courses. One storey and attic. Two boarded doors with flat stone arches rounded at corners to jambs. That to right now replaced by a 2 light window. Four ground floor casement windows with chamfered reveals and ovolo moulded mullions. Three facade dormer windows with shaped barge boards.	507586,298951	Medium
1222417	Listed Building Grade II	Riverside	Cottage and workshop range. Early C18 with late C19 alterations. Coursed limestone rubble with freestone quoins; Collyweston stone slated roofs. One storey and attic forming long L-plan with back range extending to south and including a workshop. North elevation: Gabled canopy to C20 door to right hand and part roof and gabled canopy to left hand window; two gabled dormer windows with casements and patterned barge boards, brick stacks to left hand. South and east elevations: Three stacks; glazed door and sixteen-paned hung sash window to left hand with windows and boarded doors; one first floor loft door approached by wooden steps and five small hipped casement dormer windows two with metal frames and leaded lights. Associated with riverside wharves and used as granaries in 1759, converted to a house c.1850 by L.C. Gilbert, builder.	507489.867,299019	Medium
1222418	Listed Building Grade II	Number 4 (Waters Edge) And Wall and Outbuilding to South East	Cottage, attached wall and outbuilding. Late C17 or early C18 with C19 and C20 alterations and addition. Coursed limestone rubble and freestone dressings; Collyweston stone slated roofs with parapet gables and brick end stack to west partly rebuilt. South elevation: C20 south extension to right hand with pent roof and entrance in angle. Two casement windows at each floor level to left hand. Boundary wall to east; small wash house to south with red pantiled roof and brick stack, boarded doors and window in north elevation. Interior: Chamfered ceiling beams. Associated with riverside wharves and used as granary in 1759, later converted to a house.	507505,299034	High
1222420	Listed Building Grade II	18 20, London Road	Two houses. Dated '1858 B', with coronet on plaque, for the Duke of Bedford, possibly by S.S. Teulon. Hammer dressed limestone with freestone dressings. Collyweston stone slated roofs. Two storeys. Main north-south range with wide gable projecting to left of centre and side stack with tabled offsets to right hand; ridge stack and stacks to rear with moulded courses and ashlar quoins. Closed porch to left hand. Parapet gables with stacks. Chamfered plinth and cills. Chamfered four-centred archway with C20 panelled inner door (No. 20). One three-	507555,299002	Medium



# A47 WANSFORD TO SUTTON DUALLING

## Appendix 6.1 Cultural Heritage Information

NHLE/HER/ WAN Ref	Designation	Name	Description	NGR	Value / Sensitivity
			light and one single-light casement ground floor windows with wooden ovolo mullions and chamfered stone architraves. Similar two light and single-light first floor windows.		
1222421	Listed Building Grade II	Butchers Shop	Two houses and shop. Dated 'I.S.1827' on stone plaque in main elevation, C18 extended to west in C19. Dressed limestone and coursed limestone rubble with freestone dressings. C20 tiled roof; ridge and end stack to left hand with sawtooth brick cornice. Two storeys. Long east-west range with two houses flanking shop. Wooden lintels to all openings. Halved boarded door to shop and window to left hand with common entablature and plain pilasters. Flush- panelled house door to left hand and half-glazed door to right hand, two ground floor sixteen-paned hung sash windows recessed for shutters and five first floor sixteen- and twelve-paned hung sash windows. The shop was built by John Setchall, a butcher.	507612,298994	Medium
1222423	Listed Building Grade II	Barn Circa 50 Metres North East of The Haycock Inn	Barn c.50 metres north-east of The Haycock Inn GV II Barn. Early C19. Coursed limestone rubble with freestone dressings. Collyweston stone slated roof. Central double entrance with boarded doors to south-east elevation and with boarded pitching door; ventilation slits. The Haycock Inn formerly ran a large livery stable and a farm, mentioned in the Bedford Estate records.	507646,299099	Medium
1224316	Listed Building Grade II	1, Nene Way	Probably C17/18 cottage, remodelled in 1888. Coursed stone rubble. Slate roof with gabled ends. Brick chimney stack at each end. Two storeys. Two window range, modern casements with glazing bars, 2-lights to first floor, 3-lights to ground floor, wooden lintels. Ceiling beams. Formerly the Cross Keys public house	509723,298913	High
1224371	Listed Building Grade II	The Grange	Formerly the Vicarage. C17 in origin but remodelled in 1880. The Victorian remodelled house is H shaped on plan, rock faced stone with Collyweston stone roof. Two storeys and attic. Projecting gabled wings with 3 bays between and central gabled porch. C13 window inserted on this elevation with 2 lancet lights beneath a quatrefoil, in a stone architrave with a chevron carved drip head. Old walling on south end of west wing	509477,298676	High
1224408	Listed Building Grade II	12, Nene Way	Circa mid C19 estate cottage. Coursed rock faced stone with ashlar quoins. Collyweston stone roof with gabled ends. One storey and attic. Right hand projecting gable with lean-to porch in angle. Ground floor stone oriel on moulded stone corbel. Two and 3-light metal frame casements with lozenge panes and segmental arches. Stone chimney stacks	509571,298805	Medium
1225258	Listed Building Grade II	Stone Cottage	C18 row of cottages, Coursed stone with Collyweston stone roof with gabled ends. Two storeys. Stone cottage has higher roof level and has stone coped gable, one window range, of C19 casements. No 2 is a 2 window range with modern casements and internal end stacks. Two porches off centre with Collyweston stone roof.	506756,300497	Medium
1225298 / 00046	Listed Building Grade I	Church of St Andrew	From C12, and restored 1889. Built of stone rubble and ashlar with Collyweston stone roofs.	506983,300584	High

# A47 WANSFORD TO SUTTON DUALLING

## Appendix 6.1 Cultural Heritage Information

NHLE/HER/ WAN Ref	Designation	Name	Description	NGR	Value / Sensitivity
1225898	Listed Building Grade II	Elizabethan Cottage	Elizabethan Cottage (formerly listed as Cottage 210 yds west of Church of St John the Baptist) TF 10 SW 10/667 2.12.57 II GV 2. C17 coursed stone rubble cottage at right angles to road. Thatched roof with gabled ends. One storey and attic. Modern attic casement in thatch. One ground floor casement with glazing bars and boarded door to left. Stone end chimney stack. Small single storey wing to right (south) with thatched roof.	510823,300546	High
1225934	Listed Building Grade II	Fielding House	Early C18 house. Coursed stone with a steeply pitched Collyweston stone roof with stone coping to gable ends. Modillion eaves. Two storeys and attic. Three bays. First floor, three C18/19 3-light casements with glazing bars. Ground floor, tripartite sashes with glazing bars and central flush-panelled door with rectangular fanlights. Timber lintels. Three old hipped dormers with casements with glazing bars. Ashlar off centre and end stacks, north end has cornice. Brick rear wall. Early C19 rear wing with late C19 extension with Guthic windows.	507382,299274	Medium
1226378	Listed Building Grade II	K6 Telephone Kiosk	Type K6. Designed 1935 by Sir Giles Gilbert Scott. Made by various contractors. Cut iron. Square kiosk with domed roof. Unperforated crowns to top panels and margin glazing to windows and door.	506727,300495	High
1237866 / 00128	Listed Building Grade II*	The Haycock Hotel	Said to have been built as a posting house, probably in 1632. Converted into a private residence in the mid C19 and reconverted into a hotel in recent years. Two storeys with attics, built of local stone and Collyweston slates on an H-shaped plan.	507563,299057	High
1237907	Listed Building Grade II	Forge and Stable Range Circa 40 Metres North of The Haycock Inn	Forge and stable range c.40 metres north of The Haycock Inn GV II Forge and stable range. C18 and mid C19. Coursed limestone rubble with freestone dressings and Collyweston stone slated and pantiled roofs. Two storey stable range with first floor loft attached to forge by covered way forming L-plan. South-east elevation of stable range; central boarded door and two windows, loft entrance to right hand with boarded door and windows with wooden ventilation slats. Interior with brick forge complete.	507610,299107	High
1238018	Listed Building Grade II	1, Lovers Lane	C17 coursed stone rubble cottage with steeply pitched Collyweston stone roof with gabled ends. Two storeys. Ground floor 2 windows. First floor one window. C19 2-light casements. Central brick chimney stack and end stone stack. Modern one storey concrete extension at rear. Interior: fireplace bressumer is supported on reused C12 carved stones with chevron ornament	509542,298753	High
1265884	Listed Building Grade II	County Boundary Post Beside West Side Cutwater Parapet	County boundary post beside west side cutwater parapet GV II Boundary post. Cast iron, triangular sectioned with concave head painted white and with lettering painted black; inscribed COUNTY BOUNDARY, HUNTINGDON, SOKE OF PETERBOROUGH The above items were originally listed in Huntingdon District - List No 57 dated 6.II.88,	507464,299143	Medium
1266453	Listed Building Grade II	Avebury Cottage	C17/18 row of cottages (now one tenement) with C19 alterations. Coursed stone. Steeply pitched Collyweston stone roof with gable ends. One storey and attic. Four window range. Two C19 stone bay windows and 4 centred arch doorway with modern porch. Left hand of front, wide garage doorway recently inserted. Three dormers, 2 hipped, one gabled. Ashlar ridge and end stacks with cornices. Wing at rear with 2 hipped dormers, stone mullion windows and diagonal stacks.	506749,300402	High

# A47 WANSFORD TO SUTTON DUALLING

## Appendix 6.1 Cultural Heritage Information

NHLE/HER/ WAN Ref	Designation	Name	Description	NGR	Value / Sensitivity
1266496	Listed Building Grade II	Sacrewell Farmhouse	Mid C18 house. Coursed stone. Steeply pitched Collyweston stone roof with gabled ends. Two storeys and attic. Four window range. C19 3-light sashes in stone frames. Central doorway converted to window. Four C19 gabled dormers. Internal ashlar stack at each end and another off centre. Wing at rear.	507958,300272	Medium
1274413	Listed Building Grade II	2, Graeme Road	C17 cottage rebuilt in late C18/early C19. Low pitched Welsh slate roof with gabled ends. Coursed stone rubble with stone quoins. Two storeys. Two windows. Sashes with glazing bars in flush frames. Central boarded door in moulded wood frame. Brick end stacks. Rendered lean-to on east end.	509675,298615	High
1274512	Listed Building Grade II	Drayton Place	House, formerly house and shop. Circa 1820. Dressed limestone with ashlar and freestone dressings; brick in rear elevation. Welsh slate low pitched pyramidal roof, rear brick stack. Three storeys and cellar, square plan with main facade and shop entrance facing north. Former shop with central doorway sealed and patterned rectangular fanlight approached by stone steps and two large windows (originally with small panes); common entablature enriched by deeply moulded wooden cornice. Three first floor recessed sixteen-paned hung sash windows with flat stone arches and flush key stones and stone cills. Three similar second floor windows with twelve panes. West entrance to house with six-flush-panelled door and rectangular fanlight approached by stone steps. Possibly built for Thomas Smith, a grocer, in 1828.	507600,298987	Medium
1274607	Listed Building Grade II	6 8, London Road	Two estate houses. Dated '1857 B' on plaque in north gable wall, built for the Duke of Bedford possibly by S.S. Teulon. Hammer dressed limestone and some red brick with freestone dressings. Plain tiled roofs. Ashlar end stack to left hand with one shaft, and two ridge stacks with two and one shafts and chamfered cornices. Two storeys, double pile plan with extensions. East elevation: Chamfered plinth continuous around projecting gabled wing to right hand and gabled porch to left hand. Panelled door shaped to two-centred chamfered stone arch; chamfered stone architraves to cast iron casement windows with latticed glazing bars, three ground floor three-light and one two-light window and four similar first floor two-light windows. Side entrance to No. 6. The houses are similar to two other groups of estate cottages in Wansford.	507518,299061	Medium
1274652	Listed Building Grade II	The Old House and Rear Boundary Wall	1848 for the Duke of Bedford's steward. Dressed limestone rubble with freestone and ashlar dressings. Welsh slated roofs. Ashlar gable end stacks. Two storeys with attic and cellars, rear addition c.1850 completing double pile plan. Symmetrical facade of three bays; entrance with pilastered stone architrave and three-block rustication to round-headed arch; four-panelled door with patterned round headed fanlight. Ashlar plinth continuous around two, two storey bay windows with chamfered reveals and nine-paned hung sash windows. Central blind window above entrance with moulded cornice. Two C20 casement dormer windows. Cast iron boot scraper beside entrance. Interior details C19, original plan slightly altered to rear.	507544,299015	Medium
1274685	Listed Building Grade II	6 8, Elton Road	Pair of cottages formerly a farmhouse. Late C17 or early C18 with C19 additions and alterations. Coursed dressed limestone and rubble with freestone quoins chamfered and rounded to south. Collyweston stone slated roofs with chamfered	507591,298939	High

# A47 WANSFORD TO SUTTON DUALLING

## Appendix 6.1 Cultural Heritage Information

NHLE/HER/ WAN Ref	Designation	Name	Description	NGR	Value / Sensitivity
			copings to parapet gables; ashlar gable end stack to left hand and tall central ridge stack. One storey and attic; C18 back range to No. 6 with hipped dormer windows and wooden lintels to ground floor openings; late C17 or early C18 back range to No. 6 with parapet gable and end stack. Two entrances to main elevation each with chamfered wooden lintels and C18 glazed six-panelled doors. Two ground floor C20 metal casement windows and two similar windows to large gabled dormers. One-two light ovolo moulded mullioned casement window in south elevation. One of a number of buildings altered c.1770 for the Duke of Bedford.		
1274687	Listed Building Grade II	18-24, Elton Road	Row of four houses. Early C19 with early C20 alterations. Coursed dressed limestone rubble with ashlar dressings. Collyweston stone slated roofs; two ashlar ridge stacks with stepped cornices. Two storeys, double pile plans. Ashlar quoins and jambs to openings with flat stone arches and flush keystones. Four replacement doors and four ground floor windows inserted into original shallow segmental bay windows. Four first floor sixteen-paned recessed hung sash windows. Interior: Similar plans with rear kitchen and boxed staircase; round arched recesses, some with cupboards, to main room flanking chimney; plain panelled doors.	507611,298894	Medium
1331233 / 50790	Listed Building Grade II	Sacrewell Lodge	C18 house. Coursed stone with steeply pitched Collyweston stone roof with gabled end. Internal end stacks of stone. Two storeys and attic. Five bays. Flat stone arches, C19 2-light casements with glazing bars. Central doorcase with modern glazed door inserted. Three hipped dormers. C19 stone wing at rear.	507424,300578	Medium
1331243	Listed Building Grade II	Graeme House	C18 cottage with C17 wing to east. Coursed stone rubble, concrete tile roofs with gabled ends. With 2 end brick chimney stacks. One window on first floor. Two-light casements on ground floor. Modern casements. When the house was used as a vicarage in the C19 a Gothic stone porch was added. Lower 2 storey original C17 cottage to right (east) 2 windows, modern casements. C19 extension to rear (north).	509689,298639	High
1331253	Listed Building Grade II	Gate Piers Immediately South of Manor House	Gate piers immediately south of Manor House TF 0600 44/614 II GV 2. C18. Large rusticated stone gate piers, square on plan, with cornices and ball finials.	506733,300520	Medium
1331254	Listed Building Grade II	2, 4 And 6, Russell Hill	C18 row of cottages refashioned in C19. Coursed stone with steeply pitched Welsh slate roof with gabled ends, east end has stone coping. One storey and attic, 7 window range. C19 casements, one at centre has stone mullion. Four C19 gabled dormers. C19 porches with large timber brackets, boarded doors with wrought iron hinges. End and ridge stacks.	506883,300516	Medium
1331255 / 00116	Listed Building Grade II*	Sibberton Lodge	C17 house with a medieval wing, possibly a chapel. The C17 part has datestone 1657, coursed stone with steeply pitched Collyweston stone roof with coped gable ends, 2 storey, 4 window range.	506303,299914	High
1331283	Listed Building Grade II	Model Farmhouse	tablet dated 1685. Coursed stone house, square on plan with steeply pitched hipped Collyweston stone roof. Two storeys. Three by 3 bays. Three-light stone mullion windows with drip moulds. Modern stone doorway on south side to left of centre. Two modern hipped dormers. Ashlar chimney stacks with cornices. Wing on west side of late C19, stone with Collyweston stone roof with gabled end, 2 storeys, and single storey extension. Interior: Victorian dog-leg staircase. Chamfered ceiling	510546,300402	medium

# A47 WANSFORD TO SUTTON DUALLING

## Appendix 6.1 Cultural Heritage Information

NHLE/HER/ WAN Ref	Designation	Name	Description	NGR	Value / Sensitivity
1331284 / 00043	Listed Building Grade II	Manor House	C17 house. Coursed stone with steeply pitched Collyweston stone roof with coped gable ends. Two storeys and attic. Five bays.	511070,300489	High
1331285	Listed Building Grade II	Sundial in Paddock Immediately West of Manor House	Circa mid C17 astronomical sundial in form of large stone block on moulded base, almost 6 ft high. The sides have divided rectangular concavities diagonally set and concave hemispheres. The front has a deep heart-shaped concavity. The front face of the top is inclined forward and has a divided rectangular concavity with semi-circular ends. Erected by Bishop Dove of Peterborough.	511023,300494	High
1331286	Listed Building Grade II	Primrose Cottage	Mid C19 range of 4 cottages, converted into 2. Coursed stone with ashlar dressings. Thatched roof with half hipped gable ends. One storey and attic. Five gabled dormers with thatched roofs and shaped bargeboards. Four small ground floor casements with glazing bars. Recessed porch at centre with elliptical arch. Thatched roof porch at each end on timber posts. Ledged doors. Two large brick chimney stacks on ridge.	510802,300549	Medium
1394044	Listed Building Grade II	K6 Telephone Kiosk	The kiosk is situated at the east end of the village. Primrose Cottage (Grade II) is located on the opposite side of the street. Approximately 25m to the north-east stands Elizabethan Cottage (Grade II), whilst approximately 30m to the south-east stands Keepers Cottage (Grade II). The kiosk has a strong visual relationship with these three listed buildings collectively.	510806,300530	High
1428204	Listed Building Grade II	Thornhaugh And Wansford War Memorial	the memorial is in the form of a floriated Latin cross with wheel, each arm finished with a fleur de lys. It is supported by a hexagonal shaft terminating in a hexagonal base with a roll moulding. This stands on a square plinth with chamfered and scrolled corners which itself stands on a two-stepped hexagonal base of roughly dressed coursed stone. The west face of the plinth has the inscription 'TO THE GLORY OF GOD WHO SAVED OUR COUNTRY IN HER TIME OF PERIL 1914-1918'. The east face has the inscription 'IN MEMORY OF THOSE WHO GAVE THEIR LIVES FOR THEIR COUNTRY IN THE GREAT WAR 1914-1918'.	506976,300558	High
1222419	Listed Building Grade II	Templar House	Two houses, formerly a house and shop. Late C18 or early C19 with later alterations. Ashlar limestone walls and dressings and coursed limestone rubble, C19 brick. Welsh slated roofs. Three ashlar stacks with single shafts and moulded cornices. Two storeys with cellar and rear ranges. Openings to doorways and windows with flush keystones to flat arches. Two entrances with recessed six-panelled door to left hand and replacement door to right hand both with round headed fanlights and patterned cast iron glazing bars. Ashlar blocking to left hand ground floor bay with inserted sixteen-paned hung sash window, two similar ground floor windows to right hand and five smaller first floor windows. Cast iron boot scraper to right hand door. Formerly a grocer's shop, closed in 1850 and purchased by L.C. Gilbert builder and contractor who removed C18 shop fittings to his workshop adjoining No. 2 London Road.	507531,299042	Medium
1237717	Listed Building Grade II	Barnaby House and Outbuilding and	House and outbuilding and garden boundary wall to rear GV II House. C18 with C19 alterations. Coursed dressed limestone. Collyweston stone slated roofs; end stacks with coped parapet gable to right hand. Two storeys with attics, rear wing with	507539,299028	Medium



# A47 WANSFORD TO SUTTON DUALLING

## Appendix 6.1 Cultural Heritage Information

NHLE/HER/ WAN Ref	Designation	Name	Description	NGR	Value / Sensitivity
		Garden Boundary Wall to Rear	hipped roof dormer windows and brick end stack. Central four-panelled door with rectangular fanlight and flat canopy with moulded cornice and soffit panel. Two ground floor canted bay windows with hipped roofs and hung sashes; three first floor twelve-paned C19 replacement hung sash windows. Moulded wooden eaves cornice, and eaves cornice to three hipped dormer windows. Outbuilding, one storey and attic with coped parapet gable to west.		
1274654	Listed Building Grade I	Wansford Bridge (To Cambridgeshire County Boundary)	Road bridge, formerly carried the Great North Road over the River Nene. Twelve arches; seven northernmost dated 'PM 1577' (Peterborough Magistry), Sir Edward Brudenell of Deene treasurer and surveyor; next three arches repaired with inscriptions 'HVC NORTH P REPARAT SVTV COMITAT 1674' and 'P HVNT HVC REPARAT SVTV COMITAT 1672' on east side cutwater; rebuilding by single span across the main stream and small side arch dated 1795 on oval plaques above keystones on east and west sides. Freestone limestone blocks with freestone and ashlar dressings, (stones with mason's marks). Twelve arches; ten arches to north with coped parapets and moulded string course continuous around V-shaped cutwaters to piers on west side, C16 piers on east side also with cutwaters; plain coped parapet to C18 arches with wider roadway. Seven northern arches semi circular with two plain square orders, three with an added internal order; three repaired arches semi circular with one plain order; semi circular southern arch with ashlar dressings and rising keystone with moulded detail. The stone bridge replaced an earlier wooden bridge with eight arches damaged by floods in 1571, in 1795 the original thirteen arches were reduced to ten following ice and flood damage. The Wansford bypass was constructed in 1929.	507504,299111	High
1274865	Listed Building Grade II	17, Elton Road	House. Late C18 or early C19. Coursed limestone rubble with Collyweston stone slated mansard roof and rear outshut roof. Two storeys with attics. Symmetrical facade: Flat canopy to glazed panelled door flanked by two canted bay windows with casements and hipped roofs, two first floor casement windows with wooden lintels, and two casement dormer windows.	507622,298934	Medium
1222044	Listed Building Grade II	13 And 15, Elton Road	Two estate houses. Circa 1840, built for the Duke of Bedford possibly by S.S. Teulon. Hammer dressed limestone and rubble with freestone dressings. Collyweston stone slated roofs. Two storeys main east-west range with single storey range to east gable. Parapet gables, tall central ridge stack with two rectangular ashlar shafts and common moulded cornice. Boarded doors to two entrances in north elevation, No. 15 to right hand with flat arch and chamfered jambs. Three ground floor and four first floor casement windows of one and two lights with chamfered stone flat arched heads and jambs and stone cills.	507623,298944	Medium
1274864	Listed Building Grade II	1-11, Elton Road	Row of six estate houses. Dated '1836 B' on two gable plaques, built for the Duke of Bedford possibly by S.S. Teulon. Hammer dressed limestone with ashlar and freestone dressings. Collyweston stone slated roofs. Five symmetrical ridge stacks with moulded cornices. Two storeys. Long north-south range with paired central and single gabled wings and four lean-to porches in angles, (two porches to north and south). Moulded stone eaves cornices and chamfered plinth; ashlar quoins. Porches	507610,298964	Medium

# A47 WANSFORD TO SUTTON DUALLING

## Appendix 6.1 Cultural Heritage Information

NHLE/HER/ WAN Ref	Designation	Name	Description	NGR	Value / Sensitivity
			with chamfered two-centred arches, unglazed side lights and inner boarded doors. Eight ground floor, and first floor two and three light cast iron latticed casement windows with ovolo moulded mullions continued in two-centred arched heads and recessed in flat stone arches and with stone cills. Four chamfered gable recesses, two with plaques. Interior: Two room plan with boxed staircase. No. 1 was formerly a saddler's shop.		
1237793	Listed Building Grade II	30, London Road	House. Circa 1830. Coursed dressed limestone rubble with ashlar dressings. Collyweston stone slated roof; brick stack to left hand. Two storeys. Openings with flat stone arches with flush keystones; doorway to right hand with six-flush-panelled door, one ground floor sixteen-paned hung sash window recessed for shutters and one similar first floor window both with stone cills.	507619,298999	Medium
1274653	Listed Building Grade II	32, London Road	House. Late C18 or early C19. Coursed limestone rubble with ashlar and freestone dressings. Collyweston stone slated roof; brick stack to left hand. Two storeys, symmetrical facade. Round headed stone arch to doorway with patterned glazing bars to fanlight and with C20 door replacement. Ashlar and freestone jambs to window openings with flat arches, flush keystones, and cills. Two ground floor and two first floor recessed sixteen-paned hung sash windows.	507626,299002	Medium
1222422	Listed Building Grade II	Stable Range Attached to East of Number 34	Stable range attached to east of No. 34 GV II Stable range. Circa 1830. Dressed coursed limestone, with freestone dressings. Welsh slated roof. Two storeys. Chamfered four-centred head to archway with mitre-stopped chamfered jambs and with boarded doors. Segmental arched head to left hand stable window with wooden slats; boarded loft door and first floor casement window with segmental arched head.	507645,299009	Medium
1237799	Listed Building Grade II	34, London Road	House. Circa 1830. Dressed limestone with ashlar and freestone dressings. Collyweston stone slated roof, stack to rear. Two storeys with elliptical archway to right hand with two boarded doors. Door and window openings with flat stone arches and flush key stones; four-flush-panelled door and rectangular fanlight with two ground floor sixteen-paned hung sash windows recessed for shutters and two similar first floor windows.	507633,299006	Medium
1237832	Listed Building Grade II	36 38 40, London Road	Row of three houses. Circa 1830. Dressed coursed limestone and ashlar and freestone dressings. Welsh slated roofs, two brick end stacks and two ridge stacks. Two storeys, cellar to No. 40. Flat stone arches with flush key stones to all openings. Two replacement doors and one four-flush-panelled door (No. 40) all with rectangular fanlights. Three ground floor sixteen-paned hung sash windows recessed for shutters and three similar first floor windows.	507658,299010	Medium
1127444	Listed Building Grade II	Bridge Cottage, Downderry House	Range of 2 early C18 houses. Coursed stone with dressed quoins. Steeply pitched Collyweston stone roof with stone coping to south gable end. Two storeys and attic. Four window range. Three-light casements with glazing bars, flat stone arches. Two doorways with modern doors inserted. Three old hipped dormers with casements with glazing bars. Two ashlar stacks one at centre, the other at south end.	507389,299241	Medium

# A47 WANSFORD TO SUTTON DUALLING

## Appendix 6.1 Cultural Heritage Information

NHLE/HER/ WAN Ref	Designation	Name	Description	NGR	Value / Sensitivity
1222045	Listed Building Grade II	Bedford Row, Morva Bass, Post Office	Two shops and one house formerly a shop, and row of 3 houses formerly 6 houses. Dated 1826 on plaque in rear elevation; C20 alterations. Dressed limestone rubble with ashlar and freestone dressings. Welsh slated, and Collyweston stone slated roofs. 2 storeys, L-plan; main north-south range formerly with 3 shops and elliptical headed archway to left of centre giving access to range east of No 23. Main range: Hipped roof with left hand stack and 2 ridge stacks each with sawtooth brick cornices; 3 shop windows and doorways with rectangular fanlights and with reeded pilasters and common entablatures. Door to No 23 double leafed, modern door to No 31 and to No 33 a C20 replacement, one twelve-pane hung sash window to left hand with flat ashlar arched head and flush keystone, 6 similar first floor windows and 2 with replacement casements. Range to rear with 3 brick stacks; ashlar band continuous over window arches and doors with flush keystone; 6 doorways, 2 with original flush-panelled doors; 6 ground floor and first floor casement windows. No 23 a grover's shop in 1841 census returns, and No 33 a tailor's shop in 1827.	507636,298911	Medium
1222364	Listed Building Grade II	Cross Keys Public House	Public house. Circa 1750 with C20 renovation. Dressed limestone with ashlar dressings. C20 ridged pantiled roof; central rectangular planned brick ridge stack with sawtooth brick cornice. Two storeys, symmetrical facade; two outer four-panelled doors and moulded wooden frames to two ground floor hung sash windows without glazing bars, all with wooden lintels; two first floor windows similar to ground floor with original small sixteen panes.	507631,298918	Medium
1222412	Listed Building Grade II	Sydney House	House, formerly a house, two cottages to rear and stable range. Late C17 with C19 alterations and rebuilding and C20 renovation. Coursed dressed limestone rubble and freestone. Collyweston stone slated roofs with chamfered copings to parapet gables; rebuilt end stacks. Two storeys and attics with one storey and attic rear wing forming an L-plan, and shop to north. Central doorway with ashlar lintel and flush keystone; six-raised and fielded panelled door. Two ground floor bay windows with leaded casement lights; three first floor cross-framed casement windows and two gabled casement dormer windows. Interior: Modified plan with partition removed from south side of cross passage, rear kitchen wing rebuilt in C19. Stop-chamfered cross beams and cambered mantel beam to open hearth in main room.	507603,298917	High
1225965	Listed Building Grade II	Barn and Stables Adjoining Rear (East) Of Wharf House	Long range of C18 stone farm buildings with steeply pitched Collyweston stone roofs with gabled ends. The westernmost is two storeys and has external stone stairs to first floor door, and has small square window openings. Barn and stabling adjoining east has slightly steeper pitched roof and has modern garage doors inserted, with hipped roof left door above. Stabling at east end with loft above. Included for group value.	507424,299255	Medium
1331288	Listed Building Grade II	Wharf House	Early C18 house. Coursed stone with dressed quoins. Steeply pitched Collyweston stone roof with stone coping to end gables. Two storeys and attic. Three window range. Right hand blocked. Sashes with glazing bars. Three hipped dormers. Ashlar stacks with cornices, one on ridge, with 5 square shafts, the other at south end. Ashlar bay at rear with 2 sashes. C18 wing at rear with gabled end to roof and a single storey extension.	507396,299226	Medium

# A47 WANSFORD TO SUTTON DUALLING

## Appendix 6.1 Cultural Heritage Information

NHLE/HER/ WAN Ref	Designation	Name	Description	NGR	Value / Sensitivity
1225937	Listed Building Grade II	7, Bridge End	C18 house, formerly 2 cottages. Coursed stone with dressed quoins. Steeply pitched Collyweston stone roof with coped gabled ends. Two storeys. Three window range. Two and 3-light casements, ground floor with flat stone arches. Doorways left and right, left hand door converted to window, right hand boarded door with rectangular fanlight. Ashlar stack at south end.	507384,299252	High
1331256	Listed Building Grade II	Stables to West of Sibberton Lodge	Early C19 stable range. Coursed stone with Collyweston stone roof with gabled ends. One storey and attic. Central stable door with square window either side, with flat stone arches. Two hipped dormers. Single storey one bay wing at each end. Included for group value.	506279,299895	Medium
1266086	Listed Building Grade II	Greystone	C17 ashlar house. Datestone on front "1657 TT". Collyweston stone roof with gabled ends. Front has wide 2-storeyed splayed bay, 6-lights wide with ovolo moulded stone mullion. Moulded eaves, cornice and hipped roof. Moulded string course and plain plinth. External stone stack at south end with offsets. Interior was gutted in late C19/early C20 to form one room said to have been billiard room of adjoining house, it contains some re-used panelling, partly C17. Later C19 or C20 wing at rear (west) with Collyweston stone roof.	507353,299322	Medium
1266207	Listed Building Grade II	Barn v South East of Sibberton Lodge	Barn to south-east of Sibberton Lodge TF 09 NE 16/621 19.3.62 II GV 2. C17/18 barn. Coursed stone with steeply pitched modern slate roof with coped end gables. Central barn doors, small square ventilation holes. Loft door in end wall. Included for group value.	506318,299883	Medium
1331287	Listed Building Grade II	The Corner House	Includes No 17 Peterborough Road. C18 range on corner site. Coursed stone with Collyweston stone roof with gabled ends and hipped corner. One storey and attic. Corner Cottage has 2 fixed-light former shop windows with glazing bars either side of central doorway with rectangular fanlight, and small modern casement in original opening. Four hipped dormers. No 17 Peterborough Road has 3 modern casements and 5 hipped dormers.	507376,299293	Medium
1225917	Listed Building Grade II	Meadow Cottage	Early C18 cottage. Coursed stone. Thatched roof with gabled ends. South end has stone coping to gable. Internal end stacks, One storey and attic, 2 window range. Modern three-light casements, first floor with eyebrows in thatch. Modern central door with modern hood. Later single storey wing at rear.	507374,299224	Medium
1127462	Listed Building Grade II	Sibberton Lodge Cottage	C18 stables converted to cottage. Coursed stone with steeply pitched pyramidal roof of Collyweston stones. Square on plan. Two storeys. Modern windows and door. Modern flat roof extension at rear (east). Included for group value.	506314,299900	Medium
1331249	Listed Building Grade II	Hillside and Former Workshop to South	No 19 (Hillside) and former workshop to south TL 0799 45/684 II 2. Dated 1850. Estate cottage in Tudor style built for cooper George Eyres - stone barrel with initials G. E. in panel on front. Coursed stone with freestone dressings. Gabled, steeply pitched, Collyweston stone roof. Two storeys 2 window range. Right hand gabled, with 2 storey canted bay with corbelled gable, containing Duke of Bedford's arms, and with stone mullion (transom window with 4-centred arch side lights. Left hand stone porch with 4-centred arch with date 1850 in spandrel, and ledged door with wrought iron hinges. Gabled above doorway. To left (south) single storey cooper's workshop with 3-light stone mullion window (which appears to be earlier) with hood	507332,299470	Medium

# A47 WANSFORD TO SUTTON DUALLING

## Appendix 6.1 Cultural Heritage Information

NHLE/HER/ WAN Ref	Designation	Name	Description	NGR	Value / Sensitivity
			above and ledged door to right. End stacks with ramped and gabled caps and red brick diagonal shafts. All the windows have multi-pane metal frames.		
1331276	Listed Building Grade II*	Great North Road Bridge Carrying North Bound Carriageway Over the River Nene	1925-28 by Owen Williams and Maxwell Ayrton for Ministry of Transport. Mass concrete constructions. Segmental arch to 109ft wide central span and two flanking flood arches each with 50ft span segmental arches carrying flat road deck. Between the main and flood arches the piers each have two pairs of cutwaters on either side rising from large splays at the bases to the refuges in the parapet; between the cutwaters the piers are pierced by round-headed arches. A significant feature of the design are the arches that pierce the spandrels, two in each of the main arch spandrels and one for the flood arch spandrels, which have wide vertical expansion joints rising from the crowns of the arches and up through the parapets. There are four similar expansion joints above the extrados of the main arch. The point where the expansion joint rises from the arch is emphasised by a chamfered recess instead of a keystone. The parapet projects on corbels which rise through it as pyramidal lozenge shapes. Inscriptions formed by shuttering include: the date in Roman numerals over the main arch, and in the main arch spandrels "County of Huntingdon" on the south side and "County of the Soke of Peterborough" on the north side.	507630,299362	High
1161364	Listed Building Grade II	45 Main Street	C18 cottage. Coursed stone rubble. Thatched roof with gabled ends. Two dormers. Two ground floor windows, casements with glazing bars. Two central doorways, one blocked.	511748 299118	Medium
1163093	Listed Building Grade II	Dovecot to west of Village Farmhouse	Small C18 dovecot. Stone rubble. About 13 ft square on plan. Pantile roof with gabled ends, and lantern. Plank door with stone lintel.	512023 298680	Medium
1222034	Listed Building Grade II	Sibson Manor House	Farmhouse. Early C17 with mid C19 alterations and additions. Coursed limestone rubble with freestone and ashlar dressings. Collyweston stone slated roofs hipped with gablet to left hand. Large ridge stack to left of centre with four ashlar shafts. Two storeys, three unit plan, and rear service wing. Main entrance to right of centre with moulded jambs and lintel and boarded door with rectangular fanlight; four three-light ovolo-moulded mullioned casement windows and one two-light window; one, two-light and three, three-light first floor windows similar to ground floor all with moulded cornices. Interior: Stone chimney piece with moulded jambs and four-centred arch in a square head in hall and first floor room.	509540 297671	High
1222035	Listed Building Grade II	Granary c.25 metres south of Sibson Manor House	Granary. C18 with C19 alterations. Coursed limestone rubble with freestone dressings and Collyweston stone slated roofs. Parapet gables and stone steps to left hand of north-east elevation leading to boarded door, sliding ground floor door to workshop. The barn and granary were stone slated after a fire c.1920. Included for group value.	5 09523 297635	Medium
1222036	Listed Building Grade II	Sibson House Hotel	Hotel formerly an inn and farmhouse. 1762-4 for the Duke of Bedford; stone mason Thomas Thompson, carpenter William Bradshaw; early C19 extension and alteration; C20 renovation and additions. Coursed limestone blocks with freestone and ashlar dressings. Collyweston stone slated roofs. Two storeys with double pile	509657 297485	High



# A47 WANSFORD TO SUTTON DUALLING

## Appendix 6.1 Cultural Heritage Information

NHLE/HER/ WAN Ref	Designation	Name	Description	NGR	Value / Sensitivity
			extension to north-west and rear extensions. Parapet gables with ashlar end stacks, two canted bay windows with ovolo moulded mullions and stone slated roofs flank main entrance with boarded door to left of centre and one three-light mullioned casement window to right hand. Four recessed first floor casement windows with upper lights, replacing former cross-framed windows, dovecot at first floor with framed wooden flight entry, one ground floor and two first floor wooden casement windows to extension. The inn was recorded as The Wheatsheaf from 1769, the building accounts mention the re-use of material from a building formerly on the site.		
1222037	Listed Building Grade II	No. 29 old Great North Road	Cottage, originally a handed pair. Late C18 or early C19. Coursed limestone rubble with freestone dressings. Slated roof, central ashlar ridge stack. One storey and attic, symmetrical facade with two entrances (to left hand blocked with inserted window), with boarded door to right hand. Four leaded light casement windows with wooden lintels; two sloping roofed casement dormer windows. Interior: Back to back open hearths; boxed staircase.	5 09414 297877	Medium
1222038	Listed Building Grade II	6, 10, 12, 18 and 20, Old Great North Road	Row of four cottages, formerly eight. Circa 1845. Jacobean style. Built by L.N.W.R. Coursed limestone rubble with ashlar dressings. C20 tiled roofs.	5 09276 297970	Medium
1222040	Listed Building Grade II	Entrance gate piers to park boundary wall of Stibbington Hall	Gate piers. Possibly circa 1625. Ketton limestone with plinths and chamfered caps surmounted by shaped finials.	5 08900 298690	High
1222042	Listed Building Grade II	Garden boundary wall and doorway c.15 metres north of No. 41 (The Old Rectory)	Garden boundary wall and gateway. Mid C19 and earlier. Coursed limestone rubble with freestone dressings. Doorway similar to rear porch of No. 41 (The Old Rectory) with chamfered coping to parapet gable supported on two shaped corbels with chamfered jambs and head. Included for group value.	5 09025 298645	Medium
1222043	Listed Building Grade II	Stibbington Manor, outbuilding and service yard boundary wall	House, formerly a farmhouse, outbuilding and boundary wall. Early C17 with late C17 and mid C19 alterations and additions. Coursed limestone rubble with freestone and ashlar dressings and rock faced limestone. Collyweston stone slated roofs; parapet gables with ashlar end stacks to north and east gables and large ashlar ridge stack to right of centre with three stacks. Two storeys, three unit plan main range and rear service wing, late C17 staircase addition with lean-to roof in angle and with C19 additions to rear and south gable of main range. West elevation; main entrance to left of centre with flat stone canopy supported on scroll brackets and C20 door. Ovolo moulded mullioned casement windows with moulded cornices, two, six-light and two, three-light ground floor windows and one, two-and three-light and two, four-light first floor windows. Rear entrance with shallow canted two storey porch with boarded door and mullioned first floor window. C19 outbuilding with hipped roof linked to main building by boundary walls to south and east, Interior of house; C17 staircase of two flights with turned balusters resited; sealed hearths; stop-chamfered ceiling beams; other C19 details.	5 08872 298670	High
1222174	Listed Building Grade II	Three Barns Circa 10 Metres To North West Of Sibson House	Three barns c.10 metres to north-west of Sibson House Hotel and stone mounting block. GV II Three barns and stable accommodation. Mid C18, late C18 or early C19 and C19. Coursed limestone rubble with freestone dressings. Collyweston roofs	5 09639 297493	Medium

# A47 WANSFORD TO SUTTON DUALLING

## Appendix 6.1 Cultural Heritage Information

NHLE/HER/ WAN Ref	Designation	Name	Description	NGR	Value / Sensitivity
		Hotel And Stone Mounting Block, Great North Road	(one formerly thatched). Original barn to right hand, with two later barns forming one contiguous range. Original barn with parapet gables and dovecot at first floor with wooden framed flight entry, two glazed doors and C20 window (mounting block with three steps beside window dated 1703); central barn with double boarded doors and C20 window with wooden lintel, two small first floor windows; left hand barn with double boarded doors, ventilation slits and one casement first floor window with wooden lintel. The earliest barn is mentioned in the lease of The Wheatsheaf Alehouse, Barn Stables etc for 1771 from the Bedford Estate.		
1222196	Listed Building Grade II	Viaduct to east of Wansford Railway Station	Railway viaduct. Circa 1845, possibly altered or partly rebuilt c.1912, restored 1977. Built for L.N.W.R. Northampton - Peterborough line. Cast iron bridge with double track and pedestrian way supported by brick and rock faced limestone piers, cutwater to main pier in mid stream.	5 09353 297975	Medium
1222241	Listed Building Grade I	Stibbington Hall	Country house. Dated 1624 on plaque with late C17 or C18 alterations and C20 additions. Ketton limestone with Collyweston stone slated roofs. Two storeys: E-plan extended to north-west with later rear passage and long gallery. South-west facade: Symmetrical with projecting wings with two storey bay windows to right and left hand; two storeyed central porch. Two ashlar chimney stacks symmetrically positioned, with two flues and a common entablature. Moulded stone copings to parapet gables with shaped apex and side finials, curvilinear parapet gable to porch with carved and shaped finials. Continuous moulded string course at first floor and also at eaves height carried above two storey bay windows; continuous chamfered plinth. Entrance archway to porch with semi-circular head and moulded architrave with rectangular keystone and jewel ornament, moulded imposts, sunk spandrels and stop-chamfered responds flanked by Doric pilasters on pedestals, square incised sundial on right hand pilaster; first floor three-light casement window with moulded mullions and transoms, flanked by Ionic pilasters on pedestals, below the window a sunk rectangular panel inscribed with lead lettering 'DEO TRIN-UNI SIT GLORIA 1624', in gable above a raised shield carved with arms of Peter Edwards of Alleston and his wife, initials 'IE', and 'IH' below of John Edwards his son and wife. Inner doorway with flat four-centred arch in a square head with stop moulded jambs. Two storey bay windows to each wing carried above eaves height with a moulded parapet, two windows to each bay with four mullioned and transomed casement lights and single side lights. One similar four-light window at each floor flanking porch, first floor windows carried above eaves height; oval lights with moulded architraves in each gable pediment. Interior: Original stone chimney pieces with moulded jambs, flat two-centred heads and moulded cornices in hall and south-east wing; staircase hall rebuilt with C17 closed string staircase with symmetrically shaped balusters, square newels and moulded finials. Alterations and repairs are recorded in rentals 1857-8.	5 08924 298739	High
1222315	Listed Building Grade II	Four rows of tombstones in eastern angle of south porch	C18 and early C19 representing a larger number of good C18 tombstones and limestone slabs. Identified in rows A-D from west to east. Row A: a) Dated 1818 to Robt Boyall segmental head with oval plaque and ribband and laural leaf garland,	5 09027 298655	Medium

# A47 WANSFORD TO SUTTON DUALLING

## Appendix 6.1 Cultural Heritage Information

NHLE/HER/ WAN Ref	Designation	Name	Description	NGR	Value / Sensitivity
		and aisle of parish church of St John The Baptist	inscription painted black; b) Shaped head with raised plaque, inscription unclear; c) Dated 1858 to Mary Boyall, plain slab with deep incised inscription; d) Dated 1865 to John Boyall similar to above. Row B: a) Dated 1865 to John Boyall similar to above. Row B: a) Dated 1799, segmental head with recessed oval plaque putti and garlands, black painted inscription unclear; b) Dated 1720, classical composition with Ionic columns and winged putti, inscription unclear; c) Dated 1709, segmental head with putti and garlands; d) Dated 18-- to Wm Allen, segmental head with oval plaque and black painted inscription. Row C: a) Dated 1781 to John Cooper, square head with inscribed decoration including fluted columns and arabesques; b) Square head with winged putti and rosettes, cartouche with two putti, inscription unclear; c) Dated 1748, scroll head with cartouche and two putti, inscription unclear; Row D: a) Dated 1770 to Mary Cooper, square head with inscribed decoration including fluted columns and arabesques; b) Dated 17-- segmental head, two putti flank small cartouche with two oval plaques, inscription unclear; a) Segmental head with urn and putti decoration above segmental headed plaque, inscription unclear; d) Dated 1863 to John Gallow, segmental and shouldered head with draped urn and two putti, segmental, shouldered plaque with black painted inscription.		
1222331	Listed Building Grade II*	The Old Rectory	House formerly the rectory. Early to mid C17 (qv The Haycock, Wansford, Cambs.) with late C18 and mid C19 alterations and additions. Coursed limestone rubble with freestone and ashlar dressings. Collyweston stone slated roofs. Two storeys with attics, main east-west range with original three unit plan and cross passage to east end; one storey and attic and single storey kitchen and dairy ranges to east, staircase wing to north and porch to rear entrance mid C19. South facade: Parapet gables with end stack to right hand, ridge stack with four shafts and tall additional side stack to north-east with two shafts of ashlar, rebuilt brick stack to kitchen range. Plastered coved eaves cornice with moulded stone string; continuous moulded label extended into kitchen range; chamfered plinth. Ovolo moulded mullioned and transomed casement windows, two of three lights and one with two lights and similar lights above doorway to right hand with C19 panelled door; C19 stone mullioned bay window to left hand. Five first floor three-light and one two-light ovolo moulded mullioned and transomed casement windows. Five segmental headed dormer windows. North facade: Blocked openings of original windows and former doorways, reused C15 window tracery; C19 porch with parapet gable supported on shaped corbels surmounted by Gothic finials; chamfered jambs and head to doorway with panelled door. Interior: Early C17 staircase, rebuilt, with closed string and turned balusters; four stone chimney pieces with mannerist detail and moulded stone cornices to central ground and first floor rooms, two with over mantels with sunk panelled pilasters. Sealed kitchen hearth originally with baking oven; inserted partitions with C18 panelled doors and C17 boarded attic doors; staggered butt purlin roof.	5 09041 298632	High

# A47 WANSFORD TO SUTTON DUALLING

## Appendix 6.1 Cultural Heritage Information

NHLE/HER/ WAN Ref	Designation	Name	Description	NGR	Value / Sensitivity
1222339	Listed Building Grade II	Old Castle Farmhouse	House formerly a farmhouse. Early C18 with mid C19 alterations and additions. Squared limestone rubble with freestone dressings. Rubble limestone end stacks and ridge stack to right of centre. Coped parapet gables. Two storeys with attics, and one storey and attic service range to south. West elevation: C19 four-panelled door and rectangular fanlight with patterned glazing bars, flanked by two ground floor casement windows with wooden lintels similar to four first floor casement windows. C19 bay window to right hand with two casement windows in service range. Five hipped dormer windows with leaded lights. Boot scraper beside main entrance.	5 09063 298592	Medium
1222414	Listed Building Grade II	Stibbington House and gate piers to driveway	House formerly a lodge, and gate piers. Early C19, mid C19. Coursed limestone rubble with freestone dressings. Welsh slated roofs. One storey and attic with gable to street and main entrance in symmetrical south facade. Freestone porch with four-centred arch in a square head with original panelled inner door. Two ground floor ovolo moulded mullioned and transomed casement windows; two facade dormers. Pierced and carved barge boards to gables. Corbelled end stack to west with two octagonal shafts each with embattled caps, similar eastern stack behind ridge. Eccentric Gothic octagonal turret to rear, embattled with conical stone cap and crocketed finial. Rusticated gate piers with moulded bases and caps surmounted with ball finials.	5 07673 298781	Medium
1222416	Listed Building Grade II	Mile post c.500 metres north-west of Stibbington School	Mile post. C19. Cast iron, triangular section with concave head and painted white with black inscription 'Stamford 6 miles', 'Stilton 8 miles'.	5 08146 298763	Medium
1222424	Listed Building Grade II	Gazebo and garden boundary wall to south of Mill Farmhouse	Possibly early C19. Coursed limestone rubble with Collyweston stone slate roof, wooden open lattice screen and entrance in north elevation. Semi circular in plan and built into the south wall of a wall enclosing a rectangular garden.	5 10964 297281	Medium
1222526	Listed Building Grade II	Gate piers to garden entrance, c.15 metres to north of Stibbington House	Gate piers, mid C19. Rusticated limestone with moulded plinth and plain capital surmounted by urns with swags and mask decoration. The gardens were landscaped in 1927 by L.C. Gilbert for G.W. Abbott, possibly reusing C19 garden ornaments.	5 07573 298647	Medium
1225871	Listed Building Grade II	Manor Farmhouse	Farmhouse. Early C17, c.1800 and later C19. Regular coursed and squared coursed limestone with Collyweston slate roof. Originally 2-unit plan with cross passage, at right angles to the road, now L-shaped. 2 storeys. Elevation abutting Main Street is a 3-window range with gable to left. 4-light, ovolo-moulded stone mullion window, with hood mould, to ground floor of gable and similar 3-light window above. C19 casement windows, to right, have ashlar dressings and wood lintels. Central, 4-panel, door has a leaded casement, immediately above, both have ashlar dressings and wood lintels. Ashlar quoins and evidence of straight joint between gable and later range to right. Ashlar gable parapets with one urn finial at eaves, to left. Ashlar ridge and end stacks, to cross wing, has moulded corbelling. Yellow brick stack at end, to right. Elevation to left is an irregular 3-window range, at ground floor. 3-light, ovolo-moulded stone mullion, window, to right of centre. One first floor and 2-ground floor windows are C19 casements under wood lintels. Single-light fire	5 07116 297801	High

# A47 WANSFORD TO SUTTON DUALLING

## Appendix 6.1 Cultural Heritage Information

NHLE/HER/ WAN Ref	Designation	Name	Description	NGR	Value / Sensitivity
			window with moulded stone surround, to ground floor centre. Mid/late C19 one-bay 2-storey extension, set back to left, has C19 casements. Rear elevation of both wings has C19 lean-to extensions with catslide roofs. interior not inspected but north room of cross-wing noted as having a stop-chamfered spine beam, with stops defining the position of the former cross-passage. Rebuilt open fireplace and C17 fireplace at first floor with moulded stone surround with shelf and 4-centred arch-head. Reset C18 staircase with turned balusters and closed string. Panelled window reveals		
1225872	Listed Building Grade II	Pair of attached cow houses and granaries approx. 10m N of Manor Farmhouse	Pair of cow houses and granaries. Early C19 extended as datestone 1824. Squared coursed limestone with Collyweston slate and corrugated asbestos roofs. Each originally cow house with granary above, forming an L-shape range. Together comprising a 4-window range of casement openings at first floor with plank and stable doors at ground floor, under wood lintels. Datestone in south gable. Interiors not inspected. Included for group value.	5 07102 297828	Medium
1225873	Listed Building Grade II	Barn approx. 30m N of Manor Farmhouse	Barn. C18. Squared coursed limestone with Collyweston slate and corrugated iron roof. Single unit barn with central cart entrance, now modified. Triangular vents flanking the cart entrance and slit vents in gable ends. Interior not inspected but noted as having remains of C18 roof structure with clasped purlins.	5 07112 297844	Medium
1225874	Listed Building Grade II	The Angel Public House	Public house. C17 and C19. Regular coursed limestone with pantile and concrete pantile roofs. Originally 2-unit plan. Single storey with attic 2-window range at ground floor. Canted bay window with glazing bars, ashlar base and flat roof, to left. Casement window with glazing bars, ashlar dressing and wood lintel, to right. 2 gabled half dormers, to attic, have similar casements, under wood lintels. Central C20 door, under wood lintel. Gable parapets with concrete copings and brick stacks at ends. Left gable has evidence of earlier roof line and blocked openings. Rear wing has C20 concrete pantile roof. Interior has open fireplace with bressumer. The bressumer has a scratched date 1673, probably not original. Included for group value.	5 07065 297801	High
1225875	Listed Building Grade II	Sundial Cottage	Shown as Chareen on Ordnance Survey map. House. C17 modified C19. Regular coursed limestone with ashlar banding and dressings. Collyweston slate roof. 3-unit plan, with rear wing. Single storey with attic. Main front of 4 bays, 3-window range. Centre 2 bays are ashlar, and break forward separately. These projections were originally intended to continue at roof level to form gabled eaves dormers; probably removed C19. Bay to right of centre has C19 tripartite sash window set in and breaking through a moulded stone surround, formerly a stone mullion window. Chamfered plinth below window and moulded string course above. Similar tripartite sash window, to far right, has moulded stone surround with cornice over. C19 casement window, to far left, has similar surround with cornice over. Small single-light window, to left of centre, has single-light C19 casement window, above, set under eaves. Bay to left of centre has a 6-panelled door with a moulded stone surround and 4-centred arch-head. Flanking single-light windows, with moulded stone surrounds, now blocked. Chamfered plinth below and moulded stone cornice	5 07052 297811	High



# A47 WANSFORD TO SUTTON DUALLING

## Appendix 6.1 Cultural Heritage Information

NHLE/HER/ WAN Ref	Designation	Name	Description	NGR	Value / Sensitivity
			above. 3 hipped eaves dormers with C19 casement windows. Ashlar gable parapets and ashlar ridge and end stacks. Left gable has an inscribed sundial. Rear elevation has a projecting wing, to left, with C19 casement windows and a C19 oven, with hipped roof, to right. Fragments of chamfered masonry reset to centre of range. Interior not inspected but noted as having ogee moulded spine beam in centre room with a chip carved rosette in the soffitt. Plank door with moulded battens and original hinges		
1225876	Listed Building Grade II	Yarwell Post Office and attached house	Early C18. Squared coursed limestone with Collyweston slate roof. Originally 2-unit plan. Single storey with attic. 2-window range of C19 casements under wood lintels. Central C19 four-panel door; is also under wood lintel. Hipped, roof dormer, to left, has horizontal sliding sash window. Brick stack, now rendered, at end. Single-storey, extension to rear. Mid C19, single-unit, 2-storey shop is attached to left. Interior not inspected	5 06944 297821	Medium
1225877	Listed Building Grade II	Sunnyside	C17 altered C20. Regular coursed and squared coursed and banded limestone with Collyweston slate roof. Originally 2-unit plan with central stack. 2 storeys. 2-window range at first floor, and 3-window range at ground floor of C19 and C20 casements. Ground floor centre window was originally a door and has concrete lintel; first floor windows also have concrete lintels. Ground floor flanking windows have C17 moulded stone surrounds, with hood moulds. Ashlar gable parapets and kneelers and ashlar stack at ridge. Left bay is squared coursed limestone with 3 ashlar bands, other is regular coursed. Right gable has C20 door and windows under concrete lintels and bands of projecting stonework in gable, probably pigeon holes. Single-storey extension to rear. Interior; living room, to left, has open fireplace with bressumer and roll moulded spine beam. Former cross-passage runs behind the central stack.	5 06785 297867	High
1225878	Listed Building Grade II*	Church of St. Mary Magdalene	Church. C13, tower remodelled C18, aisles removed 1782 restored 1892. Squared coursed limestone parts banded with ashlar and with ashlar dressings. Lead and Collyweston slate roof. Originally aisled nave and chancel with west tower, nave is now without aisles. South elevation of south chapel is of 2-window range of one- and 2-light square-head windows. Shallow lean-to roof with lead covering, and ashlar gable parapets. West elevation has outline of blocked archway. East elevation is blank. 3-light east window of chancel has 4-centred arch-head and hollow reveals. North elevation of north chapel, now vestry, is a 2-window range with a 2-light square-head window, to right, and lancet window to left; both restored C19. Similar roof as south chapel, with moulded rafter feet. East and west elevations are blank. South elevation of nave is of 3-bays with evidence of the C13 arcade to the former south aisle, now demolished. windows in flanking bays have double-chamfered heads, formerly the heads of the arcades. Central C18 south doorway, now blocked has plain arch-head and ashlar surround with keyblock. Plinth above window heads marks line of former roof abutment. Steeply gabled roof with ashlar gable parapet and finial and exposed ends of tie beams, at eaves. North elevation of nave is all similar to the south elevation. Central C18 north doorway with a C19	5 07094 297761	High

# A47 WANSFORD TO SUTTON DUALLING

## Appendix 6.1 Cultural Heritage Information

NHLE/HER/ WAN Ref	Designation	Name	Description	NGR	Value / Sensitivity
			ribbed door. West tower of 2 uneven stages with plinth. Unbuttressed with irregular ashlar quoins. 2-light west window has plain circles at head and roll mouldings. Slit window above. 2-light bell-chamber openings to each face of upper stage, have square-heads, arch-head lights and roll mouldings. Plain ashlar parapet and set back pyramid roof with weathervane. Interior: C13 three-bay nave arches of double chamfered arches, now all blocked, have circular piers and semi-circular responds. 3 capitals on north side have nail head decoration. Roof structure in nave is probably late C18 with king post trusses. C19 roof structure in chancel and chapels. C19 octagonal font. C19 and C20 furnishings. Fielded panelled vestibule over south doorway. C20 stained glass to east window of chancel. Monuments: various C17 and C18 inscribed floor slabs throughout, one in vestry has a brass plaque with coat of arms. Humphrey Bellamy, d.1715, chest tomb in vestry with fielded panelled sides and black slab with inscription and armorial device. Medieval gargoyle in south chapel. Hatchment in belfry. The chancel was thatched until 1892. The removal of the aisles in 1782 was carried out by a Mr. Sanderson as they had fallen into disrepair.		
1225879	Listed Building Grade II	Chest tomb approx. 12m N of vestry of Church of St. Mary Magdalene	Chest tomb. Dated 1633. Limestone ashlar with panelled sides and partially legible inscription.	5 07093 297774	High
1225880	Listed Building Grade II	Ballaugh Cottage	House. Dated 1591 altered C18, C19 and C20. Regular coursed limestone with Collyweston slate roof. Originally probably 2-unit plan. 2 storeys. 2-window range of C20 p.v.c. casements, in original openings, under wood lintels. 2 lintels to left has stop-chamfers. Central C20 lean-to porch. Partly rebuilt stone stacks at ridge and end. Interior: rooms to left and right of entrance have open fireplaces with bressumers. Room to right of entrance has remains of winder stair, to left of fireplace, and spine beam with date 1541. The date is flanked by fluting and there is a rosette on the soffit of the beam C19 roof structure. Included for group value.	5 07024 097778	Medium
1225881	Listed Building Grade II	The Farriers	House. C17 and early C19. Squared coursed limestone with ashlar dressings and Collyweston slate roof. Originally 2-unit plan now L-shape. Single storey with attic and 2 storeys. Main front is a 3-window range of casements under wood lintels. 3 eaves dormers, also with casement windows; dormer to left has a wooden gablet over and others have hipped roofs. Blocked door to right of centre. Ashlar quoins and ashlar dressings to some window openings. Brick and stone stacks at ridge and end. Early C19, 2-storey, 2-window range to rear has casement windows and a C20 glazed porch, with hipped roof. Interior not inspected but noted as having an open fireplace with bressumer.	5 06897 297811	High
1225882	Listed Building Grade II	Forge Cottage	House and forge, now one dwelling. Dated 1598, reconstructed C17 and C18 with C19 addition. Squared coursed limestone and brick, with Collyweston slate roofs. Originally one- and 2-unit plans. Part single storey with attic and part 2-storey. Main house is an irregular 3-window range with central bay breaking forward slightly. C19 casement to left has moulded stone surround. Single-light window to left of centre	5 07185 297788	High

# A47 WANSFORD TO SUTTON DUALLING

## Appendix 6.1 Cultural Heritage Information

NHLE/HER/ WAN Ref	Designation	Name	Description	NGR	Value / Sensitivity
			has ashlar surround. Casement window with glazing bars, to right, is under wood lintel. Evidence of refenestration to this window. 3 gabled eaves dormer have C19 casement windows. Central plank door, under wood lintel, and double plank doors to far right, also under wood lintels. Bay to far right was originally the forge. Ashlar gable parapet to right and brick stack at end. 2-storey, one-bay, extension, attached to left, has stone ground floor and brick first floor and was originally an open carriage arch. Ashlar canted bay window added into carriage arch late C19. C20 casement window above. Plank door, to right, has ashlar surround. Lateral stack to rear. Interior: entrance hall has spine beam with inscribed date 1598 flanked by fluting. Small open fireplace, with bressumer, on the rear wall		
1225909	Listed Building Grade II	Wendmiur	Two houses shown as Wedmuir on Ordnance Survey map; the house so named to the west is not included. House, now 2 dwellings. C17 and C19. Regular coursed limestone with Collyweston slate roof. Originally 3-unit plan, now T-shape. Single storey with attic. 5-window range with bay to right of centre breaking forward as a gabled cross wing. Irregularly spaced C20 casement windows under wood lintels. Evidence of 2 blocked doors to centre and left. 2 gabled roof dormers, to left, have C19 style casement windows. Hipped eaves dormer to right. Brick and ashlar stack at ridge and end; end stack to left has a moulded corbel. Entrance at rear.	5 06972 297789	High
1225912	Listed Building Grade II	Whitelands	Early C17 and C19. Squared coursed limestone with Collyweston slate roof. Originally 2-unit, now 3-unit plan. 2 storeys. Irregular 4-window range of C19 casements under wood lintels. C20 casement to ground floor left of centre. C20 lean-to porch to right of centre. Ashlar gable parapets and brick stacks at ridge and ends. Evidence of earlier roof line to front elevation and right gable. C20 glazed porch to rear. Interior: centre room and kitchen to right has spine and wall beams. Originally probably house and attached farm building, subdivided in C19 to form 2 dwellings.	5 06842 297817	High
1237952	Listed Building Grade II	2, Old Great North Road	House formerly a farmhouse and inn. Early Mid C18 with C19 alterations. Coursed limestone rubble with freestone and ashlar dressings. Collyweston stone slated roofs. Two storeys with attics, L-plan with lean-to in angle and lower range to north. Parapet gables with chamfered copings and end stacks each with two ashlar shafts; moulded corbels continued as moulded wooden eaves cornices with modillions; ashlar band between floors. C19 gabled open porch and glazed panelled door, two large ground floor and three first floor sixteen-paned recessed hung sash windows with C19 chamfered lintels. C17 windows in side elevation possibly reused from the hall demolished in c.1730. Interior: Staircase, early C18 with moulded string and rails, turned balusters and square newels with ball finials. The farmhouse was formerly an inn c.1750.	5 10875 297203	Medium
1237953	Listed Building Grade II*	Parish church of St Remigus	Parish church. C12 stones reused. C13 chancel and south aisle, mid C13 north aisle and lengthened have. Early C14 west tower, and south aisle rebuilt and possibly widened; south porch added. Nave clerestory C14. Alterations in late C14 and C15 include remodelled doorway to tower and closing the west end of the north aisle. Restoration 1887, chancel arch, and north arcade and aisle rebuilt. Walls of	510883 297322	High

# A47 WANSFORD TO SUTTON DUALLING

## Appendix 6.1 Cultural Heritage Information

NHLE/HER/ WAN Ref	Designation	Name	Description	NGR	Value / Sensitivity
			<p>limestone rubble with Barnack dressings and ashlar limestone. Roofs of Collyweston stone slate and lead. South elevation: West tower of two stages with corbel table with mask-corbels and small carved animals at base of spire; reset lancet window and belfry window of two pointed lights cut into round arches with detached shafted jambs and chevron ornament, (on west wall a niche with moulded jambs, two-centred head and label with figure of a man, on inscribed panel below 'Vous ke par issi passey pur le alme Thomas Purdeu priez'). Spire of ashlar, with two ranges of lights, the lower of two trefoiled lights with a quatrefoil in a gabled head, the upper, a single light with trefoiled gabled head, restored top of spire. Nave clerestory, three windows each of two pointed lights in two-centred arches with moulded labels and mask and head stops; late C13 south doorway with two-centred arch of two moulded orders with moulded label and mask stops; three mid C14 windows each of two square-headed lights. South porch with two-centred outer archway of two chamfered orders with moulded label and mask stops, responds with attached shafts and moulded capitals and bases, gable with carved apex stone. Chancel: three windows, two mid C14 with two square-headed lights moulded labels and mask stops, low-side window of one square-headed light; mid C14 doorway with chamfered jambs and segmental head, earlier windows jambs visible. Interior: Nave arcades of three bays; north arcade C13 restored 1887 with round arches of one chamfered order with plain labels, octagonal columns with moulded capitals and bases; south arcade, two eastern bays early C13 with arches similar to north arcade, the eastern column is quatrefoil in plan and western column octagonal, both with moulded caps and bases. Tower doorway with two-centred head and chamfered jambs; stair turret doorway with square head. Piscina in east wall and south aisle. Bracket in south aisle. Chancel arch restored reusing some old material. Piscina C14 with chamfered jambs and segmental arch, sedilia of three bays with moulded two-centred arches and labels with head-stops, shafts between the bays with moulded capitals and bases. Brackets on east wall. Chancel screen, restored five bays C15; two bench ends in chancel with poppy-heads and one pew-end with carved heads. Font, C15 octagonal bowl quatrefoiled and sixfoiled panels and modern step. For monuments, floor slabs and memorial glass see RCHM, and VCH. Roofs restored, nave roof with six reset C15 carved angels.</p>		
1237954	Listed Building Grade II	Two tombstone c.14 metres south of west tower of St Remigius Church	Two tombstones. Limestone slabs with segmental heads and inscription on cartouche enriched with fruit and flowers. Left hand tombstone with central coronet and two angel heads, inscribed 'Thomas and Mary son and daughter of Bryan and Mary Morris d.1732 and 17--'. Right hand tombstone with central angel head flanked by rosettes, inscribed to Bryan Morris, d.1817	510894 297306	Medium
1237955	Listed Building Grade II	Tombstone group between c.14 and 17 metres to south of chancel of St Remigius Church	Tombstone group. Four large tombstones. Limestone slabs with round plaques, relief decoration of figures, urns and angels. Identified A-D from north to south. A, inscription unclear; B inscription to Mary? Norton wife of George Norton 1806; C inscription to George Norton 1802; D, with carved head and basket of flowers with rose swags inscribed to Edward Sculthorpe 1810.	510903 297312	Medium

# A47 WANSFORD TO SUTTON DUALLING

## Appendix 6.1 Cultural Heritage Information

NHLE/HER/ WAN Ref	Designation	Name	Description	NGR	Value / Sensitivity
1237956	Listed Building Grade II	Mile post north-west of the Manor House	Mile post. C19. Cast iron. Triangular sectioned with concave head. Painted white with raised inscription painted black. 'TO LONDON 81', 'STILTON 6', 'STAMFORD 8'.	510820 297195	Medium
1237957	Listed Building Grade II	Hall Cottages	Row of five cottages formerly outbuildings to The Hall (demolished c.1730). Possibly late C17 with C18 and early C19 alteration. Coursed limestone rubble with plain ashlar buttressing in line with chimney stacks. Two end stacks and five ridge stacks, end stack to left hand of ashlar, remaining stacks of brick. Collyweston stone slated roof. Two storeys with gabled rear wing. Parapet gables. Six C20 doors one to right hand with porched entrance; nine ground floor windows of various sizes with glazing bars, eight similar first floor casement windows all with brick arches, doorways in round headed brick arches. The former building was converted to farm labourers cottages in the early C19.	5 10816 297290	Medium
1237958	Listed Building Grade II	Stable range c.5 metres south of The Manor House	Stable range. Dated 1881 H on plaque. Coursed limestone rubble with freestone dressings. Collyweston stone slated hipped roof and C19 ridged pantiles. One storey. Three boarded doors, and two double doorways to right hand, three boarded windows all with C20 wooden lintels. Included for group value.	5 10855 297154	Medium
1266114	Listed Building Grade II	5, Mill Road	Early C18 remodelled early C19. Squared coursed limestone with Welsh slate and pantile roof. Originally probably 3-unit plan. 2 storeys. Elevation abutting Main Street has an 8-paned, unhorned sash window to ground floor right, under a wood lintel and a C19 casement window under the eaves to the first floor left. 2 single-light windows to ground floor right of centre. Central C20 door, under rendered head. Ashlar gable parapets, partially rebuilt in brick, to left. Brick and ashlar stacks at ends and lateral brick stack to left of centre. C20 extension to right has lean-to roof with old pantile roof. Rear elevation has central rendered porch, with canted sides and bay window above. Similar flanking bay windows at ground floor, all with sash windows with glazing bars. Sash window to far left and casement window to far right. Interior not inspected but noted as having early C19 staircase with stick balustrade abutting the flanking walls.	5 07195 297706	Medium
1266121	Listed Building Grade II	K6 Telephone Kiosk	Telephone kiosk. Type K6. Designed 1935 by Sir Giles Gilbert Scott. Made by various contractors. Cast iron. Square kiosk with domed roof. Unperforated crowns to top panels and margin glazing to windows and door.	5 06881 297821	High
1266127	Listed Building Grade II	Yarwell House	Shown as Yarwell Manor House on Ordnance Survey map. Farmhouse. Late C18 and mid C19. Squared coursed limestone with Collyweston slate roof. Originally 3-unit plan. 2 storeys. 5-window range of C19 and C20 casements under wood lintels. C20 door to right of centre is also under wood lintel. Large ashlar quoins. Ashlar gable parapets and remains of ashlar stacks at ridge and end. Mid C19 wing to rear. Interior not inspected but noted as having 2 open fireplaces with bressumers and ceiling beams. C19 room, to rear, is noted as having elliptically headed recesses flanking the fireplace.	5 07177 297803	Medium
1266128	Listed Building Grade II	Corner Cottage	House. C17 and C19. Regular coursed limestone with concrete tile roof. Originally 3-unit plan. Single storey with attic. Irregular 3-window range of C19 casements under wood lintels. 4 C20 flat-roofed eaves dormers have casement windows. C18	5 06766 297876	Medium



# A47 WANSFORD TO SUTTON DUALLING

## Appendix 6.1 Cultural Heritage Information

NHLE/HER/ WAN Ref	Designation	Name	Description	NGR	Value / Sensitivity
			part-glazed door, to right of centre, and C20 door to far left, both under wood lintels. Blocked fire window with ashlar jambs to far left. Brick and stone stacks, now rendered, at ridge and ends. Interior not inspected but noted as having an openfireplace with chamfered bressumer. Used for a time as 2 dwellings. Included for group value		
1266129	Listed Building Grade II	Pair of chest tombs approx. 13m S of nave of Church of St. Mary Magdalene	air of chest tombs. Dated 1764 and early C19. Limestone ashlar. Late C18 chest tomb to north has bolection moulded pilasters at corners and partially legible inscription to John Hackett. Early C19 chest tomb, to south, has reeded pilasters at corners and oval panels with inscriptions to Saunderson family.	507097 297748	Medium
1266130	Listed Building Grade II	Mullions	Formerly listed as The Cottage, C17, C18 and C19. Squared coursed limestone with Collyweston slate roof. Originally 2-unit plan with cross passage. Single storey with attic, and 2 storeys. 5-window range. 2-window range, to right, is C17 and has a 2-storey, 5-light, canted bay window with ovolo moulded stone mullions and ashlar gablet with parapets and kneelers. Similar 3-light stone mullion window, to ground floor right, and similar attic window set in stone eaves dormer with ashlar parapets and kneelers. All stone mullion windows have hood moulds. 3-window range, to left, of C19 casement windows under eaves at first floor. 2 plain C20 casement windows at ground floor under renewed wood lintels. C20 door, to centre, has C17 moulded stone surround with square-head. Eaves on 2 levels, ashlar gable parapets, to left, and brick and ashlar stacks at ridge and end. 2-light stone mullion windows to rear. Interior: rooms to left and right of entrance have open fireplaces with bressumers. Cross-passage rooms at back of central stack. 3 bays, to left of main front, remodelled C19 and subdivided to form 2 dwellings.	506921 297808	High
1266132	Listed Building Grade II	Village Pound	Pound. Probably C18 modified C20. Squared coursed limestone walls with stone-on-edge- coping. Rectangular plan with opening in north wall. Wall probably lowered C20. A pound is shown here on the Enclosure Map of 1778. (Northamptonshire Record Office - Enclosure Maps)	506739 297914	Medium
1266143	Listed Building Grade II	Church yard monument approx. 8m N of chancel of Church of St. Mary Magdalene	Church yard monument. Dated 1773. Limestone ashlar. Short rectangular obelisk with arch-head side panels. Partially legible inscription.	507080 297766	Medium
1274387	Listed Building Grade II	Boundary post c.10 metres to east of No. 33	Boundary post C19. Cast iron with stone backing. Triangular sectioned with inscription painted black on white ground 'PARISH BOUNDARY'.	510054 297361	Medium
1274401	Listed Building Grade II	The Manor House	House, formerly a farmhouse and inn. Early to mid C18 with C19 alterations. Coursed limestone rubble with freestone and ashlar dressings. Collyweston stone slated roofs. Two storeys and attics, T-plan with stair turret in angle and single storey gable end range to south. Parapet gables with chamfered copings and moulded corbells continued in moulded wooden eaves cornices with modillions. Three gable end stacks each with two ashlar shafts and ridge stack with three shafts. North elevation; ashlar band between floors, chamfered plinth; C19 gabled	510844 297180	High

# A47 WANSFORD TO SUTTON DUALLING

## Appendix 6.1 Cultural Heritage Information

NHLE/HER/ WAN Ref	Designation	Name	Description	NGR	Value / Sensitivity
			porched entrance with glazed, panelled door and rectangular fanlight, flanking bay windows; four first floor cross framed windows; three hipped dormer windows with casements; (some C17 mullioned windows in rear elevations possibly reused from Hall demolished c.1730, and wooden door jamb carved with jewel ornament also reused). Interior: South wing resited C16 or C17 panelling with arabesque frieze; north wall panelling C17, closed string staircase with turned balusters and square newels. The house was formerly an inn called 'The Farmhouse' in 1742.		
1274428	Listed Building Grade II	No. 3 (Mill Cottage) and 12/173 adjoining range of barns and stables to west and south	Cottage, granary and stables. C18 with early C19 rebuilding and alteration; 1805 dated stone to granary. Coursed limestone rubble with freestone dressings; Collyweston stone slated and Welsh slated roofs. Brick shafts to chimneys. L-plan with cottage to east of east-west range and granary and stables to west forming north-south range. North elevation: Two storey cottage with parapet gables and end stacks, two brick shafts to left hand stack and single shaft to right hand. C20 door and two ground floor casement windows with wooden lintels; two first floor casement windows. Lean-to addition linking cottage to granary. West elevation: two storey granary and stables, one pair of double boarded doors to right hand entrance with segmental headed arch, two casement windows and doorway to left hand and one blocked doorway and window further to left; five first floor casement windows with wooden lintels.	510973 297333	High
1274434	Listed Building Grade II	Water Newton Mill, formerly the Water Mill	Water mill. '1791 J Compton' on dated plaque, with C19 additions and alterations. Converted to dwellings and shop in 1986. Coursed limestone rubble with freestone dressings, Collyweston stone slated roofs, and red pantiled roof. Three storeys and attics to main north-south range with mansard roof, gable extension of two storeys to south formerly linked at right angles to east-west range. Single storey and attic steam engine house to north with western outshut and tapering red brick stack. West elevation: seven main bays, segmental arched head with dropped keystones to all windows with cast iron glazing bars, five first floor and ground floor windows with central four panes pivot hung, second floor windows with eight panes. Two boarded first floor doors; wheel archway to left hand, double glazed doors to left of centre and brick segmental arched opening to right of centre. Internal machinery largely intact, including two wheels one with fourteen foot diameter, two pairs of stones, sash hoists and grain bins.	511006 297384	High
1274435	Listed Building Grade II	The Old Rectory	House formerly the rectory. Early C18 with later additions; porch dated 1894. Coursed limestone rubble with ashlar and freestone dressings. Collyweston stone slated roofs. Two storeys and attics with single storey range to right hand. Parapet gables with brick end stacks and moulded corbels similar to moulded stone eaves cornice. Ashlar band between floors, chamfered plinth. Dated stone porch with chamfered two-centred arch; glazed door with reeded wooden architrave. Two ground floor C19 hung sash windows with margin glazing bars and inserted flat ashlar arched heads; three first floor casement windows and three dormer windows with boarded gables. Original moulded ceiling cornices.	510901 297274	Medium

# A47 WANSFORD TO SUTTON DUALLING

## Appendix 6.1 Cultural Heritage Information

NHLE/HER/ WAN Ref	Designation	Name	Description	NGR	Value / Sensitivity
1274436	Listed Building Grade II	Coffin c.1 metre to south of west tower of St Remigus Church	Coffin. Possibly Roman. Barnack limestone, carved from monolith with original cover.	510874 297316	High
1274655	Listed Building Grade II	Mill Farmhouse	House formerly a farmhouse. C17 with early and late C19 alterations and additions. Coursed limestone rubble with freestone and ashlar dressings. Collyweston stone slated roofs. Two storeys with attics, original L-plan extended to west by one bay and to south by an additional kitchen. C19 entrance in angle facing east. North facade; brick and ashlar end stacks and ridge stack, chamfered copings to parapet gables, chamfered plinth. One French casement window, double hung sash window and canted bay window; three first floor three-light C20 casement windows. Interior: Exposed chamfered and stopped ceiling beams, C19 alteration of original plan and staircase. C17 moulded boarded doors with applied frames to imitate two-panelled early C19 doors. The house was formerly the Miller's house. Included for group value.	510955 297334	Medium
1274656	Listed Building Grade II	Mill Bank Cottage	Cottage, formerly the lock keeper's cottage. Dated 1788 J Compton on plaque with moulded cornice above window. Renovated 1986. Dressed limestone with freestone and ashlar dressings. Collyweston stone slated roof; brick stack to right hand. Keystones and gauged stone flat window and door arches. C20 door and canopy approached by steps to left hand; former segmental planned bay window with hung sashes and shutters replaced by C20 casement window to right hand. Interior plan modified; C20 staircase. Included for group value.	510962 297364	Medium
1274688	Listed Building Grade II	Workshop, former soll to Wansford Paper Mill c.26 metres west of Stibbington House	Workshop, formerly the soll (rag sorting house) of the paper mill. Possibly early C19, with late C19 and C20 alterations. Coursed limestone rubble with freestone dressings. Low pitched hipped Collyweston stone slated roof. Two storeys, entrance facing south with glazed door to right hand and casement window to left hand, two large first floor windows with small panes and segmental brick arches. The soll may have survived the fire in the mill of 1805; it is illustrated in a bill head c.1830 with a double hipped roof, an explosion closed the mill in 1855 and the mill buildings were demolished in 1867. Newspaper was manufactured from bleached rags at the mill for the London Times and Stamford Mercury.	507524 298602	Medium
1274697	Listed Building Grade II	Granary, stables and coach house c.15 metres south of Stibbington Manor	Stables, coach house and granary. Circa. 1850. Rock faced limestone and freestone; Collyweston stone slated roof. One storey and attic, with first floor granary. Double boarded doors and stable doors to left and right hand with two horizontal sliding sash windows with wooden lintels. Hipped roof to loft entry with boarded door approached by stone steps from right hand, two flanking hipped dormer windows with slatted wooden ventilation. Interior of granary complete with storage compartments. Mounting block beside stair. Included for group value.	508877 298639	Medium
1274712	Listed Building Grade II	Stables, coach house and cottage ranges c.5 metres north-west of Stibbington Hall	Stables, coach house and cottage ranges. Mid C19. Rock faced limestone with freestone and ashlar dressings. Collyweston stone slated roofs. One storey and attic main north-west south-east range with stable range to rear forming an L-plan. Main facade; symmetrical with coped parapets to gables and facade dormers. Wide gabled central bay with coach house entry through four-centred arch in square head	508929 298766	Medium

# A47 WANSFORD TO SUTTON DUALLING

## Appendix 6.1 Cultural Heritage Information

NHLE/HER/ WAN Ref	Designation	Name	Description	NGR	Value / Sensitivity
			with moulded label, double boarded doors and two-light window above. Two cottages flanking archway each with two ground floor two-light casement windows, one single-light window and boarded door all with moulded drip moulds; two, two-light casement dormer windows. Ashlar plinth.		
1274755	Listed Building Grade II	Main building, Wansford Railway Station	Offices, formerly the main station building. Circa 1845. Jacobean style qv Stibbington Hall. Designed by J.W Livock; builder, Thompson of Barnack for L.N.W.R. Northampton-Peterborough line. Fine coursed limestone rubble with freestone and ashlar dressings. Welsh slated roofs.	509247 297939	Medium
1274858	Listed Building Grade II	Cottage c.5 metres to north-west of Sibson Manor House	Cottage formerly a bakehouse and brewhouse. Possibly C18 with C19 alterations. Coursed limestone rubble with Collyweston stone slated roof, ashlar end stack to left hand. Two storeys. One ground floor and one first floor wooden casement windows. Doorway in south-east gable. Included for group value.	509519 297685	Medium
1274859	Listed Building Grade II	Signal box to east of Wansford Railway Station	Signal box. Circa 1912. Brick ground storey with timber-framed and boarded first storey. Welsh slated roof with gable bargeboards and finials. Wooden stair to signal box entrance with glazed door. Large four-paned windows arranged in pairs or groups of three. Segmental brick arches to recessed ground storey panels and four-paned windows shaped to arches. Signal box fittings complete. The station was closed in 1957.	509324 297972	Medium
1274860	Listed Building Grade II	Wansford Railway Tunnel c.500 metres west of Wansford Station	Railway tunnel. Completed June 1845 for L.N.W.R. Northampton - Peterborough line by Jones of Sheffield. Coursed rock faced limestone and freestone dressings to embankment walls, brick lined tunnel. Romanesque details to round arch of west portal with two roll-moulded and chamfered orders springing from attached columns with cushion capitals. Single track line with pedestrian side walk to south side. The tunnel was constructed in seventeen months by 1,000 navvies camped in a disused quarry in the parish of Elton	508934 297766	Medium
1274861	Listed Building Grade I	Gateway and Boundary wall to forecourt of Stibbington Hall	Gateway and boundary wall. Circa 1625. Ketton limestone and limestone rubble. Arched opening with semi-circular head and keystone with jewel ornament moulded imposts, sunk spandrels and stop-chamfered responds flanked by Doric pilasters on pedestal, similar to entrance porch of Stibbington Hall with a moulded cornice surmounted by an open ogee-shaped gable enclosing a pierced stone circle with flanking finials and apex finial.	508902 2098726	High
1274862	Listed Building Grade II*	Parish Church of St John the Baptist	Parish Church. Nave and chancel arch early to mid C12, north aisle c.1180. Chancel rebuilt mid C13 and south arcade and aisle rebuilt. In 1848-49 church restored, north and south aisles rebuilt, west tower demolished and vestry, organ chamber, south porch and timber bellcote added. Architect (Protheroe Pevsner) and Teulon. Walls of limestone rubble and dressings of Barnack stone. Roofs of Collyweston stone slates. South elevation: South aisle with gabled roof, two two-light windows, south porch with two-centred outer arch of two continuous chamfered orders. Chancel with three two-light windows, c.1330 each with trefoiled ogee lights and with a quartrefoil in a two-centred head with a moulded label and mask-stops, below the western window a blocked 'low-side' window with a square head; C13 doorway with two-centred arch and moulded imposts. Interior: Nave; north arcade, two wide	509023 2098666	High

# A47 WANSFORD TO SUTTON DUALLING

## Appendix 6.1 Cultural Heritage Information

NHLE/HER/ WAN Ref	Designation	Name	Description	NGR	Value / Sensitivity
			bays c.1180 of round arches with two plain orders and chamfered label, the round column has a scalloped cruciform capital with moulded abacus, and moulded base; south arcade of three partly restored bays with two-centred arches of two chamfered orders, octagonal columns with moulded capitals and bases. Partly restored C12 doorway in west wall with jambs and round arched head of three orders, the inner order plain with shouldered head and modern lintel with tympanum enriched with regulated ornament, two round and roll-moulded orders with outer band of billet-ornament, two detached shafts to jambs with cushion-capitals and modern bases. Chancel arch, round of two square orders the inner with a soffit roll, responds each with a half-round shaft with scalloped capitals and grooved and chamfered abaci continued along the the wall. Font, C12 octagonal bowl with round arch on each face springing from small shafts at the angles with moulded capitals and bases, plain round stem C13 with eight shafts each with moulded capitals and bases, and chamfered plinth. Fragment of stone effigy of priest in chancel and C12 and C13 carved stones.		
1274863	Listed Building Grade II	Chest tomb c. 10 metres east of chancel of parish church of St John the Baptist	Chest tomb. Dated 1781 and 1801 on two inscriptions, each to a John Brickwood. Limestone. Plain coping and stepped plinth, square blustered quoins with reeded pilasters flanking raised rectangular panels.	509040 298654	Medium
1331539	Listed Building Grade II	Manor House	Probably C17 or early C18 house. Long coursed stone rubble range with Collyweston stone roof with gabled ends, with stone coping. One storey and attic. Various irregularly spaced small window openings, casements, and Victorian stone door surround. One hipped dormer and modern brick external chimney stack on front. Modern ridge stack. Right hand end (south) heightened in late C19, also with Collyweston stone roof and large Victorian hipped dormer. Interior: has large open fireplace.	511817 298920	High
1331540	Listed Building Grade II	10 Main Street	Possibly C17 origin or C18 cottage with later alteration at right angles to road. Dressed stone. Slightly pitched Welsh slate roof with gabled ends. Two storeys. Two window range, C19 casements with glazing bars. Left and right hand doorways. Eaves rebuilt in brick. Internal end chimney stacks.	511736 298851	High
1331541	Listed Building Grade II	Punchbowl	A much restored C18 cottage adjoining east end of No 44. Whitewashed stone rubble with thatched roof with gabled ends. One storey and attic. Two window range. Modern casements with glazing bars. Central modern glazed door. Two eyebrow dormers.	511801 299066	Medium
1331542	Listed Building Grade II	15 Main Street	C18 house. Ashlar. Collyweston stone roof with coped gable ends. Two storeys and attic. Three window range. Two light wood mullion transom windows, stone lintels with keyblocks. Central modern door with rectangular fanlight. Two hipped dormers. Internal end chimney stacks. One storey extension to left (south) with asbestos roof.	511728 298936	Medium
1331548	Listed Building Grade II	Manor Farmhouse	C17 house refashioned in early C19. Long coursed stone rubble range with low pitched Welsh slate roof with gabled ends. Wing at rear forming L-shaped plan. Two storeys. Three wide spaced windows. Modern 3 and 4-light casements with glazing	512172 298664	High



# A47 WANSFORD TO SUTTON DUALLING

## Appendix 6.1 Cultural Heritage Information

NHLE/HER/ WAN Ref	Designation	Name	Description	NGR	Value / Sensitivity
			bars. Central canted bay window and doorway to left. Brick end and ridge stacks. Interior: open fireplace in wing and staircase at junction with central octagonal newel-post with shaped finial.		
1331561	Listed Building Grade II	55 Main Street	C17 house. Coursed stone with thatched roof with gabled ends. Projecting gabled cross wing to right (north). Stone coping to gables. Two storeys. Five/six window range. Modern door to right of centre. Rebuilt ashlar ridge stack.	511776 299188	High
1331562	Listed Building Grade II	Nos 111 and 111A Peterborough Road	Early C19 pair of houses. Coursed rubble with ashlar dressings. Welsh slate roof with gabled ends. Three storeys. Four bays, left and right hand blind. Sashes with margin glazing bars, in stone architraves with key blocks. Glazed and panelled door to No 111. Modern window and door to ground floor of No 111A. Central brick chimney stack.	511758 298736	Medium
1331563	Listed Building Grade II	117 Peterborough Road	Early C19 cottage. Coursed stone with ashlar quoins. Welsh slate roof with gabled ends. Two storeys. Three bays. Modern casements in original openings with keyblocks to flat head. First floor centre window blocked. Central doorway with round head with keyblock, blind fanlight and modern door. Included for group value.	511738 298756	Medium
1331579	Listed Building Grade II	The Cabin	C18 cottage with alterations. Stone rubble with rendered front, Pantile roof with gabled ends. One storey and attics. Two modern semi-dormers with catslide roofs. Ground floor has 3 windows and central canted bay replacing door. Modern casements with glazing bars. Chimney stacks at gable ends.	512174 298708	Medium
1393916	Listed Building Grade II	School House including former wash house and pump	Schoolhouse, originally designed as two dwellings for the headmaster and caretaker, converted in the first half of the C20 into a single dwelling for the headmaster, now occupied as a private dwelling. It is a good example of an early 'board' schoolhouse built in the Duke of Bedford's estate style. The building also retains an unusual plan form, designed to accommodate both the headmaster and caretaker. It has group value with the adjacent school, which also survives relatively unaltered.	508537 298594	Medium
N/A	Conservation Area	Thornahaugh	Rural village alongside the A1	506942 300390	Medium
N/A	Conservation Area	Wansford (North)	Rural roadside village at the crossing point of the River Nene and Great North Road, adjacent to the A1.	507367 299274	Medium
N/A	Conservation Area	Wansford (South)	Rural roadside village at the crossing point of the River Nene and Great North Road, adjacent to the A1	507544 298804	Medium
N/A	Conservation Area	Stibbington	Rural village at a former crossing point of the Nene	508980 298643	Medium
N/A	Conservation Area	Sutton	Rural village at a former crossing point of the Nene	509643 298775	Medium
N/A	Conservation Area	Water Newton	Rural village surrounding a medieval water mill and weirs.	510891 297277	Medium
N/A	Conservation Area	Ailsworth	Semi-rural village on a former main road	511743 299054	Medium

# A47 WANSFORD TO SUTTON DUALLING

## Appendix 6.1 Cultural Heritage Information

NHLE/HER/ WAN Ref	Designation	Name	Description	NGR	Value / Sensitivity
N/A	Conservation Area	Castor	Semi-rural village on a former main road	512389 298452	Medium
53916	None	Churchyard Cross (WW1 Memorial), St. Andrews Churchyard, Thornhaugh	The churchyard cross was erected in memory of the fallen of the First World War. A second memorial is within the church (PCCHER 53917). The Cross was designed by Stamford architect H.F. Traylen and the work was undertaken by stonemasons Belton and Goddard of Great Casterton.	506977,300560	Medium
53917	None	World War 2 Memorial Plaque, St Andrews Church	The 1939-1945 memorial for the parish of Thornhaugh-cum-Wansford was dedicated on 30th September 2001 following several years of work by the Stibbington & District Branch of the Royal British Legion. It records the death of Gunner Edward Sydney Emblow 336 Battery, 135th (Herts Yeomanry) Field Regiment, Royal Artillery, who died of his wounds in Singapore on 29th January 1942.	506976,300582	Medium
51601	None	Enclosure	An almost square ditched enclosure (c. 24m x 29m) with a second, slightly larger and more curvilinear enclosure adjoining to the south. Both visible as crop marks. A crop marked ditch adjoining the east side of the enclosures runs north-south for approx. 250m between the A47 and the Wansford to King's Cliffe road.	506460,299420	Low
51617	None	Thornhaugh Roman Road	A Magnetic susceptibility reconnaissance survey was carried out on January 24th 2008 and potentially identified the location of a Roman Road.	506420,299530	Negligible
51618	None	Thornhaugh Quarry (Eastern Extension)	A geophysical survey was carried out in May 2008. Main features included two possible rectilinear ditched enclosures in the north-west corner of the field, one of which contained a cluster of anomalies suggesting the presence of internal features. An area of strong magnetic activity was also identified in the centre of the field.	506200,299500	Negligible
51630	None	Thornhaugh Quarry (Eastern Extension)	An aerial photographic survey was carried out in July 2008 and recorded ditches and suggestions of ditches that closely match the two enclosures identified by the earlier geophysical survey.	506200,299500	Negligible
51636	None	Thornhaugh Quarry (Eastern Extension)	A field walking survey was carried out at Thornhaugh Quarry and identified two concentrations of predominantly later prehistoric lithics (flakes, blades, scrapers, and cores) in correspondence of two enclosures which had been previously located by both geophysical and aerial photographic surveys.	506250,299550	Negligible
50415	None	Findspot - Medieval	O1, One medieval jetton (14th or 15th century) and a George 5th penny.	506970,300660	Negligible
50532	None	Haycock Hotel Trenching	An archaeological watching brief was carried out while an extension was being built to the hotel. The lack of archaeological evidence from any of the areas observed during the investigation and the accumulation of alluvial silt suggests that the location was prone to flooding during late prehistoric and early historic periods.	507564,299109	Negligible
50593	None	World War II Barracks	Second World War Barracks, Concrete base with timber huts. Possibly Polish Airborne troops or special forces. Of temporary use.	506850,299050	Low
50594	None	Aircraft crash site	Aircraft crash site. An Avro Lancaster Mark III, serial No DV197 code VNT. 59 Sqn RAF Skellingthorpe crashed on return due to flak damage over Berlin 31/07/43. Nose buried in ground, tail section broke off and removed at the time.	506930,299420	Low
50595	None	Aircraft crash site	Aircraft crash site. Avro Lancaster, c. 1943/44 nose-dived into ground. Probably much still buried.	507800,299000	Low

# A47 WANSFORD TO SUTTON DUALLING

## Appendix 6.1 Cultural Heritage Information

NHLE/HER/ WAN Ref	Designation	Name	Description	NGR	Value / Sensitivity
50596	None	Nene Valley Service Station	In May 1993 an archaeological evaluation was carried out on land adjacent to a service station. Most of the site consisted of level flood plain, but a large mound was noted in the south-east corner of the site next to the River Nene. The mound was excavated and found to contain large quantities of unopened freshwater mussels, coal, bone, 17th century pottery, river silts and gravels. Evidence suggests that the mound has been formed by periodic dredging of the river.	508350,299650	Negligible
50597	None	Token Findspot	Token, formerly a George III (1797) 'Cartwheel' penny converted to a token and stamped with starburst or cogwheel patterns. Found by owner in garden of house.	509504,298704	Negligible
50635	None	Site of Royal Observer Corps bunker	Reported site of a Royal Observer Corps bunker.	508050,299770	Low
50761	None	Manor House	Dated 1700, date of restoration 1900. Coursed stone house with steeply pitched hipped Collyweston stone roof. H-shaped on plan with five bays. Interior modernised and few features remain	509803,298862	Medium
50773	None	The Old Rectory	Large mid C17 stone house with late C19 additions of 1878. Coursed stone with freestone dressings. Most rooms have moulded plaster cornices, some have chimney pieces with dog ear architraves, ground floor rooms have plain panelling, hall has moulded arch with keyblock.	506997,300609	Medium
50789	None	Sacrewell Farmhouse	Mid C18 house. Coursed stone. Steeply pitched Collyweston stone roof with gabled ends.	507919,300003	Medium
50790	None	Sacrewell Lodge	C18 house. Coursed stone with steeply pitched Collyweston stone roof with gabled end. C19 stone wing at rear.	507531,300892	Medium
50791	None	Sacrewell Mill	Early C18 mill house and watermill dated 1755. Adjoining at right angles. All coursed stone with steeply pitched Collyweston stone roofs. Contains complete mill machinery in working order with a cast iron overshot wheel and pit wheel. There is a great spur wheel and a timber main drive shaft and crown wheel. Two of the original 3 sets of stones remain. There is also a chain hoist operated by the main drive on a windlass principle. Storage bins, chutes and hopper all intact. Including stable wing, now a garage, adjoining north of mill, a long one storey and attic, also stone, with Collyweston stone roof.	507888,300065	High
00181	None	River finds - Roman	2 Ro lamps found in river bed.	508594,299596	Negligible
00189	None	Roman Pit	Roman finds from gravel pit include pottery, money box, dice box, mortar, a stone coffin, and Ro? horseshoe.	508700,299300	Negligible
00190	None	Toll Bar, West of Sutton Heath Cropmarks	In the field known as 'Toll Bar', Sacrewell Farm, are several crop mark circles and enclosures of possible prehistoric or Roman origin which are designated SAM 201.	508700,299800	Negligible
00190a	None	Toll Bar, West of Sutton Heath Cropmarks (a)	track (R Desmond, 14/06/1985). See also RN 00190.	508400,299800	Negligible

# A47 WANSFORD TO SUTTON DUALLING

## Appendix 6.1 Cultural Heritage Information

NHLE/HER/ WAN Ref	Designation	Name	Description	NGR	Value / Sensitivity
00190b	None	Toll Bar, West of Sutton Heath Cropmarks (b)	Linear feature (R Desmond, 14/06/1985). See also RN 00190.	508500,299700	Negligible
00190c	None	Toll Bar, West of Sutton Heath (c)	TL/0870/9968: Double ring ditch: inner ditch c 23m diameter, outer c 30m, 2 parallel ditches run E from inner ditch for c 65m. R2, TL/0869/9969: ? pond barrow c 20m diameter; dark circular mark. See also RN 00190.	508670,299680	Negligible
00190d	None	Toll Bar, West of Sutton Heath (d)	Large rectangular enclosure, short ditch at NW corner leading to small enclosure, also small 3-sided enclosure surrounding square enclosure. R1, rectangular enclosure (R Desmond, 13/06/1985). See also RN 00190.	508700,299900	Negligible
00190e	None	Toll Bar, West of Sutton Heath (e)	See also RN 00190.	508700,299700	Negligible
00190f	None	Toll Bar, West of Sutton Heath (f)	25m diameter. R1, ring ditch (R Desmond, 13/06/1985). See also RN 00190.	508620,299860	Negligible
00190g	None	Toll Bar, West of Sutton Heath (g)	40m diameter, a smaller ring ditch touches on N (see RN 00190h). R1, 25m diameter. R2, ring ditch with ring of pits inside (R Desmond, 13/06/1985). See also RN 00190.	508630,299760	Negligible
00190h	None	Toll Bar, West of Sutton Heath (h)	32m diameter, touches larger ring ditch to S (see RN 00190g). See also RN 00190.	508640,299790	Negligible
01965	None	Chowlock Close, Walleys Field,	Black flint axe found on surface in NE corner of Chowlock Close, Walleys Field, Sacrewell Farm by Mr D O Powell. length 13,5 cm, width 5,0 cm (SW 500). See also RN 01965a for Roman glass.	508100,300700	Negligible
01965a	None	Chowlock Close, Walleys Field,	Two tiny fragments of Ro glass also found on Chowlock Close by Mr Powell. see also RN 01965 for Neo flint axe.	508100,300700	Negligible
01966	None	Walleys Field, Sacrewell Farm	Brown flint axe, polished one side, found on surface of Walleys Field, Sacrewell Farm by Mr D O Powell; length 14,0cms, width 6,5 cms.	508000,300800	Negligible
01967	None	Pump Close, Sacrewell Farm	Polished white flint axe found on surface of Pump Close, Sacrewell Farm by D O Powell; length 12,2 cms, width 5,3 cm.	507300,301000	Negligible
01968	None	Moors Close, Sacrewell Farm	Polished axe of greenstone found on surface of Moors Close, Sacrewell Farm by Mr D O Powell; length 10,8 cms, width 6,0cms.	508100,300900	Negligible
50792	None	Former Thornhaugh County Primary School	Mid C19 school converted from earlier building. Single storey stone range with ashlar front and half hipped thatch roof. Seven bays.	506936,300505	Medium
50793	None	Manor House, Gate Piers.	Gate piers immediately south of Manor House. C18. Large rusticated stone gate piers, square on plan, with cornices and ball finials.	506732,300522	Medium
00059a	None	Middle Ground Field, Sacrewell Farm (a)	Parts of two rooms and the corridor of a house at Sacrewell Lodge (TF/0760-/009-) were dug out in 1928. The sites of two extensive Roman buildings have been found on Sacrewell Farm. A heavy scatter of RB pottery and building debris centred on TF/07638/0046- indicates the site of the Roman building.	507630,300460	Low
00059b	None	Middle Ground Field, Sacrewell Farm (b)	Roman gravestone found in 1949 in ploughing near the site of Ro buildings (RN 00108 ) in a field N of Thornhaugh Brook on Sacrewell Farm (area centred on (TF/076-/003- ). Tombstone inscribed NO ... STRV ...XXV ... LAV	507600,300300	Negligible

# A47 WANSFORD TO SUTTON DUALLING

## Appendix 6.1 Cultural Heritage Information

NHLE/HER/ WAN Ref	Designation	Name	Description	NGR	Value / Sensitivity
01969	None	Bottom Meadow, Sacrewell Farm	Leaf-shaped arrowhead of black flint, very fine quality, found on the surface of Bottom Meadow, Sacrewell Farm by Mr D O Powell in 1973; length 4,0 cms, width 2,0 cms.	508000,301100	Negligible
01970	None	Drummer's Leys, Sacrewell Farm	Grey black flint knife found on the surface of Drummer's Leys field at Sacrewell Farm by D O Powell in 1983; length 9,1 cms, maximum width 1,7 cms.	508600,300200	Negligible
01971	None	Wallets Field, Sacrewell Farm	Two flint End Scrapers (S W 59 and S W 76) and a loom weight of gritstone with hourglass perforation, length 13 cms width 7,3 cms, were found over several years in 1960's by D O Powell on the surface of Wallets Field, Sacrewell Farm.	507800,300600	Negligible
01972	None	Moors Close, Sacrewell Farm	Brown flint knife found on surface of Moors Close field by Mr D O Powell in 1960's; length 6,4cms, maximum width 2,0 cms.	508400,300400	Negligible
01973	None	Middle Ground Field, Sacrewell Farm	A small fired clay male head of a deep pink colour, 5,5 cms high and 5,5 cms from back to front profile, found on the surface of 'Middle Ground' field at Sacrewell Farm in 1973 in the area of a Roman villa.	507500,300400	Negligible
01974	None	Middle Ground Field, Sacrewell Farm	A small iron die for stamping leather or wood. 9/16in by 9/16in, with stem 2 1/4 in long.	507450,300530	Negligible
01975	None	Fishponds, Sacrewell Farm	In constructing commercial fishponds Roman pottery was discovered in the puddled clay lining of an earlier farm pond. Fragments of Ro tegula and imbrex tiles have also been found on the site by Mr D O Powell of Sacrewell Farm. The pottery is of C2 date.	507930,300060	Negligible
01976	None	Waggon Hovel field, Sacrewell Farm	Mr D O Powell possesses several worked flints, mostly scrapers, found on the surface of Waggon Hovel over a period of years from approx 1970 onwards.	507800,299800	Negligible
01977	None	Sacrewell Field, Sacrewell Farm	Worked flints have occasionally been found on the surface of Sacrewell Field by Mr D O Powell (in recent years) of Sacrewell Farm.	507800,300800	Negligible
01978	None	Parson's Close, Sacrewell Farm	Worked flints have occasionally been found in recent years on the surface of Sacrewell Field by Mr D O Powell of Sacrewell Farm.	507600,301300	Negligible
01979	None	Sharpe's Field Close	Sharpe's Field Close, Sacrewell Farm. In recent years Mr D O Powell of Sacrewell Farm has found a few worked flints on Sharpe's Field which lies in the Southern half of Spring Close at Sacrewell Farm.	508300,300300	Negligible
01980	None	Moors Close, Sacrewell Farm	From Moors Close, Sacrewell Farm. Two worked flints found in recent years by Mr D O Powell. See RN 01980a - Ro pottery.	508000,300000	Negligible
01980a	None	Moors Close, Sacrewell Farm	From Moors Close, Sacrewell Farm. One sherd of a Roman reeded neck flagon in buff fabric found in recent years by Mr D O Powell. See RN 01980 - worked flints.	508000,300000	Negligible
01982	None	Lodge Close, Sacrewell Farm	A few worked flints and 1 neck fragment of a Ro coarseware flagon found on Lodge Close by Mr D O Powell of Sacrewell Farm.	507800,300300	Negligible
01984	None	Sacrewell Farm	The WSA collection includes a small iron spear head or javelin head of uncertain date but it strongly resembles known examples from Ro military sites, see W H Manning, Romano - British ironwork in the Museum of Antiquities, Newcastle upon Tyne no 9 - 12,	507000,300000	Negligible
01985	None	Spring Close	A barbarous radiate coin, illegible, was found on the surface of Spring Close by D O Powell 05/05/1966.	508300,300200	Negligible



# A47 WANSFORD TO SUTTON DUALLING

## Appendix 6.1 Cultural Heritage Information

NHLE/HER/ WAN Ref	Designation	Name	Description	NGR	Value / Sensitivity
01986	None	Ring Ditch	R1, A slightly oval ring ditch on gravel at about 55 ft above OD, 80 - 90 feet in diameter. It is visible on an unspecified CUCAP AP.	509390,299030	Low
01987	None	Ring Ditch	A ring ditch 200 yards E of Sutton Pits, on gravel at about 60 ft OD. The ditch appears to be interrupted by four causeways symmetrically placed. It is visible on an unspecified CUCAP AP. See RN 08144 for a U ring ditch nearby.	509510,299130	Low
01988	None	Sacrewell Farm	The late William Scott Abbotts collection of flints at Sacrewell Farm comprises over 600 worked flints including axes, arrowheads, knives, scrapers, spears, cores and indeterminate types, all of which were found on the field complex of Sacrewell Farm.	507000,300000	Negligible
01989	None	Toll Bar Field, Sacrewell, Farm	Several Roman coins have been found on the surface of Toll Bar during field walking during the period 1948 - 84.	508800,299800	Negligible
01990	None	Middle Ground Field, Sacrewell Farm	In an area where surface finds of Ro sherds and building materials are still visible and which are associated with a known villa site, 2 Ro coins were found by the late William Scott Abbott.	507500,300400	Negligible
01991	None	Waggon Hovel Field, Ro Villa site	In 1963 Peterborough Museum Society's Archaeological Field Section excavated a Ro building with a hypocaust and a Roman quarry on the site of the 'Roman Building' marked on the 6 in OS map	507970,299670	Medium
01992	None	Sacrewell Farm	The William Scott Abbott Collection includes over 60 sherds of Samian ware and a large quantity of Ro coarse ware which range in date from mid C2 to late C4 and most probably were collected from the known Ro building sites on Sacrewell Farm.	507000,300000	Negligible
01992a	None	Sacrewell Farm	The William Scott Abbott Collection includes 28 coins which were discovered on Sacrewell Farm but for which there is no recorded provenance. The legends on many are illegible and range from early C2 to late C4.	507000,300000	Negligible
02003	None	Human Remains	Human skeleton with an iron spear head, perhaps of AS date, found 1888. O2, Peterborough Museum have no further information to add to the above report. The spear cannot be traced in the Accession book.	511000,299000	Negligible
02015	None	Iron Spearhead	An iron spearhead resembling those of the Roman period, Length 26,5 cms, max width across blade 4,5 cms, diameter of socket hole 1,5 cms, is labelled Roman found at Wansford.	507000,299000	Negligible
02039	None	Roman Pottery	A collection of 18 sherds of Nene Valley colour-coated wares, several with white scroll decoration en barbotine, plus 1 sherd of samian ware from a Drag 36 bowl with barbotine decoration. No other information available, however, there is a known Ro villa	507000,299000	Negligible
02133	None	Roman Coins	Roman coins from Upton and Wansford. Now in the Peterborough Museum. The museum records are incomplete and only a dupondius of Hadrian is specifically listed as from Upton.	510000,300000	Negligible
02134	None	Iron Cinders (slag)	Iron cinders (slag) found at Upton., Probably Roman, many similar finds known in this area (Upton, King's Cliffe, Fineshade) a good many of which are Roman.	510000,300000	Negligible
02136	None	small Anglo-Saxon settlement	A small AS settlement, several acres of sherds.	510600,300000	Negligible
02137	None	Slag	Small slag scatter.	510800,300000	Negligible

# A47 WANSFORD TO SUTTON DUALLING

## Appendix 6.1 Cultural Heritage Information

NHLE/HER/ WAN Ref	Designation	Name	Description	NGR	Value / Sensitivity
50867	None	Greystone, No.1 Old North Rd	C17 ashlar house. Datestone on front "1657TT". Collyweston stone roof with gabled ends.	507342,299322	Medium
50868	None	Church House, No.5 Bridge End	C18 house. Coursed stone with ashlar quoins and window surrounds. Steeply pitched Collyweston stone roof with coping to end gables.	507384,299261	Medium
50869	None	Meadow Cottage, No.4 Bridge End	Early C18 cottage. Coursed stone. Thatched roof with gabled ends. South end has stone coping to gable. Internal end stacks. One storey and attic, 2 window range.	507373,299220	Medium
50870	None	No.7 Bridge End	C18 house, formerly 2 cottages. Coursed stone with dressed quoins. Steeply pitched Collyweston stone roof with coped gabled ends. Two storeys. Three window range.	507390,299244	Medium
50871	None	Downderry House and Bridge cottage	Range of early C18 houses. Coursed stone with dressed quoins. Steeply pitched Collyweston stone roof with stone coping to south gable end. two storeys and attic. Four window range.	507392,299236	Medium
50872	None	Wharf House, No.11 Bridge End	Early C18 house. Coursed stone with dressed quoins. Steeply pitched Collyweston stone roof with stone coping to end gables. Two storeys and attic. Three window range.	507398,299224	Medium
50873	None	Wharf House (No.11), Barn and Stables	Long range of C18 stone farm buildings with steeply pitched Collyweston stone roofs with gabled ends. The westernmost is 2 storeys and has external stone stairs to first floor door, and has small square window openings.	507403,299236	Medium
50874	None	The Corner House & No.17 Peterborough Rd	Includes No.17 Peterborough Road. C18 range on corner site. Coursed stone with Collyweston stone roof with gabled ends and hipped corner. One storey and attic.	507377,299291	Medium
50875	None	Fielding House, No.3 Bridge End	Early C18 house. Coursed stone with a steeply pitched Collyweston stone roof with stone coping to gabled ends. Modillion eaves. Two storeys and attic. Three bays.	507380,299274	Medium
00217	None	Roman Settlement Evidence	Building stone, stone roofing tile, sherds etc.	509400,298500	Low
00220	None	No.1 Lovers Lane	C17 coursed stone rubble cottage with steeply pitched Collyweston stone roof with gabled ends. 2 storeys. Ground floor 2 windows. First floor 1 window. C19 2-light casements.	509540,298750	Medium
00221	None	The Grange	The Grange is C17 in origin, but was remodelled in 1880. The Victorian remodelled house is H shaped in plan, rock faced stone with Collyweston stone roof.	509470,298660	Medium
00226	None	St John the Baptist	dating from early to mid C12 with C13 chancel, N arcade of c 1180 and C13 S arcade. Completely restored 1848 - 1849 when aisles rebuilt and W tower removed. The church as a whole represents 1848 - 1849.	509030,298670	High
51213	None	Saxon cross shaft	Part of the shaft of a pre-Conquest cross is built into the east gable of the nineteenth century dovecote (00225) bordering the south side of the churchyard.	509534,298716	Low
51265	None	9 Russell Hill, Thornhaugh	A watching brief was carried out during the construction of a house in July 2003 (R1). The investigation revealed a sequence of natural, subsoil and topsoil deposits. A brick built post medieval well or cistern was also identified.	506890,300550	Negligible
51163	None	Thornhaugh Quarry	Observation of quarry soil stripping under an access agreement revealed a ditch running approximately north-west – south-west for 30m near the given grid	506100,299520	Negligible

# A47 WANSFORD TO SUTTON DUALLING

## Appendix 6.1 Cultural Heritage Information

NHLE/HER/ WAN Ref	Designation	Name	Description	NGR	Value / Sensitivity
			reference. The ditch was around 1m wide. A few large unabraded late medieval shelly ware sherds were uncovered.		
54016	None	National Grid Refurbishment Cottam to St Neots	Pre-assigned Event Number. Requested by Headland Archaeology. Awaiting completion of fieldwork and report	510000,298900	None
09884	None	Middle Ground Field, Sacrewell Farm	R1, Trapezoidal enclosure, linear ditches and adjacent probable long barrow. (R Palmer 23/09/1990).	507600,300400	Low
09885	None	Double Ditched Track with Parallel Ditches	Double ditched track plus parallel ditches, linear. Sketched on to existing mapped framework at 1:10,000. (R Palmer 17/07/1990).	508300,300400	Negligible
51116	None	Wing to Peterborough Pipeline	Observation during pipeline construction running from TL/101/989 to TL/102/979 revealed a ditch 2.5m wide and 0.20m deep running NE to SW and a posthole 0.25m diameter and 0.13m deep. No artefacts were recovered.	510154,298510	Negligible
54067	None	The Grange, 15 Nene Way	Pre-assigned event number for watching brief. Assigned to Witham Archaeology (Dale Trimble).	509641,298573	None
53784	None	Russell Hill	In March 2014 staff of APS carried out a watching brief during the excavation of foundations for a dwelling on land at Russell Hill, Thornhaugh. The investigation revealed no archaeological remains. A short length of modern ditch was uncovered.	506790,300450	Negligible
53810	None	Land adjacent to the former Little Chef, Great North Road, Wansford	An archaeological evaluation was undertaken on land adjacent to the former Little Chef, Great North Road, Wansford by Neville Hall on the 1st September 2014 in advance of proposed residential development. R1. No archaeological activity was identified.	507530,299420	Negligible
53698	None	Silk Fishery and Fishponds, Sacrewell	Possible fishery and fishponds identified by documentary evidence.	508024,300073	Negligible
53699	None	Site of former Smithy, Great North Road	A 'smithy' was located on the Great North Road, Thornhaugh on the 1886 OS and remained in existence until at least 1959 (S2).	507270,300568	Low
53717	None	The Grange	Possible traces of ridge and furrow visible on the 2010 Peterborough City Council aerial photograph.	509544.279,298649.833	Negligible
53718	None	Ridge and Furrow	Traces of ridge and furrow visible on Peterborough City Council 's 2012 aerial photograph	509591.784,298434.659	Negligible
53721	None	St. Mary's Church, Wansford	Neville Hall (MiFA) was commissioned on behalf of the Wansford Parochial Church Council, to undertake Level 2 Historic Building Recording and an archaeological watching brief on groundworks pertaining to the construction of a new single storey extension and associated works.	507331.999,299248.85	Negligible
53722	None	St. Mary's Church, Wansford	Neville Hall (MiFA) was commissioned on behalf of the Wansford Parochial Church Council, to undertake Level 2 Historic Building Recording and an archaeological watching brief on groundworks pertaining to the construction of a new single storey extension and associated works.	507331.589,299235.534	Negligible
53529	None	Former Stamford and Wansford Railway	In February 1857, the Stamford and Essendine Railway opened an 8½ mile branch from Stamford East station to Wansford, on the Northampton to Peterborough line of the London and North Western Railway. The stations were at Barnack, Ufford, Wansford Road and Wansford. Closed in 1931.	508957,299638	Moderate

# A47 WANSFORD TO SUTTON DUALLING

## Appendix 6.1 Cultural Heritage Information

NHLE/HER/ WAN Ref	Designation	Name	Description	NGR	Value / Sensitivity
53534	None	Sacrewell Mill, Sacrewell Farm, North Road	Archaeological monitoring of a hand-dug test pit adjacent to the south-eastern gable wall of the watermill was undertaken on 19th February 2013 by Pre-Construct Archaeology in advance of restoration and conservation work to improve visitor access. Excavation identified the Barnack Limestone foundations of the mill, the later brick foundation of a small outbuilding or lean-to structure dated to the 19th century, and an undated metal track.	507905,300057	Negligible
00095	None	Roman Buildings and Potteries	Roman buildings and potteries. 1969 OS report site under corn stubble, no visible remains. OS think that this is probably Sutton Heath Ro site (TF/091/008) scheduled.	509200,300510	Low
00096	None	Roman Settlement Evidence	A small Ro occupation site. No further information. See also RN 00095 for Ro buildings and potteries.	509350,300550	Negligible
09085	None	Ring Ditch and Enclosure	Ring ditch and enclosure visible on air photographs, a) TL/1025/9826 ring ditch, 130 feet in diameter. b) TL/1013/9826 Rectangular, ditched enclosure orientated E to W, 170 feet by 120 feet.	510200,298230	Negligible
09086	None	Sutton Crossways	Ring ditches and enclosures visible on air photographs. (a) TL/1023/9862 ring ditch, diameter 120 feet (b) TL/1038/9869 Double ring ditch, 130 yards NE of 'a', comprising two concentric circles, diameters 100 feet and 120 feet.	510250,298600	Negligible
09087	None	Ring Ditch	Ring ditch about 30m in diameter (TL/1088/9858). Ring ditches. (R Palmer 29/07/1983 CUCAP AP CCW 66 used); O1, (TL/1065/9860) Circular crop marks. AP (Allen 9/39); O2, The field is under crop. No surface irregularities are evident.	510700,298600	Negligible
09102	None	Enclosure and associated earthworks	Enclosure, enclosure system and ditches. (NB TL/108-/997- closely parallel to TL/503-/232- - check sizes?) (R Palmer 03/08/1983 CUCAP AP AFZ 35 used) R2, Undated enclosure 560 yds on glacial gravel at about 70 feet above OD.	510800,299650	Negligible
09103	None	Ditches and enclosure	Enclosure, enclosure system and ditches. (R Palmer 03/08/1983 CUCAP APs AFZ 35, 36 used). O1, Crop marks; rectangular enclosure, probably RB. O2, This site falls on arable land and is at present under crop. No finds have been reported.	511010,299410	Negligible
09113	None	Ditch fragments	Fragments of ditches, also in field to N.	510440,299390	Negligible
09121	None	Ditch Fragments	Ring ditch 15m in diameter.	510470,299440	Negligible
09122	None	Enclosure	Enclosure, Rounded ends with narrow straight sided sides, ends greater in diameter than width of centre. Traces of ditches forming no pattern to W and NW. about 140m away maximum.	510530,299380	Negligible
09166	None	Bronze Age flints and ring ditches	A small group of Bronze Age flints recovered. Ring ditches - 180', 90', 65' and 100' in diameter.	510650,298500	Negligible
09167	None	Trackway	Track running N - S towards the W of enclosure at this NGR. Track's most southerly point TL/1067/9865.	510740,298820	Negligible
08465	None	Castor/Ailsworth Bypass	Excavation of trial pits during construction of Castor / Ailsworth bypass. 10 pits and surrounding area were of potential archaeological interest. The finds have yet to be processed.	510233,299180	Negligible
08466	None	Castor/Ailsworth Bypass	Excavation of trial pits during construction of Castor / Ailsworth bypass. 10 pits and surrounding area were of potential archaeological interest. The finds have yet to be processed.	511069,299306	Negligible

# A47 WANSFORD TO SUTTON DUALLING

## Appendix 6.1 Cultural Heritage Information

NHLE/HER/ WAN Ref	Designation	Name	Description	NGR	Value / Sensitivity
08468	None	Castor/Ailsworth Bypass	During construction of the Castor / Ailsworth bypass 3 boreholes were of potential archaeological interest. A detailed borehole report is awaited from Leonard Threadgold, the contractor.	510510,299180	Negligible
08472	None	Castor/Ailsworth Bypass	Excavation of trial pits during construction of Castor / Ailsworth bypass. 10 pits and surrounding area were of potential archaeological interest. The finds have yet to be processed.	510400,299158	Negligible
8474	None	Castor/Ailsworth Bypass	Excavation of trial pits during construction of Castor / Ailsworth bypass. 10 pits and surrounding area were of potential archaeological interest. The finds have yet to be processed.	510125,299213	Negligible
08359	None	Ring Ditches	Two concentric circles, diameters 100 ft and 80 ft visible on CUCAP APs (unspecified). There are possible traces of a ring of pits within the inner circle.	509550,299240	Negligible
08368	None	Pit alignment	Pit alignment running from TL/0935-/9942 to TL/0950/9926.R1, 400 yds SE of Sutton Toll, on gravel at about 60 ft above OD. It is visible on unspecified CUCAP APs. It extends SE from the modern A47 road for 250 yards.	509350,299420	Negligible
08369	None	Possible Roman Road	Parchmark from TL/0936/9909 to TL/0934/9913 continues to TL/0931/9920. Roman road has been suggested.	509360,299090	Negligible
08463	None	Castor/Ailsworth Bypass	Excavation of trial pits during construction of Castor / Ailsworth bypass. 10 pits and surrounding area were of potential archaeological interest. The finds have yet to be processed.	510639,299171	Negligible
08144	None	Ring Ditch	Immediately S of the ring ditch in RN 01987, is a dark circular mark 40 ft in diameter showing on APs at about 60 ft above OD. This may be another ring ditch.	509530,299110	Negligible
07695	None	Sacrewell farm	Roman pottery.	508050,300050	Negligible
00227	None	Ring Ditch	Ring ditch about 60 feet in diameter, 80 yards N of Sutton Toll, on gravel at about 70 feet OD. Visible on CUCAP APs.R1, Ring ditch, linear ditch. (R. Desmond 13/06/1985 );	509110,299610	Negligible
00228	None	Ridge and Furrow	Ridge and furrow (R Desmond 13/06/1985). Exact location of find site not known.	509600,298800	Negligible
00229	None	Flint findspots	Many flints including transverse arrowheads and blades.	509900,299000	Negligible
00230	None	Posthole	Contractor's slip trench produced an undated post hole.	509260,299550	Negligible
00040	None	Deserted Medieval Village of Sibberton	Site of medieval village of Sibberton. Most of the land at Wansford was a parcel of the manors of Thornhaugh and Sibberton, and may have been created from Sibberton parish. The name of the village is commemorated in 'Sibberton Lodge' (RN 00116).	506150,300020	Medium
00042	None	Thornhaugh 'Henge'	Originally interpreted as a possible henge, this former earthwork feature seems more likely to be an ornate garden feature. The feature is 275 feet in diameter and lies in a shallow, marshy valley north of Manor Farm, Thornhaugh.	506600,300900	Low
53555	None	Thornhaugh Quarry, Peterborough	During 2009 - 2010 a programme of archaeological investigations uncovered Roman pottery and isolated prehistoric flints.	506209.628,299587.55	Negligible
53556	None	Thornhaugh Quarry, Peterborough	During 2009 - 2010 a programme of archaeological investigations uncovered Anglo-Saxon pottery and other datable finds.	506199.17,299590.04	Negligible
53557	None	Thornhaugh Quarry, Peterborough	During 2009 - 2010 a programme of archaeological investigations uncovered Anglo-Saxon pottery and other datable finds.	506202.822,299581.574	Negligible



# A47 WANSFORD TO SUTTON DUALLING

## Appendix 6.1 Cultural Heritage Information

NHLE/HER/ WAN Ref	Designation	Name	Description	NGR	Value / Sensitivity
53558	None	Thornaugh Quarry, Peterborough	R1. During 2009 - 2010 a programme of archaeological investigations uncovered Bronze Age flints and a Late Anglo-Saxon enclosure.	506195.85,299583.732	Negligible
53603	None	Medieval Village of Sibberton	Possible moat associated with the site of the Medieval village of Sibberton or possibly with the manor which fell into disuse in 1428	506240,299991	Low
53604	None	Thornhaugh Manor	A moat associated with Thornhaugh manor house is mentioned on the Rockingham Forest Trust website.	506753,300560	Low
52456	None	Aircraft Crash Site	On 13/3/42 Manchester L7395 of 61 Sqn crashed at Thornaugh due to engine and instrument failure. Crew bailed safely. NOTE: As the actual crash site is unknown, a generic grid reference has been assigned to the HER record.	507000,301000	Low
52237	None	Wansford Staunch, River Nene	One of the many staunches on the River Nene. R2. Staunches (also known as flash locks) can be problematic to navigate. They basically constitute a weir with one gate.	507748,299449	Low
52242	None	Flint Findspots	various flints discovered during the Colonisation of Britain Modern Humans Project.	507000,300500	Negligible
52318	None	Aircraft Crash Site, Sacrewell Lodge	On the 20/07/39 Blenheim L8368 of 23 Sqn was involved in a mid air collision with Blenheim L1448 at Sacrewell Lodge.	507629.443,300785.354	Low
52319	None	Aircraft Crash Site	On 20/07/39 Blenheim L1448 was involved in a mid air collision with Blenheim L8368. NOTE: As the actual crash site is unknown, a generic grid reference has been assigned to the HER record.	507631.716,300777.018	Low
52360	None	Aircraft Crash Site	14/8/44 Lancaster I PD208 BQ-V of 550 Sqn crashed at Wansford. NOTE: As the actual crash site is unknown, a generic grid reference has been assigned to the HER record.	507344,299744	Low
52361	None	Aircraft Crash Site	On 19/8/44 Master AZ359 of 7 (P)AFU crashed 2 miles from Wansford. NOTE: As the actual crash site is unknown, a generic grid reference has been assigned to the HER record.	507329.048,299743.021	Low
52369	None	Aircraft Crash Site	21/3/45 a Halifax of 1665 HCU crashed 4 miles South East of Wittering. NOTE: As the actual crash site is unknown, a generic grid reference has been assigned to the HER record.	507000,300500	Low
52378	None	Aircraft Crash Site	On 3/9/41 Hampden I X2919 VN of 50 Sqn crashed between Wansford and Wittering Airfield. NOTE: As the actual crash site is unknown, a generic grid reference has been assigned to the HER record.	507000.937,301000.532	Low
52051	None	St. Michael and All Angels Church, Sutton	An archaeological watching brief was commissioned by the Friends of the Church of St. Michael and All Angels, Sutton to take place during transforming building work on the church in the spring and summer of 2010. Early Medieval pottery was uncovered.	509520,298710	Negligible
52052	None	St. Michael and All Angels Church, Sutton	An archaeological watching brief was commissioned by the Friends of the Church of St. Michael and All Angels, Sutton to take place during transforming building work on the church in the spring and summer of 2010. Early Medieval pottery was uncovered.	509520,298710	Negligible

# A47 WANSFORD TO SUTTON DUALLING

## Appendix 6.1 Cultural Heritage Information

NHLE/HER/ WAN Ref	Designation	Name	Description	NGR	Value / Sensitivity
52053	None	St. Michael and All Angels Church, Sutton	An archaeological watching brief was commissioned by the Friends of the Church of St. Michael and All Angels, Sutton to take place during transforming building work on the church in the spring and summer of 2010. Early Medieval pottery was uncovered.	509520,298710	Negligible
52054	None	St. Michael and All Angels, Sutton	An archaeological watching brief was commissioned by the Friends of the Church of St. Michael and All Angels, Sutton to take place during transforming building work on the church in the spring and summer of 2010. Early Medieval pottery was uncovered.	509520,298710	Negligible
52078	None	Thornhaugh Quarry Eastern Extension, Thornhaugh	An archaeological trial trenching at Thornhaugh Quarry revealed tentative evidence for occupation was encountered in the form of a poorly-defined charcoal rich layer possibly representing an Early Medieval occupation horizon in the north-west corner, iron production in the middle of the site in the form of a bloomery oven, slag and burnt clay and possible quarrying at the southern limits of the site.	506200,299600	Negligible
52109	None	Ailsworth	Metal artefact found in Ailsworth parish. Recorded by the Portable Antiquity Scheme. CAM-OE1731: Copper alloy strap end (c.AD800-900)	511000,299000	Negligible
52117	None	Wansford	1. 2 seal matrix found in Wansford parish. Recorded by the Portable Antiquity Scheme. IHS-8F72A7: Lead circular seal matrix (AD1240-1300) HIS-D28DB1: Lead seal matrix (AD1250-1400)	508000,299000	Negligible
51946	None	Church Street	An archaeological watching brief was undertaken by Northamptonshire Archaeology during the construction of a foundation trench at Church Street, Wansford. No archaeological deposits were present and no artefacts were recovered.	507400,299300	Negligible
07854	None	Thumb pot	Roman thumb pot.	509700,298800	Negligible
07856	None	Dredging finds	Fishing net weight "dredged from the River Nene". Bronze bracelet, found with broken pot and bones.	507500,299300	Negligible
07857	None	iron findspot	C13 iron key with circular bow, solid shank, 1,7in long.	507000,299000	Negligible
07940	None	Flint scatter	124 assorted worked flints, flakes, scrapers, cores etc. from the river. See also RN 00130 Mes flints from Wansford in Peterborough Museum.	507000,299000	Negligible
05648	None	Mound	Mound, on 50ft contour line, 600yds WNW of the church, was roughly circular but is now almost formless.	508500,298800	Negligible
05665	None	Enclosure	Enclosure part of N and W sides of enclosure? rectangular.	509910,299650	Negligible
00057	None	Holy Well	The names of Sacrewell Lodge (TF/075-/008-) and Sacrewell Farm (TF/079-/003-) are thought to derive from a nearby holy well. Not mentioned by Hope in 'Holy Wells of England' 1893	507000,300000	Low
00059	None	Middle Ground Field, Sacrewell Farm	Roman ironworks shown on map. See also RN 00059a for Ro building, villa coins, RN 00059b for Ro gravestones.	507740,300460	Negligible
00123	None	Neolithic Handaxe	6 inches long with polished end was found near the river at Wansford.	507000,299000	Negligible
00124	None	Hillside, No.19 Old North Road	Old North Road, No 19 (Hillside) and former workshop to S. Dated 1850. Estate cottage in Tudor style built for cooper George Eyres - stone barrel with initials G E in panel on front. Coursed stone with free stone dressings.	507320,299470	Negligible

# A47 WANSFORD TO SUTTON DUALLING

## Appendix 6.1 Cultural Heritage Information

NHLE/HER/ WAN Ref	Designation	Name	Description	NGR	Value / Sensitivity
00125	None	Gold Coin	Gold coin 'British' found 'near Wansford Bridge'.	507400,299150	Negligible
00127a	None	St Mary the Virgin	Medieval grave	507480,299150	Low
00120a	None	Spearhead	Spearhead of c 920 AD, the dating was confirmed personally by T C Lethbridge. Found in the "1930s". See also RN 00120b - Neo axe, 00120c - Ro pottery.	507520,298650	Negligible
00120b	None	Neolithic Axe	Lower half of a highly polished stone axe. Finds made in the "1930s". See also RN 00120a - AS spearhead, 00120c - Ro pottery.	507520,298650	Negligible
00120c	None	Anglo-Saxon spearhead	See also RN 00120a - AS spearhead, 00120c - Neo axe.	507520,298650	Negligible
00121	None	Cist burial	A cist containing an urn and cremation was found near Wansford Paper Mills about 1836, (R1, R2). A cist burial, containing a fine and early example of an overhanging rim urn.	507500,298700	Low
00122	None	Roman Buildings	Roman buildings and ironworking shown on plan. The area is known to have produced Roman material but it is not certain whether there are houses there or more kiln sites.	507800,298800	Low
00129	None	Anglo-Saxon spearhead	Anglo-Saxon spearhead found by I Drayton of the Haycock Hotel. Now in the inn. Mr Drayton, owner of the Haycock Hotel, confirmed in 1971 the site of the find which was made "about 20 years ago".	507550,299290	Negligible
00130	None	Mesolithic flint finds	Mesolithic flint finds recovered by The Colonisation of Britain by Modern Humans Project.	507500,299500	Negligible
00131	None	Roman Building	Site of Roman building	507970,299670	Low
10044	None	Field System	Possible field traces plus pit row. (R Palmer 28/06/1990).	509300,299900	Low
10050	None	Linear Boundaries	Linear boundaries including double-ditched length. Sketched at 1:10,000 with minimal control. (R Palmer 28/06/1990).	509900,298300	Negligible
01588	None	Slag Scatter	Small slag scatter. Also at TL/107-/999-.	510100,299900	Negligible
01589	None	Ridge and Furrow	Cultivation remains. The open fields of the parish were enclosed in 1843. The only traces of ridge and furrow that remain are immediately N of Upton Lodge (TL/102-/997-), where three interlocked curved furlongs meet along the course of a small stream.	510200,299700	Negligible
01590	None	Early Iron-Age and Roman sherd scatter and slag heap.	Early IA and Ro sherd scatter and slag.	510600,299500	Negligible
01591	None	Anglo-Saxon sherds and slag heap	A few AS sherds, slag and some flints.	510900,299700	Negligible
00173	None	Stibbington Hall	House 70 yards NW of the church, built on E-shaped plan in 1625 with small slightly earlier wing at N end. 2 storey, Ketton stone, Collyweston slate roof. Complete example of its period with the main front almost completely unaltered.	508920,298730	High
04389	None	Sutton Heath, Romano-British site	Enclosures (A Spedding 24/04/1984).Field walking demonstrates the presence of a number of Roman buildings - their stone walls still well preserved in spite of recent ploughing. A large quantity of Roman pottery in very good condition has been recovered.	508750,300550	Low

# A47 WANSFORD TO SUTTON DUALLING

## Appendix 6.1 Cultural Heritage Information

NHLE/HER/ WAN Ref	Designation	Name	Description	NGR	Value / Sensitivity
04389a	None	Sutton Heath, Romano-British site	Some Post-Med brick and one sherd of Westerwald pottery was noted, as well as a general spread of natural stone. See also RN 04389 for Roman settlement.	508750,300550	Low
00044	None	Thornhaugh 'Henge'	Fishpond complex now levelled.	506700,300900	Negligible
04474	None	Enclosure	Traces of an enclosure. (H Snape 21/11/1983)	508000,298800	Negligible
00045	None	Limestone Quarry	Post-medieval limestone quarry.	506890,300800	Negligible
00046a	None	St Andrews Church	C15 rectangular grave slab of Ketton stone with a single line shaft.	506980,300585	Low
00047	None	Conduit Head	Russell Hill (north side). Conduit head immediately south of numbers 5 and 7. Dated 1839. Small ashlar structure with raised parapet with date in panel and arched recess beneath with iron lions head fountain with basin below.	506950,300550	Low
00476	None	Roman quern	Roman quern found 1896, in gravel pit. R2, Grid ref for find - ? TL/1140/9876.O2, The base stone of a quern from Ailsworth (no precise location) is in the reserve collection at Peterborough Museum. It is classified as Roman.	511000,299000	Negligible
50010	None	Pit alignment	Pit alignment running from the given grid reference to TF/0983/0069.	509260,300270	Negligible
50012	None	Ermine street	Route of Roman road running from TF/0994/0000 to TF/0928/0100.	509940,300010	Low
50342	None	Roman Building	Roman building located 1 km north-west of the village, close to the Roman road. It was found in 1934 during quarrying operations (Peels Quarry). A large building, with stone paved floors was discovered together with a small pillared hypocaust, drying room, bath or room heating and quantities of 'late Roman pottery'. No other details are available. It was destroyed by quarrying.	506180,299140	Low
50343	None	Roman iron working	Roman iron workings.	507650,299950	Negligible
51861	None	Thornhaugh Quarry (Eastern Extension)	A field walking survey identified a small and diffuse scatter of Roman material (abraded pottery sherds and tile) which was interpreted as being associated with the Roman road that marks the southern boundary of the development site.	506250,299550	Negligible
51862	None	Thornhaugh Quarry (Eastern Extension)	A field walking survey carried out at Thornhaugh Quarry identified medieval abraded pottery sherds.	506250,299550	Negligible
51863	None	Thornhaugh Quarry (Eastern Extension)	A field walking survey carried out at Thornhaugh Quarry identified fragments of post medieval glazed pottery, brick, tile and glass.	506250,299550	Negligible
51905	None	Stibbington, nr. Roman Drive	Roman pottery found at Stibbington at TL/086/988, alongside a footpath. The assemblage includes rims, bases and body sherds of Nene Valley colour-coated ware (brown, red and grey) and grey ware. Forms comprise bowls, cups and mortaria.	508600,298800	Negligible
10250	None	Roman Road	Roman road (Ermine Street) survives as wonderful agger 10m wide, 0.5m high, NW of Upton Lodge. Approximate grid ref.	510800,298700	Low
11038	None	Excavation	On May 4th to 6th, 1993, excavations comprising 2 trenches did not reveal any archaeological features. See RN 11039 for other area.	508280,299630	Negligible
11039	None	Excavation	O1, On May 4th to 6th, 1993, excavations revealed an accumulation of post-medieval debris including unopened mussels, coal, bone, C17 sherds, river silts and gravels. This is probably the result of periodic dredging of the River Nene in the post-medieval period. No other archaeological features were revealed	508280,299630	Negligible
11837	None	Anglo-Saxon moot	Possible Anglo-Saxon hundred or wapentake meeting place.	507400,299100	/Medium

# A47 WANSFORD TO SUTTON DUALLING

## Appendix 6.1 Cultural Heritage Information

NHLE/HER/ WAN Ref	Designation	Name	Description	NGR	Value / Sensitivity
01570	None	Roman Pottery	Pottery found in March 1957 by Eric Standon. Three pieces of Nene Valley ware, one piece of colour coated ? Colchester ware and one grey ware jar. ? Excavation, indicated by completeness of finds.	508200,299100	Negligible
01571	None	Roman Pottery	Sherds of a mortarium, colour-coated ware (including imitation Samian D38, Castor ware box and flagon neck) and painted ware.	508200,299000	Negligible
01584	None	Bronze-Age flint scatter	A few BA flints.	510300,298500	Negligible
01585	None	Sutton Cross	The base of a medieval cross at the junction of Ermine Street and Sutton Crossways. The rectangular cross base (29 inches x 33 inches) with a rectangular socket is now set in a concrete surround.	510762,298846	Low
01586	None	Ridge and Furrow	Cultivation remains. The open fields of Sutton were not finally enclosed legally until 1903, though only two people worked the land in the C19 and physical enclosure took place in 1880. Fragmentary traces of ridge and furrow exist or can be seen on AP.	510000,298500	Negligible
01653	None	Ring Ditch	On gravel at about 55ft above OD, diameter 80 ft, shown on unspecified CUCAP AP. See RN 08340 for Prehistoric polished stone axe nearby.	509830,299110	Negligible
00173a	None	Stibbington Hall	Entrance gateway to Stibbington Hall. The porch bears the arms of Peter Edwards impaling those of his wife Joan Knight of Piddington, with beneath the initials of Joan and her second husband John Hangar.	508920,298730	Medium
00173b	None	Stibbington Hall	Fish ponds ? Three marked on map of 1838. See also RN 00173 - Stibbington Hall, RN 00173a - entrance gateway West of Stibbington Hall	509220,298800	Low
00174	None	Burial	"A stone coffin hewn out of one block measuring 6ft 8ins x 2ft 5ins and 16ins deep, without cover, found in E Midlands Gravel Company's digging at Wansford (sic); a skeleton and urn from it had been broken into fragments".	508500,299400	Negligible
00176	None	Burial	Bronze age Cist burial	508350,299850	Low
00177	None	Roman burials and finds	Large quantity of Ro pottery (mainly kiln wasters), 6 Roman burials and a few C3 - C4 coins.	508400,299400	Negligible
00178	None	Barrow and ring ditch	Mound 600 yds W N W of Stibbington Church, was roughly circular, but is now almost formless and in bad condition. R2, Large barrow circle visible on Major Allen's air photos 9/14, 9/37 and 9/62.	508610,299020	Negligible
00178a	None	Roman fort	Possible Roman fort (playing card). (R Desmond 14/06/1985). See also RN 00178 for Bronze-Age ring ditch. .	508600,299000	High
00179	None	Roman findspot	selection of Roman finds.	508600,299100	Negligible
00180	None	Roman findspot	Roman pottery and brooch found at River Nene.	508610,299590	Negligible
MPB4620	None	Shrunken village at Upton	The remains of the shrunken village is well preserved in pasture consist of a hollow way running W-E which meets another running N-S and remains of house platforms. House platforms particularly good to N of path running W to church. Fairly substantial earthworks noted to South of St John the Baptist's Church in orchard of farmhouse. Hollow way running E-W noted with earthworks to South. There are also slight earthworks in the field South of the Manor House.	510949,300550	Medium



# A47 WANSFORD TO SUTTON DUALLING

## Appendix 6.1 Cultural Heritage Information

NHLE/HER/ WAN Ref	Designation	Name	Description	NGR	Value / Sensitivity
MPB4229	None	Manor House	Manor House. Coursed stone range with steeply pitched Collyweston stone roof with stone coping to gable ends. Two storeys. Three window range. First floor, three 2-light and 3-light ovolo moulded stone mullion windows with four-centre, arch headed, lights and drip moulds. Leaded pane casement windows. Central four-centred arch headed, lights and drip mould and depressed spandrels. Ashlar end and off-centre chimney stacks with drip moulds. Small C18/19 wing at rear.	511079,300479	Medium
MPB5524	None	St John The Baptist's Church	chancel, nave and N aisle. The chancel roof is covered with blue slate, and those of the nave and aisle with collyweston slates. The E wall of the nave is the oldest part of the church in situ, and dates from the early C12. The plan of the nave has not altered since that time, although much has been replaced. At the end of C12, the N aisle was added; the arcade shafts and responds of that date still remain. The N aisle was replaced by a wider aisle in C17, when the arches belonging to the N arcade were also rebuilt. The S and W walls of the nave were rebuilt C17 and C18. The chancel was rebuilt C19 (1842). The N aisle is at a higher level than the nave and is approached by stone steps. The E end is screened to form a vestry. There is a large P med monument in the N aisle to the Dove family.	511019,300579	High
MPB1974	None	Iron Age Enclosure	Pit alignment R3, Trapezoid enclosure plus super imposed pit row running approximately E - W	509500,300799	Negligible
MPB5380	None	Roman Road	Possible Roman road, visible as a parchmark running from the given grid reference to TF/1013/0108.	510029,301039	Low
MPB5370	None	Medieval Pottery Scatter	Medieval pottery scatter. Re-deposited pottery on the west side of a track way running south for about 100m.	510941,300629	Negligible
MPB5512	None	double-ditched track/road	A double ditched track/road with what seems to be metalling (visible as a parchmark)	509599,300500	Negligible
MPB1408	None	Medieval Earthworks	Field boundaries, banked enclosures overlying Med ridge and furrow	510699,300599	Negligible
MPB1689	None	Neolithic Flint Scatter	A Neolithic site with flint scatter, including leaf-shaped arrowhead.	510799,300699	Negligible
MPB1686	None	Medieval Slag Heap	Small slag scatter	510400,300599	Negligible
MPB4230	None	Model Farmhouse	Tablet dated 1685. Coursed stone house, square on plan with steeply pitched hipped Collyweston stone roof. Two storeys. Three by 3 bays. Three-light to left of centre. Two modern hipped dormers. Ashlar chimney stacks with cornices. Wing on the west side of late C19, stone with Collyweston stone roof with gabled end, 2 storeys, and single storey extension. Interior: Victorian dog-leg staircase. Chamfered ceiling beams. The old barns were extended in the 19th century with additional barns that look like engine sheds.	510545,300399	Medium
MPB3481	None	Former site of Upton Village Hall	Circa 1912 Upton village hall was constructed, consisting of a small green painted corrugated iron hut. It was still in existence in 2002 but has since been demolished and the land now appears to be part of Glebe House. The village hall had various uses including a drill hall for the Upton and Sutton Home Guard.	510621,300504	Low
MPB3129	None	Manor Garden	What appears to be a garden and a sundial associated with the manor are visible on Peterborough City Council's aerial photos and historic maps of the area	511028,300476	Low

# A47 WANSFORD TO SUTTON DUALLING

## Appendix 6.1 Cultural Heritage Information

NHLE/HER/ WAN Ref	Designation	Name	Description	NGR	Value / Sensitivity
MPB4497	None	Top Lodge Farm	Various features across the area surrounding Top Lodge Farm, centred on TF100/010. Eleven separate feature groups were revealed. These include a triple linear ditch(TF090009); a probable oval ring ditch(TF091007); three sides of a rectangular enclosure (possibly related to the triple linear ditch)(TF091009); a row of pits cutting a rectangular enclosure(TF095008); two arcs created by a series of elongated pits (presented as a causewayed enclosure by EH)(TF099005); two or three sides of a rectangular enclosure; a double ditched ring ditch(TF103015); four small features of unknown origin(TF104014); an elongated cursus like feature which is almost certainly created by a tractor(TF090004); an apparently pentagonal enclosure which are suggested recent field divisions(TF091003); series of ditches forming part of a system of droves and large rectangular enclosures(TF092006).	509999,300999	Low
MPB2229	None	Upton Causewayed Enclosure	A Neolithic causewayed enclosure and pit alignment were identified as crop marks on aerial photographs in 1996. The crop marks comprise an incomplete double arc of segmented ditches representing around half of a complete circuit. Both circuits are visible on the south-west side, and appear to be converging. More fragmented traces are visible to the east and north-east. The visible crop marks suggest an enclosure of at least 200 metres across.	509999,300599	Medium
MPB1690	None	Upton Lodge Finds	Pre-Roman blue glass bead with annulet found S of Upton Lodge - Now (1949) in Peterborough Museum	510299,301029	Negligible
MPB5854	None	Ridge and furrow project: Upton	Medieval ridge and furrow at Sutton, visible on aerial photographs dating from 1946 to 1991	509670,300805	Negligible
MPB4420	None	Findspot scatter - Roman to victorian	Finds scatter. 26 items were found in this area by metal detector dating from the Roman to Victorian periods.	510699,300399	Negligible
WAN1	Locally Listed Building	Former Wansford Road Station	Former station building, platform, linesmans hut and platform. Converted to a private dwelling, now unoccupied	508946,299628	Medium
WAN2	Locally Listed Building	Wansford Railway No6 Bridge	Railway bridge carrying the existing A47 over a disused Stamford and Wansford Railway	508984,299570	Medium
WAN3	None	Site of Milepost	Noted on 1st edition mapping. No longer extant	507283,300552	Negligible
WAN4	None	Weir	Noted on 1st edition mapping. No longer extant	507778,299478	Negligible
WAN5	None	Site of Milestone	Noted on 1st edition mapping. No longer extant	508315,299694	Negligible
WAN6	None	Flaxen Ford	Noted on 1st edition mapping. No longer extant	508713,299570	Negligible
WAN7	None	Site of Milestone	Noted on 1st edition mapping. No longer extant	508967,299662	Negligible
WAN8	None	Site of Sutton Toll	Noted on 1st edition mapping. No longer extant	509116,299531	Negligible
WAN9	None	Site of Milestone	Noted on 1st edition mapping. No longer extant	509858,299296	Negligible
WAN10	None	Former quarry	Noted on 1st edition mapping. No longer extant	507331,300493	Negligible
WAN11	Locally Listed Building	Heath House	Former Station master's house. Now a private dwelling	508956,299726	Medium
WAN12	None	Former Quarry	Noted on 1st edition mapping. Now a mostly-infilled pond	509980, 299236	Negligible
WAN13	Locally Listed Building	Roadhouse	1930s Bauhaus inspired roadhouse. Now offices.		Medium

## A47 WANSFORD TO SUTTON DUALLING

### Appendix 6.1 Cultural Heritage Information

NHLE/HER/ WAN Ref	Designation	Name	Description	NGR	Value / Sensitivity
-	None	19th-20th century woodland plantation	Historic Landscape Character type	N/A	Negligible
-	None	"Ancient" woodland	Historic Landscape Character type	N/A	Low
-	None	Built up areas – urban development	Historic Landscape Character type	N/A	Negligible
-	None	Communications – motorways, railways	Historic Landscape Character type	N/A	Negligible
-	None	Disused mineral extraction	Historic Landscape Character type	N/A	Negligible
-	None	Formal parliamentary style – 18th century and later enclosure	Historic Landscape Character type	N/A	Negligible
-	None	Later enclosure – piecemeal by agreement	Historic Landscape Character type	N/A	Negligible
-	None	Post 1950's enclosure	Historic Landscape Character type	N/A	Negligible
-	None	'Prairie fields' – post 1950's boundary loss	Historic Landscape Character type	N/A	Negligible
-	None	'Prairie fields' with relict elements – post 1950's boundary loss	Historic Landscape Character type	N/A	Negligible
-	None	Site of special scientific interest	Historic Landscape Character type	N/A	Negligible
-	None	Water reservoir	Historic Landscape Character type	N/A	Negligible
-	None	Waterway – major river	Historic Landscape Character type	N/A	Low

## 6.5. Assessment of Impact Before Site-Specific Mitigation

6.5.1. Unless otherwise noted, impacts are adverse. For a discussion of significant impacts, please refer to ES Chapter 6 (Cultural Heritage) (**TR010039/APP/6.1**). The impact assessment includes in-design mitigation but does not account for any site-specific detailed mitigation recommendations. The impact after mitigation is detailed in ES Chapter 6 (Cultural Heritage) (**TR010039/APP/6.1**).

# A47 WANSFORD TO SUTTON DUALLING

## Appendix 6.1 Cultural Heritage Information

Table 5: Assessment of impact

NHLE/ HER/ WAN Ref Name	Designation	Value / Sensitivity	Description of impact	Magnitude of impact	Significance
1006835 / 1127445 / 00126 / Wansford Bridge	Scheduled Monument, Listed Building Grade I	High	Asset within the ZTV, not ZVI. Site observations confirm the ZTV overlap is from inaccessible roof lines and from the tops of trees which otherwise screen the asset	No Change	Neutral
1006880 / Sutton Heath, Romano-British site	Scheduled Monument	High	Asset is within the ZTV but not sensitive to setting impacts	No Change	Neutral
1006836 / Wansford Roman site	Scheduled Monument	High	Asset is within the ZTV but not sensitive to setting impacts	No Change	Neutral
1006796 / Cropmark site of a barrow cemetery and a quadrilateral ditched enclosure, together with pits and a pit alignment, approximately 837m south-east of Sacrewell Farmhouse	Scheduled Monument	High	<p>Asset is partially within the proposed scheme boundary and is immediately adjacent. Unknown archaeological remains related to the asset inside and outside of the scheduling boundary may be removed during construction</p> <p>Physical removal of 6m by 9m triangle (approx. 27m<sup>2</sup>) of land from the south-eastern corner. No known significant remains will be removed but there is potential for small or ephemeral remains, masked by geological anomalies.</p> <p>Asset is within the ZTV but not sensitive to setting impacts from the proposed scheme</p>	Minor Adverse	Moderate Adverse
1006837 / 00267 / Roman fort and enclosure at Sutton Cross	Scheduled Monument	High	Asset is within the ZTV but not sensitive to setting impacts	No Change	Neutral
1006810 / MPB4620 / Shrunken Village at Upton	Scheduled Monument	High	Asset is within the ZTV but has no upstanding remains that would be particularly sensitive to setting impacts. It does have a setting in which the open land in Upton can be appreciated but this overlaps the ZTV only from inaccessible tree tops.	No Change	Neutral
1006847 / Moated Site, Castor Manor Farm	Scheduled Monument	High	Asset is within the ZTV but not sensitive to setting impacts	No Change	Neutral
1006864 / Roman Site in Normangate Field	Scheduled Monument	High	Asset is within the ZTV but not sensitive to setting impacts	No Change	Neutral

# A47 WANSFORD TO SUTTON DUALLING

## Appendix 6.1 Cultural Heritage Information

NHLE/ HER/ WAN Ref Name	Designation	Value / Sensitivity	Description of impact	Magnitude of impact	Significance
1006863 / Site of Roman Villa NE of Sibson Hollow	Scheduled Monument	High	Asset is within the ZTV but not sensitive to setting impacts	No Change	Neutral
1006862 / Roman Villa SW of Castor Station	Scheduled Monument	High	Asset is within the ZTV but not sensitive to setting impacts	No Change	Neutral
1020124 / Bowl Barrow 450m North East of Water Newton Mill	Scheduled Monument	High	Asset within the ZTV, not ZVI. Site observations confirm the ZTV overlap is from the tops of trees which otherwise screen the asset	No Change	Neutral
1021429 / The Fort and Roman Walled Town of Durobrivae and its South, West and East Suburbs, Immediately South and East of Water Newton Village	Scheduled Monument	High	Asset within the ZTV, not ZVI. Site observations confirm the ZTV overlap is from the tops of trees which otherwise screen the asset	No Change	Neutral
1126807 / Village Farmhouse	Listed Building Grade II	High	Asset within the ZTV, not ZVI. Site observations confirm the ZTV overlap is from inaccessible roof lines and from the tops of trees which otherwise screen the asset	No Change	Neutral
1126866 / Spring Cottage	Listed Building Grade II	Medium	Asset within the ZTV, not ZVI. Site observations confirm the ZTV overlap is from inaccessible roof lines and from the tops of trees which otherwise screen the asset	No Change	Neutral
1126867 / 115 Peterborough Road	Listed Building Grade II	Medium	Asset within the ZTV, not ZVI. Site observations confirm the ZTV overlap is from inaccessible roof lines and from the tops of trees which otherwise screen the asset	No Change	Neutral
1126868 / Wheatsheaf Public House	Listed Building Grade II	Medium	Asset within the ZTV, not ZVI. Site observations confirm the ZTV overlap is from inaccessible roof lines and from the tops of trees which otherwise screen the asset	No Change	Neutral
1126897 / Thatchcroft	Listed Building Grade II	Medium	Asset within the ZTV, not ZVI. Site observations confirm the ZTV overlap is from inaccessible roof lines and from the tops of trees which otherwise screen the asset	No Change	Neutral
1127436 / 01585 / Sutton Cross	Listed Building Grade II	High	The cross itself is screened from the Proposed Scheme by dense vegetation. The asset is most often viewed from the existing Peterborough	No Change	Neutral



# A47 WANSFORD TO SUTTON DUALLING

## Appendix 6.1 Cultural Heritage Information

NHLE/ HER/ WAN Ref Name	Designation	Value / Sensitivity	Description of impact	Magnitude of impact	Significance
			Road and this includes views toward the Proposed Scheme however, as the character of the proposed scheme is almost identical to the current environment, and will be slightly further away, no impact is predicted		
1126863 / 12 Allotment lane	Listed Building Grade II	Medium	Asset within the ZTV, not ZVI. Site observations confirm the ZTV overlap is from inaccessible roof lines and from the tops of trees which otherwise screen the asset	No Change	Neutral
1126864 / Kek cottage	Listed Building Grade II	Medium	Asset within the ZTV, not ZVI. Site observations confirm the ZTV overlap is from inaccessible roof lines and from the tops of trees which otherwise screen the asset	No Change	Neutral
1126865 / 51 Main Street	Listed Building Grade II	High	Asset within the ZTV, not ZVI. Site observations confirm the ZTV overlap is from inaccessible roof lines and from the tops of trees which otherwise screen the asset	No Change	Neutral
1126898 / South View	Listed Building Grade II	Medium	Asset within the ZTV, not ZVI. Site observations confirm the ZTV overlap is from inaccessible roof lines and from the tops of trees which otherwise screen the asset	No Change	Neutral
1126899 / 44 main Street	Listed Building Grade II	High	Asset within the ZTV, not ZVI. Site observations confirm the ZTV overlap is from inaccessible roof lines and from the tops of trees which otherwise screen the asset	No Change	Neutral
1126900 / The Cottage	Listed Building Grade II	High	Asset within the ZTV, not ZVI. Site observations confirm the ZTV overlap is from inaccessible roof lines and from the tops of trees which otherwise screen the asset	No Change	Neutral
1126901 / Walnut House	Listed Building Grade II	High	Asset within the ZTV, not ZVI. Site observations confirm the ZTV overlap is from inaccessible roof lines and from the tops of trees which otherwise screen the asset	No Change	Neutral
1126902 / 19 Main Street	Listed Building Grade II	High	Asset within the ZTV, not ZVI. Site observations confirm the ZTV overlap is from inaccessible roof lines and from the tops of trees which otherwise screen the asset	No Change	Neutral
1126903 / 39 Main Street	Listed Building Grade II	Medium	Asset within the ZTV, not ZVI. Site observations confirm the ZTV overlap is from inaccessible roof lines and from the tops of trees which otherwise screen the asset	No Change	Neutral
1126904 / 43 Main Street	Listed Building Grade II	Medium	Asset within the ZTV, not ZVI. Site observations confirm the ZTV overlap is from inaccessible roof lines and from the tops of trees which otherwise screen the asset	No Change	Neutral
1126905 / 47 Main Street	Listed Building Grade II	Medium	Asset within the ZTV, not ZVI. Site observations confirm the ZTV overlap is from inaccessible roof lines and from the tops of trees which otherwise screen the asset	No Change	Neutral
1127437 / Top Lodge Farmhouse	Listed Building Grade II	High	Asset within the ZTV, not ZVI. Site observations confirm the ZTV overlap is from the tops of trees which otherwise screen the asset	No Change	Neutral
1127438 / Wall to East of Model Farmhouse	Listed Building Grade II	Medium	Construction activities may physically impact the asset by collision, vibration or other ground movement	Major adverse	Large Adverse

# A47 WANSFORD TO SUTTON DUALLING

## Appendix 6.1 Cultural Heritage Information

NHLE/ HER/ WAN Ref Name	Designation	Value / Sensitivity	Description of impact	Magnitude of impact	Significance
Fronting Road and Turning Westwards at Road Junction					
1127439 / Dovecot East South East of Manor House	Listed Building Grade II	Medium	Asset within the ZTV, not ZVI. Site observations confirm the ZTV overlap is from the tops of trees which otherwise screen the asset	No Change	Neutral
1127440 / MPB5524 / Church of St John The Baptist	Listed Building Grade I	High	Asset within the ZTV, not ZVI. Site observations confirm the ZTV overlap is from inaccessible roof lines and from the tops of trees which otherwise screen the asset	No Change	Neutral
1127441 / Keepers Cottage	Listed Building Grade II	High	Asset within the ZTV, not ZVI. Site observations confirm the ZTV overlap is from inaccessible roof lines and from the tops of trees which otherwise screen the asset	No Change	Neutral
1127442 / 00127 / Church of St Mary The Virgin	Listed Building Grade I	High	Asset within the ZTV, not ZVI. Site observations confirm the ZTV overlap is from inaccessible roof lines and from the tops of trees which otherwise screen the asset	No Change	Neutral
1127443 / 50868 / Church House	Listed Building Grade II	Medium	Asset within the ZTV, not ZVI. Site observations confirm the ZTV overlap is from inaccessible roof lines and from the tops of trees which otherwise screen the asset	No Change	Neutral
1127456 / 00047 / Conduit Head Immediately South of Nos 5 And 7	Listed Building Grade II	Medium	Asset within the ZTV, not ZVI. Site observations confirm the ZTV overlap is from inaccessible roof lines and from the tops of trees which otherwise screen the asset	No Change	Neutral
1127457 / Apple Acre Cottage	Listed Building Grade II	High	Asset within the ZTV, not ZVI. Site observations confirm the ZTV overlap is from inaccessible roof lines and from the tops of trees which otherwise screen the asset	No Change	Neutral
1127458 / 00043 / Manor House	Listed Building Grade II*	High	Asset within the ZTV, not ZVI. Site observations confirm the ZTV overlap is from inaccessible roof lines and from the tops of trees which otherwise screen the asset	No Change	Neutral
1127459 / Thornhaugh Post Office	Listed Building Grade II	Medium	Asset within the ZTV, not ZVI. Site observations confirm the ZTV overlap is from inaccessible roof lines and from the tops of trees which otherwise screen the asset	No Change	Neutral
1127460 / 50792 The Former Thornhaugh County Primary School	Listed Building Grade II	Medium	Asset within the ZTV, not ZVI. Site observations confirm the ZTV overlap is from inaccessible roof lines and from the tops of trees which otherwise screen the asset	No Change	Neutral
1127463 / Barn to South of Sibberton Lodge	Listed Building Grade II	Medium	Asset within the ZTV, not ZVI. Site observations confirm the ZTV overlap is from inaccessible roof lines and from the tops of trees which otherwise screen the asset	No Change	Neutral

# A47 WANSFORD TO SUTTON DUALLING

## Appendix 6.1 Cultural Heritage Information

NHLE/ HER/ WAN Ref Name	Designation	Value / Sensitivity	Description of impact	Magnitude of impact	Significance
1127493 / Sacrewell Mill and Mill House and Stables	Listed Building Grade II*	High	Temporary closure of access roads may lead to a reduction in maintenance measures and educational value for the regional community. Magnitude of impact is unknown as this depends on duration and frequency of closures.  Loss of associated land to the south of the asset will damage the historic setting of the structure	Minor Adverse	Slight Adverse
1127494 / 1-7, Meadow Lane	Listed Building Grade II	Medium	Asset within the ZTV, not ZVI. Site observations confirm the ZTV overlap is from inaccessible roof lines and from the tops of trees which otherwise screen the asset	No Change	Neutral
1127495 / Croft Farmhouse	Listed Building Grade II	Medium	Asset within the ZTV, not ZVI. Site observations confirm the ZTV overlap is from inaccessible roof lines and from the tops of trees which otherwise screen the asset	No Change	Neutral
1127496 /00224 / 50773 The Old Rectory	Listed Building Grade II	High	Asset within the ZTV, not ZVI. Site observations confirm the ZTV overlap is from inaccessible roof lines and from the tops of trees which otherwise screen the asset	No Change	Neutral
1127514 / 00223 / Village Pound	Listed Building Grade II	Medium	Asset within the ZVI and would be visible in views from The Drift towards the proposed Scheme. However, existing screening form hedges and trees reinforces the setting of the asset, which is its relationship with the settlement to the east and south, which would not be affected	No Change	Neutral
1127515 / 19, Graeme Road	Listed Building Grade II	High	Asset within the ZTV, not ZVI. Site observations confirm the ZTV overlap is from inaccessible roof lines and from the tops of trees which otherwise screen the asset	No Change	Neutral
1127516 / 50761 / Manor House	Listed Building Grade II	High	Asset within the ZTV, not ZVI. Site observations confirm the ZTV overlap is from inaccessible roof lines and from the tops of trees which otherwise screen the asset	No Change	Neutral
1127517 / 00222 / Church of St Michael	Listed Building Grade I	High	Asset within the ZTV, not ZVI. Site observations confirm the ZTV overlap is from inaccessible roof lines and from the tops of trees which otherwise screen the asset	No Change	Neutral
1127518 / 00225 / 51213 Dovecot East North East of The Grange	Listed Building Grade II	Medium	Asset within the ZTV, not ZVI. Site observations confirm the ZTV overlap is from inaccessible roof lines and from the tops of trees which otherwise screen the asset	No Change	Neutral
1222046 / Goss Cottage	Listed Building Grade II	Medium	Asset within the ZTV, not ZVI. Site observations confirm the ZTV overlap is from inaccessible roof lines and from the tops of trees which otherwise screen the asset	No Change	Neutral
1222417 / Riverside	Listed Building Grade II	Medium	Asset within the ZTV, not ZVI. Site observations confirm the ZTV overlap is from inaccessible roof lines and from the tops of trees which otherwise screen the asset	No Change	Neutral
1222418 / Number 4 (Waters Edge) And Wall	Listed Building Grade II	High	Asset within the ZTV, not ZVI. Site observations confirm the ZTV overlap is from inaccessible roof lines and from the tops of trees which otherwise screen the asset	No Change	Neutral

# A47 WANSFORD TO SUTTON DUALLING

## Appendix 6.1 Cultural Heritage Information

NHLE/ HER/ WAN Ref Name	Designation	Value / Sensitivity	Description of impact	Magnitude of impact	Significance
and Outbuilding to South East					
1222420 / 18 20, London Road	Listed Building Grade II	Medium	Asset within the ZTV, not ZVI. Site observations confirm the ZTV overlap is from inaccessible roof lines and from the tops of trees which otherwise screen the asset	No Change	Neutral
1222421 / Butchers Shop	Listed Building Grade II	Medium	Asset within the ZTV, not ZVI. Site observations confirm the ZTV overlap is from inaccessible roof lines and from the tops of trees which otherwise screen the asset	No Change	Neutral
1222423 / Barn Circa 50 Metres North East of The Haycock Inn	Listed Building Grade II	Medium	Asset within the ZTV, not ZVI. Site observations confirm the ZTV overlap is from inaccessible roof lines and from the tops of trees which otherwise screen the asset	No Change	Neutral
1224316 / 1, Nene Way	Listed Building Grade II	High	Asset within the ZTV, not ZVI. Site observations confirm the ZTV overlap is from inaccessible roof lines and from the tops of trees which otherwise screen the asset. Some long-distance views of the proposed scheme may be possible from upper windows, but this was not possible to access. The proposed scheme would remove traffic from the existing road and lessen urbanising elements but also reduce the indexing effect that reinforces the relationship to the historic transport network	Negligible Adverse  Negligible Beneficial	Slight adverse  Slight beneficial
1224371 / 00221 / The Grange	Listed Building Grade II	High	Asset within the ZTV, not ZVI. Site observations confirm the ZTV overlap is from inaccessible roof lines and from the tops of trees which otherwise screen the asset	No Change	Neutral
1224408 / 12, Nene Way	Listed Building Grade II	Medium	Asset within the ZTV, not ZVI. Site observations confirm the ZTV overlap is from inaccessible roof lines and from the tops of trees which otherwise screen the asset	No Change	Neutral
1225258 / Stone Cottage	Listed Building Grade II	Medium	Asset within the ZTV, not ZVI. Site observations confirm the ZTV overlap is from inaccessible roof lines and from the tops of trees which otherwise screen the asset	No Change	Neutral
1225298 / 00046 / Church of St Andrew	Listed Building Grade I	High	Asset within the ZTV, not ZVI. Site observations confirm the ZTV overlap is from inaccessible roof lines and from the tops of trees which otherwise screen the asset	No Change	Neutral
1225898 / Elizabethan Cottage	Listed Building Grade II	High	Asset within the ZTV, not ZVI. Site observations confirm the ZTV overlap is from inaccessible roof lines and from the tops of trees which otherwise screen the asset	No Change	Neutral
1225934 / 50875 / Fielding House	Listed Building Grade II	Medium	Asset within the ZTV, not ZVI. Site observations confirm the ZTV overlap is from inaccessible roof lines and from the tops of trees which otherwise screen the asset	No Change	Neutral
1226378 / K6 Telephone Kiosk	Listed Building Grade II	High	Asset within the ZTV, not ZVI. Site observations confirm the ZTV overlap is from inaccessible roof lines and from the tops of trees which otherwise screen the asset	No Change	Neutral

# A47 WANSFORD TO SUTTON DUALLING

## Appendix 6.1 Cultural Heritage Information

NHLE/ HER/ WAN Ref Name	Designation	Value / Sensitivity	Description of impact	Magnitude of impact	Significance
1237866 / 00128 / The Haycock Hotel	Listed Building Grade II*	High	Asset within the ZTV, not ZVI. Site observations confirm the ZTV overlap is from inaccessible roof lines and from the tops of trees which otherwise screen the asset	No Change	Neutral
1237907 / Forge and Stable Range Circa 40 Metres North of The Haycock Inn	Listed Building Grade II	High	Asset within the ZTV, not ZVI. Site observations confirm the ZTV overlap is from inaccessible roof lines and from the tops of trees which otherwise screen the asset	No Change	Neutral
1238018/ 00220 / 1, Lovers Lane	Listed Building Grade II	High	Asset within the ZTV, not ZVI. Site observations confirm the ZTV overlap is from inaccessible roof lines and from the tops of trees which otherwise screen the asset	No Change	Neutral
1265884 / County Boundary Post Beside West Side Cutwater Parapet	Listed Building Grade II	Medium	Asset within the ZTV, not ZVI. Site observations confirm the ZTV overlap is from the tops of trees which otherwise screen the asset	No Change	Neutral
1266453 / Avebury Cottage	Listed Building Grade II	High	Asset within the ZTV, not ZVI. Site observations confirm the ZTV overlap is from inaccessible roof lines and from the tops of trees which otherwise screen the asset	No Change	Neutral
1266496 / Sacrewell Farmhouse	Listed Building Grade II	Medium	Loss of associated land to the south of the asset will damage the historic setting of the structure and widening of the access road will add urbanising elements to the asset.	Minor Adverse	Slight adverse
1274413 / 2, Graeme Road	Listed Building Grade II	High	Asset within the ZTV, not ZVI. Site observations confirm the ZTV overlap is from inaccessible roof lines and from the tops of trees which otherwise screen the asset	No Change	Neutral
1274512 / Drayton Place	Listed Building Grade II	Medium	Asset within the ZTV, not ZVI. Site observations confirm the ZTV overlap is from inaccessible roof lines and from the tops of trees which otherwise screen the asset	No Change	Neutral
1274607 / 6 8, London Road	Listed Building Grade II	Medium	Asset within the ZTV, not ZVI. Site observations confirm the ZTV overlap is from inaccessible roof lines and from the tops of trees which otherwise screen the asset	No Change	Neutral
1274652 / The Old House and Rear Boundary Wall	Listed Building Grade II	Medium	Asset within the ZTV, not ZVI. Site observations confirm the ZTV overlap is from inaccessible roof lines and from the tops of trees which otherwise screen the asset	No Change	Neutral
1274685 / 6 8, Elton Road	Listed Building Grade II	High	Asset within the ZTV, not ZVI. Site observations confirm the ZTV overlap is from inaccessible roof lines and from the tops of trees which otherwise screen the asset	No Change	Neutral
1274687 / 18-24, Elton Road	Listed Building Grade II	Medium	Asset within the ZTV, not ZVI. Site observations confirm the ZTV overlap is from inaccessible roof lines and from the tops of trees which otherwise screen the asset	No Change	Neutral



# A47 WANSFORD TO SUTTON DUALLING

## Appendix 6.1 Cultural Heritage Information

NHLE/ HER/ WAN Ref Name	Designation	Value / Sensitivity	Description of impact	Magnitude of impact	Significance
1331233 / Sacrewell Lodge	Listed Building Grade II	Medium	The asset would be visible from the proposed new access to A1 cottages. This is a re-surface and slight widening of an existing track and will not affect the setting of the asset	No Change	Neutral
1331243 / Graeme House	Listed Building Grade II	High	Asset within the ZTV, not ZVI. Site observations confirm the ZTV overlap is from inaccessible roof lines and from the tops of trees which otherwise screen the asset	No Change	Neutral
1331253 / 50793 Gate Piers Immediately South of Manor House	Listed Building Grade II	Medium	Asset within the ZTV, not ZVI. Site observations confirm the ZTV overlap is from inaccessible roof lines and from the tops of trees which otherwise screen the asset	No Change	Neutral
1331254 / 2, 4 And 6, Russell Hill	Listed Building Grade II	Medium	Asset within the ZTV, not ZVI. Site observations confirm the ZTV overlap is from inaccessible roof lines and from the tops of trees which otherwise screen the asset	No Change	Neutral
1331255 / 00116 / Sibberton Lodge	Listed Building Grade II*	High	Asset within the ZTV, however site observations confirm the ZTV overlap is mostly from inaccessible roof lines and from the tops of trees which otherwise screen the asset. Some long-distance views may be possible toward the elements of the proposed scheme which are limited to the on-line improvements of the existing A1 carriageway and will not affect the setting of the asset	No Change	Neutral
1331283 / Model Farmhouse	Listed Building Grade II	Medium	Setting may be severely damaged if the associated wall (1127438) is damaged	Moderate Adverse	Moderate Adverse
1331284 / 00043 / MPB4229 / Manor House	Listed Building Grade II	High	Asset within the ZTV, not ZVI. Site observations confirm the ZTV overlap is from inaccessible roof lines which otherwise screen the asset	No Change	Neutral
1331285 / MPB3129 Sundial in Paddock Immediately West of Manor House	Listed Building Grade II	High	Asset not within the ZTV – screened by vegetation and buildings	No Change	Neutral
1331286 / Primrose Cottage	Listed Building Grade II	Medium	Asset within the ZTV, not ZVI. Site observations confirm the ZTV overlap is from inaccessible roof lines and from the tops of trees which otherwise screen the asset	No Change	Neutral
1394044 / K6 Telephone Kiosk	Listed Building Grade II	High	Asset within the ZTV, not ZVI. Site observations confirm the ZTV overlap is from inaccessible roof lines and from the tops of trees which otherwise screen the asset	No Change	Neutral
1428204 / Thornhaugh And Wansford War Memorial	Listed Building Grade II	High	Asset within the ZTV, not ZVI. Site observations confirm the ZTV overlap is from inaccessible roof lines and from the tops of trees which otherwise screen the asset	No Change	Neutral
1222419 / Templar House	Listed Building Grade II	Medium	Asset within the ZTV, not ZVI. Site observations confirm the ZTV overlap is from inaccessible roof lines and from the tops of trees which otherwise screen the asset	No Change	Neutral

# A47 WANSFORD TO SUTTON DUALLING

## Appendix 6.1 Cultural Heritage Information

NHLE/ HER/ WAN Ref Name	Designation	Value / Sensitivity	Description of impact	Magnitude of impact	Significance
1237717 / Barnaby House and Outbuilding and Garden Boundary Wall to Rear	Listed Building Grade II	Medium	Asset within the ZTV, not ZVI. Site observations confirm the ZTV overlap is from inaccessible roof lines and from the tops of trees which otherwise screen the asset	No Change	Neutral
1274654 / Wansford Bridge (To Cambridgeshire County Boundary)	Listed Building Grade I	High	Asset within the ZTV, not ZVI. Site observations confirm the ZTV overlap is from the tops of trees which otherwise screen the asset	No Change	Neutral
1274865 / 17, Elton Road	Listed Building Grade II	Medium	Asset within the ZTV, not ZVI. Site observations confirm the ZTV overlap is from inaccessible roof lines and from the tops of trees which otherwise screen the asset	No Change	Neutral
1222044 / 13 And 15, Elton Road	Listed Building Grade II	Medium	Asset within the ZTV, not ZVI. Site observations confirm the ZTV overlap is from inaccessible roof lines and from the tops of trees which otherwise screen the asset	No Change	Neutral
1274864 / 1-11, Elton Road	Listed Building Grade II	Medium	Asset within the ZTV, not ZVI. Site observations confirm the ZTV overlap is from inaccessible roof lines and from the tops of trees which otherwise screen the asset	No Change	Neutral
1237793 / 30, London Road	Listed Building Grade II	Medium	Asset within the ZTV, not ZVI. Site observations confirm the ZTV overlap is from inaccessible roof lines and from the tops of trees which otherwise screen the asset	No Change	Neutral
1274653 / 32, London Road	Listed Building Grade II	Medium	Asset within the ZTV, not ZVI. Site observations confirm the ZTV overlap is from inaccessible roof lines and from the tops of trees which otherwise screen the asset	No Change	Neutral
1222422 / Stable Range Attached to East of Number 34	Listed Building Grade II	Medium	Asset within the ZTV, not ZVI. Site observations confirm the ZTV overlap is from inaccessible roof lines and from the tops of trees which otherwise screen the asset	No Change	Neutral
1237799 / 34, London Road	Listed Building Grade II	Medium	Asset within the ZTV, not ZVI. Site observations confirm the ZTV overlap is from inaccessible roof lines and from the tops of trees which otherwise screen the asset	No Change	Neutral
1237832 / 36 38 40, London Road	Listed Building Grade II	Medium	Asset within the ZTV, not ZVI. Site observations confirm the ZTV overlap is from inaccessible roof lines and from the tops of trees which otherwise screen the asset	No Change	Neutral
1127444 / 50870 / 50871 / Bridge Cottage, Downderry House	Listed Building Grade II	Medium	Asset within the ZTV, not ZVI. Site observations confirm the ZTV overlap is from inaccessible roof lines and from the tops of trees which otherwise screen the asset	No Change	Neutral
1222045 / Bedford Row Morva Bass Post Office	Listed Building Grade II	Medium	Asset within the ZTV, not ZVI. Site observations confirm the ZTV overlap is from inaccessible roof lines and from the tops of trees which otherwise screen the asset	No Change	Neutral

# A47 WANSFORD TO SUTTON DUALLING

## Appendix 6.1 Cultural Heritage Information

NHLE/ HER/ WAN Ref Name	Designation	Value / Sensitivity	Description of impact	Magnitude of impact	Significance
1222364 / Cross Keys Public House	Listed Building Grade II	Medium	Asset within the ZTV, not ZVI. Site observations confirm the ZTV overlap is from inaccessible roof lines and from the tops of trees which otherwise screen the asset	No Change	Neutral
1222412 / Sydney House	Listed Building Grade II	High	Asset within the ZTV, not ZVI. Site observations confirm the ZTV overlap is from inaccessible roof lines and from the tops of trees which otherwise screen the asset	No Change	Neutral
1225965 / Barn and Stables Adjoining Rear (East) Of Wharf House	Listed Building Grade II	Medium	Asset within the ZTV, not ZVI. Site observations confirm the ZTV overlap is from inaccessible roof lines and from the tops of trees which otherwise screen the asset	No Change	Neutral
1331288 / 50872 / 50873 Wharf House	Listed Building Grade II	Medium	Asset within the ZTV, not ZVI. Site observations confirm the ZTV overlap is from inaccessible roof lines and from the tops of trees which otherwise screen the asset	No Change	Neutral
1225937 / 7, Bridge End	Listed Building Grade II	High	Asset within the ZTV, not ZVI. Site observations confirm the ZTV overlap is from inaccessible roof lines and from the tops of trees which otherwise screen the asset	No Change	Neutral
1331256 / Stables to West of Sibberton Lodge	Listed Building Grade II	Medium	Asset within the ZTV, however site observations confirm the ZTV overlap is mostly from inaccessible roof lines and from the tops of trees which otherwise screen the asset. Some long-distance views may be possible toward the elements of the proposed scheme which are limited to the on-line improvements of the existing A1 carriageway and will not affect the setting of the asset	No Change	Neutral
1266086 / 50867 / Greystone	Listed Building Grade II	Medium	Asset within the ZTV, not ZVI. Site observations confirm the ZTV overlap is from inaccessible roof lines and from the tops of trees which otherwise screen the asset	No Change	Neutral
1266207 / Barn to South East of Sibberton Lodge	Listed Building Grade II	Medium	Asset within the ZTV, however site observations confirm the ZTV overlap is mostly from inaccessible roof lines and from the tops of trees which otherwise screen the asset. Some long-distance views may be possible toward the elements of the proposed scheme which are limited to the on-line improvements of the existing A1 carriageway and will not affect the setting of the asset	No Change	Neutral
1331287 / 50874 / The Corner House	Listed Building Grade II	Medium	Asset within the ZTV, not ZVI. Site observations confirm the ZTV overlap is from inaccessible roof lines and from the tops of trees which otherwise screen the asset	No Change	Neutral
1225917 / 50869 / Meadow Cottage	Listed Building Grade II	Medium	Asset within the ZTV, not ZVI. Site observations confirm the ZTV overlap is from inaccessible roof lines and from the tops of trees which otherwise screen the asset	No Change	Neutral
1127462 / Sibberton Lodge Cottage	Listed Building Grade II	Medium	Asset within the ZTV, not ZVI. Site observations confirm the ZTV overlap is from inaccessible roof lines and from the tops of trees which otherwise screen the asset	No Change	Neutral

# A47 WANSFORD TO SUTTON DUALLING

## Appendix 6.1 Cultural Heritage Information

NHLE/ HER/ WAN Ref Name	Designation	Value / Sensitivity	Description of impact	Magnitude of impact	Significance
1331249 / 00124 / Hillside and Former Workshop to South	Listed Building Grade II	Medium	Asset within the ZTV, not ZVI. Site observations confirm the ZTV overlap is from inaccessible roof lines and from the tops of trees which otherwise screen the asset	No Change	Neutral
1331276 / Great North Road Bridge Carrying North Bound Carriageway Over the River Nene	Listed Building Grade II*	High	Asset within the ZVI. Site observations confirm the ZTV overlap would be intermittent views of improved existing carriageway and the proposed Sacrewell access road. However, only for a very brief moment while on the asset itself and its approaches. The proposed scheme would not affect the setting of the asset	No Change	Neutral
1161364 / 45 Main Street	Listed Building Grade II	Medium	Asset within the ZTV, not ZVI. Site observations confirm the ZTV overlap is from inaccessible roof lines and from the tops of trees which otherwise screen the asset	No Change	Neutral
1163093 / Dovecot to west of Village Farmhouse	Listed Building Grade II	Medium	Asset within the ZTV, not ZVI. Site observations confirm the ZTV overlap is from inaccessible roof lines and from the tops of trees which otherwise screen the asset	No Change	Neutral
1222034 / Sibson Manor House	Listed Building Grade II	High	Asset within the ZTV, not ZVI. Site observations confirm the ZTV overlap is from the tops of trees which otherwise screen the asset	No Change	Neutral
1222035 / Granary c.25 metres south of Sibson Manor House	Listed Building Grade II	Medium	Asset within the ZTV, not ZVI. Site observations confirm the ZTV overlap is from the tops of trees which otherwise screen the asset	No Change	Neutral
1222036 / Sibson House Hotel	Listed Building Grade II	High	Asset within the ZTV, not ZVI. Site observations confirm the ZTV overlap is from inaccessible roof lines and from the tops of trees which otherwise screen the asset	No Change	Neutral
1222037 / No. 29 old Great North Road	Listed Building Grade II	Medium	Asset within the ZTV, not ZVI. Site observations confirm the ZTV overlap is from the tops of trees which otherwise screen the asset	No Change	Neutral
1222038 / 6, 10, 12, 18 and 20, Old Great North Road	Listed Building Grade II	Medium	Asset within the ZTV, not ZVI. Site observations confirm the ZTV overlap is from the tops of trees which otherwise screen the asset	No Change	Neutral
1222040 / Entrance gate piers to park boundary wall of Stibbington Hall	Listed Building Grade II	High	Asset within the ZTV, not ZVI. Site observations confirm the ZTV overlap is from the tops of trees which otherwise screen the asset	No Change	Neutral
1222042 / Garden boundary wall and doorway c.15 metres	Listed Building Grade II	Medium	Asset within the ZTV, not ZVI. Site observations confirm the ZTV overlap is from inaccessible roof lines and from the tops of trees which otherwise screen the asset	No Change	Neutral

# A47 WANSFORD TO SUTTON DUALLING

## Appendix 6.1 Cultural Heritage Information

NHLE/ HER/ WAN Ref Name	Designation	Value / Sensitivity	Description of impact	Magnitude of impact	Significance
north of No. 41 (The Old Rectory)					
1222043 / Stibbington Manor, outbuilding and service yard boundary wall	Listed Building Grade II	High	Asset within the ZTV, not ZVI. Site observations confirm the ZTV overlap is from inaccessible roof lines and from the tops of trees which otherwise screen the asset	No Change	Neutral
1222174 / Three Barns Circa 10 Metres To North West Of Sibson House Hotel And Stone Mounting Block, Great North Road	Listed Building Grade II	Medium	Asset within the ZTV, not ZVI. Site observations confirm the ZTV overlap is from inaccessible roof lines and from the tops of trees which otherwise screen the asset	No Change	Neutral
1222196 / Viaduct to east of Wansford Railway Station	Listed Building Grade II	Medium	Asset within the ZTV, not ZVI. Site observations confirm the ZTV overlap is from the tops of trees which otherwise screen the asset	No Change	Neutral
1222241 / Stibbington Hall	Listed Building Grade I	High	Asset within the ZTV, not ZVI. Site observations confirm the ZTV overlap is from the tops of trees which otherwise screen the asset	No Change	Neutral
1222315 / Four rows of tomb- stones in eastern angle of south porch and aisle of parish church of St John The Baptist	Listed Building Grade II	Medium	Asset within the ZTV, not ZVI. Site observations confirm the ZTV overlap is from inaccessible roof lines and from the tops of trees which otherwise screen the asset	No Change	Neutral
1222331 / The Old Rectory	Listed Building Grade II*	High	Asset within the ZTV, not ZVI. Site observations confirm the ZTV overlap is from inaccessible roof lines and from the tops of trees which otherwise screen the asset	No Change	Neutral
1222339 / Old Castle Farmhouse	Listed Building Grade II	Medium	Asset within the ZTV, not ZVI. Site observations confirm the ZTV overlap is from inaccessible roof lines and from the tops of trees which otherwise screen the asset	No Change	Neutral
1222414 / Lodge to Stibbington House and gate piers to driveway	Listed Building Grade II	Medium	Asset within the ZTV, not ZVI. Site observations confirm the ZTV overlap is from inaccessible roof lines and from the tops of trees which otherwise screen the asset	No Change	Neutral



# A47 WANSFORD TO SUTTON DUALLING

## Appendix 6.1 Cultural Heritage Information

NHLE/ HER/ WAN Ref Name	Designation	Value / Sensitivity	Description of impact	Magnitude of impact	Significance
1222416 / Mile post c.500 metres north-west of Stibbington School	Listed Building Grade II	Medium	Asset within the ZVI. Its setting is its relationship to the line of the former great north Road and other mile markers on that route and in the region in general. The proposed scheme will not affect the setting of this asset.	No Change	Neutral
1222424 / Gazebo and garden boundary wall to south of Mill Farmhouse	Listed Building Grade II	Medium	Asset within the ZTV, not the ZVI, as an observer would have to be standing on top of the structure to be within the ZVI, which is not accessible.	No Change	Neutral
1222526 / Gate piers to garden entrance, c.15 metres to north of Stibbington House	Listed Building Grade II	Medium	Asset within the ZTV, not ZVI. Site observations confirm the ZTV overlap is from the tops of trees which otherwise screen the asset	No Change	Neutral
1225871 / Manor Farmhouse	Listed Building Grade II	High	Asset within the ZTV, not ZVI. Site observations confirm the ZTV overlap is from inaccessible roof lines and from the tops of trees which otherwise screen the asset	No Change	Neutral
1225872 / Pair of attached cow houses and granaries approx. 10m N of Manor Farmhouse	Listed Building Grade II	Medium	Asset within the ZTV, not ZVI. Site observations confirm the ZTV overlap is from inaccessible roof lines and from the tops of trees which otherwise screen the asset	No Change	Neutral
1225873 / Barn approx. 30m N of Manor Farmhouse	Listed Building Grade II	Medium	Asset within the ZTV, not ZVI. Site observations confirm the ZTV overlap is from inaccessible roof lines and from the tops of trees which otherwise screen the asset	No Change	Neutral
1225874 / The Angel Public House	Listed Building Grade II	High	Asset within the ZTV, not ZVI. Site observations confirm the ZTV overlap is from inaccessible roof lines and from the tops of trees which otherwise screen the asset	No Change	Neutral
1225875 / Sundial Cottage	Listed Building Grade II	High	Asset within the ZTV, not ZVI. Site observations confirm the ZTV overlap is from inaccessible roof lines and from the tops of trees which otherwise screen the asset	No Change	Neutral
1225876 / Yarwell Post Office and attached house	Listed Building Grade II	Medium	Asset within the ZTV, not ZVI. Site observations confirm the ZTV overlap is from inaccessible roof lines and from the tops of trees which otherwise screen the asset	No Change	Neutral

# A47 WANSFORD TO SUTTON DUALLING

## Appendix 6.1 Cultural Heritage Information

NHLE/ HER/ WAN Ref Name	Designation	Value / Sensitivity	Description of impact	Magnitude of impact	Significance
1225877 / Sunnyside	Listed Building Grade II	High	Asset within the ZTV, not ZVI. Site observations confirm the ZTV overlap is from inaccessible roof lines and from the tops of trees which otherwise screen the asset	No Change	Neutral
1225878 / Church of St. Mary Magdalene	Listed Building Grade II*	High	Asset within the ZTV, not ZVI. Site observations confirm the ZTV overlap is from inaccessible roof lines and from the tops of trees which otherwise screen the asset	No Change	Neutral
1225879 / Chest tomb approx. 12m N of vestry of Church of St. Mary Magdalene	Listed Building Grade II	High	Asset within the ZTV, not ZVI. Site observations confirm the ZTV overlap is from inaccessible roof lines and from the tops of trees which otherwise screen the asset	No Change	Neutral
1225880 / Ballaugh Cottage	Listed Building Grade II	Medium	Asset within the ZTV, not ZVI. Site observations confirm the ZTV overlap is from inaccessible roof lines and from the tops of trees which otherwise screen the asset	No Change	Neutral
1225881 / The Farriers	Listed Building Grade II	High	Asset within the ZTV, not ZVI. Site observations confirm the ZTV overlap is from inaccessible roof lines and from the tops of trees which otherwise screen the asset	No Change	Neutral
1225882 / Forge Cottage	Listed Building Grade II	High	Asset within the ZTV, not ZVI. Site observations confirm the ZTV overlap is from inaccessible roof lines and from the tops of trees which otherwise screen the asset	No Change	Neutral
1225909 / Wendmiur	Listed Building Grade II	High	Asset within the ZTV, not ZVI. Site observations confirm the ZTV overlap is from inaccessible roof lines and from the tops of trees which otherwise screen the asset	No Change	Neutral
1225912 / Whitelands	Listed Building Grade II	High	Asset within the ZTV, not ZVI. Site observations confirm the ZTV overlap is from inaccessible roof lines and from the tops of trees which otherwise screen the asset	No Change	Neutral
1237952 / 2, Old Great North Road	Listed Building Grade II	Medium	Asset within the ZTV, not ZVI. Site observations confirm the ZTV overlap is from the tops of trees which otherwise screen the asset	No Change	Neutral
1237953 / Parish church of St Remigus	Listed Building Grade II*	High	Asset within the ZTV, not ZVI. Site observations confirm the ZTV overlap is from the tops of trees which otherwise screen the asset	No Change	Neutral
1237954 / Two tombstone c.14 metres south of west tower of St Remigius Church	Listed Building Grade II	Medium	Asset within the ZTV, not ZVI. Site observations confirm the ZTV overlap is from the tops of trees which otherwise screen the asset	No Change	Neutral
1237955 / Tombstone group between c.14	Listed Building Grade II	Medium	Asset within the ZTV, not ZVI. Site observations confirm the ZTV overlap is from the tops of trees which otherwise screen the asset	No Change	Neutral

# A47 WANSFORD TO SUTTON DUALLING

## Appendix 6.1 Cultural Heritage Information

NHLE/ HER/ WAN Ref Name	Designation	Value / Sensitivity	Description of impact	Magnitude of impact	Significance
and 17 metres to south of chancel of St Remigius Church					
1237956 / Mile post north-west of the Manor House	Listed Building Grade II	Medium	Asset within the ZTV, not ZVI. Site observations confirm the ZTV overlap is from the tops of trees which otherwise screen the asset	No Change	Neutral
1237957 / Hall Cottages	Listed Building Grade II	Medium	Asset within the ZTV, not ZVI. Site observations confirm the ZTV overlap is from the tops of trees which otherwise screen the asset	No Change	Neutral
1237958 / Stable range c.5 metres south of The Manor House	Listed Building Grade II	Medium	Asset within the ZTV, not ZVI. Site observations confirm the ZTV overlap is from the tops of trees which otherwise screen the asset	No Change	Neutral
1266114 / 5, Mill Road	Listed Building Grade II	Medium	Asset within the ZTV, not ZVI. Site observations confirm the ZTV overlap is from inaccessible roof lines and from the tops of trees which otherwise screen the asset	No Change	Neutral
1266121 / K6 Telephone Kiosk	Listed Building Grade II	High	Asset within the ZTV, not ZVI. Site observations confirm the ZTV overlap is from inaccessible roof lines and from the tops of trees which otherwise screen the asset	No Change	Neutral
1266127 / Yarwell House	Listed Building Grade II	Medium	Asset within the ZTV, not ZVI. Site observations confirm the ZTV overlap is from inaccessible roof lines and from the tops of trees which otherwise screen the asset	No Change	Neutral
1266128 / Corner Cottage	Listed Building Grade II	Medium	Asset within the ZTV, not ZVI. Site observations confirm the ZTV overlap is from inaccessible roof lines and from the tops of trees which otherwise screen the asset	No Change	Neutral
1266129 / Pair of chest tombs approx. 13m S of nave of Church of St. Mary Magdalene	Listed Building Grade II	Medium	Asset within the ZTV, not ZVI. Site observations confirm the ZTV overlap is from inaccessible roof lines and from the tops of trees which otherwise screen the asset	No Change	Neutral
1266130 / Mullions	Listed Building Grade II	High	Asset within the ZTV, not ZVI. Site observations confirm the ZTV overlap is from inaccessible roof lines and from the tops of trees which otherwise screen the asset	No Change	Neutral
1266132 / Village Pound	Listed Building Grade II	Medium	Asset within the ZTV, not ZVI. Site observations confirm the ZTV overlap is from inaccessible roof lines and from the tops of trees which otherwise screen the asset	No Change	Neutral

# A47 WANSFORD TO SUTTON DUALLING

## Appendix 6.1 Cultural Heritage Information

NHLE/ HER/ WAN Ref Name	Designation	Value / Sensitivity	Description of impact	Magnitude of impact	Significance
1266143 / Church yard monument approx. 8m N of chancel of Church of St. Mary Magdalene	Listed Building Grade II	Medium	Asset within the ZTV, not ZVI. Site observations confirm the ZTV overlap is from inaccessible roof lines and from the tops of trees which otherwise screen the asset	No Change	Neutral
1274387 / Boundary post c.10 metres to east of No. 33	Listed Building Grade II	Medium	Asset within the ZTV, not ZVI. Site observations confirm the ZTV overlap is from the tops of trees which otherwise screen the asset	No Change	Neutral
1274401 / The Manor House	Listed Building Grade II	High	Asset within the ZTV, not ZVI. Site observations confirm the ZTV overlap is from the tops of trees which otherwise screen the asset	No Change	Neutral
1274428 / No. 3 (Mill Cottage) and 12/173 adjoining range of barns and stables to west and south	Listed Building Grade II	High	Asset within the ZTV, not ZVI. Site observations confirm the ZTV overlap is from the tops of trees which otherwise screen the asset	No Change	Neutral
1274434 / Water Newton Mill, formerly the Water Mill	Listed Building Grade II	High	Asset within the ZTV, not ZVI. Site observations confirm the ZTV overlap is from the tops of trees which otherwise screen the asset	No Change	Neutral
1274435 / The Old Rectory	Listed Building Grade II	Medium	Asset within the ZTV, not ZVI. Site observations confirm the ZTV overlap is from the tops of trees which otherwise screen the asset	No Change	Neutral
1274436 / Coffin c.1 metre to south of west tower of St Remigus Church	Listed Building Grade II	High	Asset within the ZTV, not ZVI. Site observations confirm the ZTV overlap is from the tops of trees which otherwise screen the asset	No Change	Neutral
1274655 / Mill Farmhouse	Listed Building Grade II	Medium	Asset within the ZTV, not ZVI. Site observations confirm the ZTV overlap is from the tops of trees which otherwise screen the asset	No Change	Neutral
1274656 / Mill Bank Cottage	Listed Building Grade II	Medium	Asset within the ZTV, not ZVI. Site observations confirm the ZTV overlap is from the tops of trees which otherwise screen the asset	No Change	Neutral
1274688 / Workshop, former soll to Wansford Paper Mill	Listed Building Grade II	Medium	Asset within the ZTV, not ZVI. Site observations confirm the ZTV overlap is from inaccessible roof lines and from the tops of trees which otherwise screen the asset	No Change	Neutral

# A47 WANSFORD TO SUTTON DUALLING

## Appendix 6.1 Cultural Heritage Information

NHLE/ HER/ WAN Ref Name	Designation	Value / Sensitivity	Description of impact	Magnitude of impact	Significance
c.26 metres west of Stibbington House					
1274697 / Granary, stables and coach house c.15 metres south of Stibbington Manor	Listed Building Grade II	Medium	Asset within the ZTV, not ZVI. Site observations confirm the ZTV overlap is from inaccessible roof lines and from the tops of trees which otherwise screen the asset	No Change	Neutral
1274712 / Stables, coach house and cottage ranges c.5 metres north-west of Stibbington Hall	Listed Building Grade II	Medium	Asset within the ZTV, not ZVI. Site observations confirm the ZTV overlap is from inaccessible roof lines and from the tops of trees which otherwise screen the asset	No Change	Neutral
1274755 / Main building, Wansford Railway Station	Listed Building Grade II	Medium	Asset within the ZTV, not ZVI. Site observations confirm the ZTV overlap is from the tops of trees which otherwise screen the asset	No Change	Neutral
1274858 / Cottage c.5 metres to north-west of Sibson Manor House	Listed Building Grade II	Medium	Asset within the ZTV, not ZVI. Site observations confirm the ZTV overlap is from the tops of trees which otherwise screen the asset	No Change	Neutral
1274859 / Signal box to east of Wansford Railway Station	Listed Building Grade II	Medium	Asset within the ZTV, not ZVI. Site observations confirm the ZTV overlap is from the tops of trees which otherwise screen the asset	No Change	Neutral
1274860 / Wansford Railway Tunnel c.500 metres west of Wansford Station	Listed Building Grade II	Medium	Asset within the ZTV, not ZVI. Site observations confirm the ZTV overlap is from the tops of trees which otherwise screen the asset	No Change	Neutral
1274861 / Gateway and Boundary wall to forecourt of Stibbington Hall	Listed Building Grade I	High	Asset within the ZTV, not ZVI. Site observations confirm the ZTV overlap is from inaccessible roof lines and from the tops of trees which otherwise screen the asset	No Change	Neutral



# A47 WANSFORD TO SUTTON DUALLING

## Appendix 6.1 Cultural Heritage Information

NHLE/ HER/ WAN Ref Name	Designation	Value / Sensitivity	Description of impact	Magnitude of impact	Significance
1274862 / 00226 / Parish Church of St John the Baptist	Listed Building Grade II*	High	Asset within the ZTV, not ZVI. Site observations confirm the ZTV overlap is from inaccessible roof lines and from the tops of trees which otherwise screen the asset	No Change	Neutral
1274863 / Chest tomb c. 10 metres east of chancel of parish church of St John the Baptist	Listed Building Grade II	Medium	Asset within the ZTV, not ZVI. Site observations confirm the ZTV overlap is from inaccessible roof lines and from the tops of trees which otherwise screen the asset	No Change	Neutral
1331539 / Manor House	Listed Building Grade II	High	Asset within the ZTV, not ZVI. Site observations confirm the ZTV overlap is from inaccessible roof lines and from the tops of trees which otherwise screen the asset	No Change	Neutral
1331540 / 10 Main Street	Listed Building Grade II	High	Asset within the ZTV, not ZVI. Site observations confirm the ZTV overlap is from inaccessible roof lines and from the tops of trees which otherwise screen the asset	No Change	Neutral
1331541 / Punchbowl	Listed Building Grade II	Medium	Asset within the ZTV, not ZVI. Site observations confirm the ZTV overlap is from inaccessible roof lines and from the tops of trees which otherwise screen the asset	No Change	Neutral
1331542 / 15 Main Street	Listed Building Grade II	Medium	Asset within the ZTV, not ZVI. Site observations confirm the ZTV overlap is from inaccessible roof lines and from the tops of trees which otherwise screen the asset	No Change	Neutral
1331548 / Manor Farmhouse	Listed Building Grade II	High	Asset within the ZTV, not ZVI. Site observations confirm the ZTV overlap is from inaccessible roof lines which otherwise screen the asset	No Change	Neutral
1331561 / 55 Main Street	Listed Building Grade II	High	Asset within the ZTV, not ZVI. Site observations confirm the ZTV overlap is from inaccessible roof lines and from the tops of trees which otherwise screen the asset	No Change	Neutral
1331562 / Nos 111 and 111A Peterborough Road	Listed Building Grade II	Medium	Asset within the ZTV, not ZVI. Site observations confirm the ZTV overlap is from inaccessible roof lines and from the tops of trees which otherwise screen the asset	No Change	Neutral
1331563 / 117 Peterborough Road	Listed Building Grade II	Medium	Asset within the ZTV, not ZVI. Site observations confirm the ZTV overlap is from inaccessible roof lines and from the tops of trees which otherwise screen the asset	No Change	Neutral
1331579 / The Cabin	Listed Building Grade II	Medium	Asset within the ZTV, not ZVI. Site observations confirm the ZTV overlap is from inaccessible roof lines and from the tops of trees which otherwise screen the asset	No Change	Neutral

# A47 WANSFORD TO SUTTON DUALLING

## Appendix 6.1 Cultural Heritage Information

NHLE/ HER/ WAN Ref Name	Designation	Value / Sensitivity	Description of impact	Magnitude of impact	Significance
1393916 / 00173 / School House including former wash house and pump	Listed Building Grade II	Medium	Asset within the ZTV, not ZVI. Site observations confirm the ZTV overlap is from inaccessible roof lines and from the tops of trees which otherwise screen the asset	No Change	Neutral
N/A / Thornahaugh	Conservation Area	Medium	Asset within the ZTV, not ZVI. Site observations confirm the ZTV overlap is from inaccessible roof lines and from the tops of trees which otherwise screen the asset. Predicted changes in road noise are not significant	No Change	Neutral
N/A / Wansford (North)	Conservation Area	Medium	Asset within the ZTV, not ZVI. Site observations confirm the ZTV overlap is from inaccessible roof lines and from the tops of trees which otherwise screen the asset. Predicted changes in road noise are not significant	No Change	Neutral
N/A / Wansford (South)	Conservation Area	Medium	Asset within the ZTV, not ZVI. Site observations confirm the ZTV overlap is from inaccessible roof lines and from the tops of trees which otherwise screen the asset. Predicted changes in road noise are not significant	No Change	Neutral
N/A / Stibbington	Conservation Area	Medium	Asset within the ZVI. Site observations confirm most of the ZTV overlap is from inaccessible roof lines and from the tops of trees which otherwise screen the individual assets within the area. will experience change to its rural setting with the introduction of new lighting and vehicle lights on the new Sacrewell access. The new lighting will not be a significant impact, as it will be virtually identical to the existing lighting at the junction. The vehicle lighting will be primarily from traffic bound for Sacrewell Farm and the filling station. Headlights would be directed toward the north-western side of the conservation area, and the distance to the Proposed Scheme would further reduce the impact. As the lights would be only experienced intermittently, during hours of darkness and from the edges of the inwardly-focused conservation area, the predicted impacts are of negligible or slight magnitude of impact, based on a changing environment. Slight has been chosen to present a reasonable worst case, following the precautionary principal.  Predicted changes in road noise are not significant.	Minor	Slight
N/A / Sutton	Conservation Area	Medium	The conservation area will experience change to its rural setting with the introduction of lighting at the proposed Sutton Heath roundabout. The changes would be limited to the rear of properties on Nene Way and the Drift, which all have substantial screening from intervening vegetation. The lighting could potentially be visible from within the conservation area on The Drift in winter, when vegetation has thinned out. This would	Minor Adverse	Slight

# A47 WANSFORD TO SUTTON DUALLING

## Appendix 6.1 Cultural Heritage Information

NHLE/ HER/ WAN Ref Name	Designation	Value / Sensitivity	Description of impact	Magnitude of impact	Significance
			<p>increase urbanising elements in the wider rural setting of the northern and eastern edges of the asset.</p> <p>Removal of vehicle traffic from the existing A47 and Sutton Drift will change the character of historic links to the road network, reducing the indexing element of traffic but reinstating more of the rural character by limiting traffic to non-motorised users and local access only.</p> <p>A significance of Slight would be the outcome of minor magnitude impacts on this asset. Discussion with the Peterborough City Archaeological Advisor and Conservation Officer and Historic England has confirmed that beneficial and adverse effects from differing elements of the proposal should be reported as separate significances. This is intended to remove the appearance of any "offsetting" which is not considered appropriate mitigation for heritage assets. However, the equal adverse and beneficial impacts come from the same element of the Proposed Scheme. Both magnitudes are presented to preserve the nuance of the effect but are balanced for the final assessment of significance.</p>	Minor adverse and Minor beneficial	Slight
N/A / Water Newton	Conservation Area	Medium	<p>Asset within the ZTV, not ZVI. Site observations confirm the ZTV overlap is from inaccessible roof lines and from the tops of trees which otherwise screen the asset.</p> <p>Predicted changes in road noise are not significant</p>	No Change	Neutral
N/A / Ailsworth	Conservation Area	Medium	<p>Asset within the ZTV, not ZVI. Site observations confirm the ZTV overlap is from inaccessible roof lines and from the tops of trees which otherwise screen the asset.</p> <p>Predicted changes in road noise are not significant</p>	No Change	Neutral
N/A / Castor	Conservation Area	Medium	<p>Asset within the ZTV, not ZVI. Site observations confirm the ZTV overlap is from inaccessible roof lines and from the tops of trees which otherwise screen the asset.</p> <p>Predicted changes in road noise are not significant</p>	No Change	Neutral
53916 / Churchyard Cross (WW1 Memorial), St. Andrews Churchyard, Thornhaugh	None	Medium	Asset within the ZTV, not ZVI. Site observations confirm the ZTV overlap is from inaccessible roof lines and from the tops of trees which otherwise screen the asset.	No Change	Neutral
51601 / Enclosure	None	Low	Asset within ZTV, Setting is not sensitive	No Change	Neutral

# A47 WANSFORD TO SUTTON DUALLING

## Appendix 6.1 Cultural Heritage Information

NHLE/ HER/ WAN Ref Name	Designation	Value / Sensitivity	Description of impact	Magnitude of impact	Significance
51617 / Thornhaugh Roman Road	None	Negligible	Asset is an archaeological investigation and is indicative of archaeological potential. Impacts on archaeological potential are discussed separately.	No Change	Neutral
51618 / Thornhaugh Quarry (Eastern Extension)	None	Negligible	Asset is an archaeological investigation and is indicative of archaeological potential. Impacts on archaeological potential are discussed separately.	No Change	Neutral
51630 / Thornhaugh Quarry (Eastern Extension)	None	Negligible	Asset is an archaeological investigation and is indicative of archaeological potential. Impacts on archaeological potential are discussed separately.	No Change	Neutral
51636 / Thornhaugh Quarry (Eastern Extension)	None	Negligible	Asset is an archaeological investigation and is indicative of archaeological potential. Impacts on archaeological potential are discussed separately.	No Change	Neutral
50415 / Findspot - Medieval	None	Negligible	Asset is a findspot and is indicative of archaeological potential. Impacts on archaeological potential are discussed separately.	No Change	Neutral
50532 / Haycock Hotel Trenching	None	Negligible	Asset is an archaeological investigation and is indicative of archaeological potential. Impacts on archaeological potential are discussed separately.	No Change	Neutral
50593 / World War II Barracks	None	Low	Asset within the ZTV, not ZVI. Site observations confirm the ZTV overlap is from the tops of trees which otherwise screen the asset.	No Change	Neutral
50594 / Aircraft crash site	None	Low	Asset is a general location and not indicative of a known object	No Change	Neutral
50595 / Aircraft crash site	None	Low	Asset is a general location and not indicative of a known object	No Change	Neutral
50596 / Nene Valley Service Station	None	Negligible	Asset is an archaeological investigation and is indicative of archaeological potential. Impacts on archaeological potential are discussed separately.	No Change	Neutral
50597 / Token Findspot	None	Negligible	Asset is a findspot and is indicative of archaeological potential. Impacts on archaeological potential are discussed separately.	No change	Neutral
50635 / Site of Royal Observer Corps bunker	None	Low	The asset has been excluded from the proposed scheme. Its setting will not be affected	No Change	Neutral
50789 / Sacrewell Farmhouse	None	Medium	Asset assessed as part of the Sacrewell complex	Negligible	Neutral
00181 / River finds - Roman	None	Negligible	Asset is a findspot and is indicative of archaeological potential. Impacts on archaeological potential are discussed separately.	No Change	Neutral
00189 / Roman Pit	None	Low	Asset within ZTV, Setting is not sensitive	No Change	Neutral
00190 / Toll Bar, West of Sutton Heath Cropmarks	None	High	Asset within ZTV, Setting is not sensitive	No Change	Neutral
00190a / Toll Bar, West of Sutton Heath Cropmarks (a)	None	Negligible	Asset within ZTV, Setting is not sensitive	No Change	Neutral

# A47 WANSFORD TO SUTTON DUALLING

## Appendix 6.1 Cultural Heritage Information

NHLE/ HER/ WAN Ref Name	Designation	Value / Sensitivity	Description of impact	Magnitude of impact	Significance
00190b / Toll Bar, West of Sutton Heath Cropmarks (b)	None	Negligible	Asset within ZTV, Setting is not sensitive	Major Adverse	Slight Adverse
00190c / Toll Bar, West of Sutton Heath (c)	None	Negligible	Asset within ZTV, Setting is not sensitive	No Change	Neutral
00190d / Toll Bar, West of Sutton Heath (d)	None	Negligible	Asset within ZTV, Setting is not sensitive	No Change	Neutral
00190e / Toll Bar, West of Sutton Heath (e)	None	Negligible	Asset within ZTV, Setting is not sensitive	No Change	Neutral
00190f / Toll Bar, West of Sutton Heath (f)	None	Negligible	Asset within ZTV, Setting is not sensitive	No Change	Neutral
00190g / Toll Bar, West of Sutton Heath (g)	None	Negligible	Asset within ZTV, Setting is not sensitive	No Change	Neutral
00190h / Toll Bar, West of Sutton Heath (h)	None	Negligible	Asset within ZTV, Setting is not sensitive	No Change	Neutral
01965 / Chowlock Close, Wallets Field,	None	Negligible	Asset is a findspot and is indicative of archaeological potential. Impacts on archaeological potential are discussed separately.	No Change	Neutral
01965a / Chowlock Close, Wallets Field,	None	Negligible	Asset is a findspot and is indicative of archaeological potential. Impacts on archaeological potential are discussed separately.	No Change	Neutral
01966 / Wallets Field, Sacrewell Farm	None	Negligible	Asset is a findspot and is indicative of archaeological potential. Impacts on archaeological potential are discussed separately.	No Change	Neutral
01967 / Pump Close, Sacrewell Farm	None	Negligible	Asset is a findspot and is indicative of archaeological potential. Impacts on archaeological potential are discussed separately.	No Change	Neutral
01968 / Moors Close, Sacrewell Farm	None	Negligible	Asset is a findspot and is indicative of archaeological potential. Impacts on archaeological potential are discussed separately.	No Change	Neutral
00059a / Middle Ground Field, Sacrewell Farm (a)	None	Low	Asset is a findspot and is indicative of archaeological potential. Impacts on archaeological potential are discussed separately.	No Change	Neutral
00059b / Middle Ground Field, Sacrewell Farm (b)	None	Negligible	Asset is a findspot and is indicative of archaeological potential. Impacts on archaeological potential are discussed separately.	No Change	Neutral
01969 / Bottom Meadow, Sacrewell Farm	None	Negligible	Asset is a findspot and is indicative of archaeological potential. Impacts on archaeological potential are discussed separately.	No Change	Neutral
01970 / Drummer's Leys, Sacrewell Farm	None	Negligible	Asset is a findspot and is indicative of archaeological potential. Impacts on archaeological potential are discussed separately.	No Change	Neutral
01971 / Wallets Field, Sacrewell Farm	None	Negligible	Asset is a findspot and is indicative of archaeological potential. Impacts on archaeological potential are discussed separately.	No Change	Neutral
01972 / Moors Close, Sacrewell Farm	None	Negligible	Asset is a findspot and is indicative of archaeological potential. Impacts on archaeological potential are discussed separately.	No Change	Neutral
01973 / Middle Ground Field, Sacrewell Farm	None	Negligible	Asset is a findspot and is indicative of archaeological potential. Impacts on archaeological potential are discussed separately.	No Change	Neutral

# A47 WANSFORD TO SUTTON DUALLING

## Appendix 6.1 Cultural Heritage Information

NHLE/ HER/ WAN Ref Name	Designation	Value / Sensitivity	Description of impact	Magnitude of impact	Significance
01974 / Middle Ground Field, Sacrewell Farm	None	Negligible	Asset is a findspot and is indicative of archaeological potential. Impacts on archaeological potential are discussed separately.	No Change	Neutral
01975 / Fishponds, Sacrewell Farm	None	Negligible	Asset is a findspot and is indicative of archaeological potential. Impacts on archaeological potential are discussed separately.	No Change	Neutral
01976 / Waggon Hovel field, Sacrewell Farm	None	Negligible	Asset is a findspot and is indicative of archaeological potential. Impacts on archaeological potential are discussed separately.	Negligible	Neutral
01977 / Sacrewell Field, Sacrewell Farm	None	Negligible	Asset is a findspot and is indicative of archaeological potential. Impacts on archaeological potential are discussed separately.	No Change	Neutral
01978 / Parson's Close, Sacrewell Farm	None	Negligible	Asset is a findspot and is indicative of archaeological potential. Impacts on archaeological potential are discussed separately.	No Change	Neutral
01979 / Sharpes Field Close	None	Negligible	Asset is a findspot and is indicative of archaeological potential. Impacts on archaeological potential are discussed separately.	No Change	Neutral
01980 / Moors Close, Sacrewell Farm	None	Negligible	Asset is a findspot and is indicative of archaeological potential. Impacts on archaeological potential are discussed separately.	No Change	Neutral
01980a / Moors Close, Sacrewell Farm	None	Negligible	Asset is a findspot and is indicative of archaeological potential. Impacts on archaeological potential are discussed separately.	No Change	Neutral
01982 / Lodge Close, Sacrewell Farm	None	Negligible	Asset is a findspot and is indicative of archaeological potential. Impacts on archaeological potential are discussed separately.	No Change	Neutral
01984 / Sacrewell Farm	None	Negligible	Asset is a findspot and is indicative of archaeological potential. Impacts on archaeological potential are discussed separately.	No Change	Neutral
01985 / Spring Close	None	Negligible	Asset is a findspot and is indicative of archaeological potential. Impacts on archaeological potential are discussed separately.	No Change	Neutral
01986 / Ring Ditch	None	Low	Asset within ZTV, Setting is not sensitive	No Change	Neutral
01987 / Ring Ditch	None	Low	Asset within ZTV, Setting is not sensitive	No Change	Neutral
01988 / Sacrewell Farm	None	Negligible	Asset is a findspot and is indicative of archaeological potential. Impacts on archaeological potential are discussed separately.	No Change	Neutral
01989 / Toll Bar Field, Sacrewell, Farm	None	Negligible	Asset is a findspot and is indicative of archaeological potential. Impacts on archaeological potential are discussed separately.	No Change	Neutral
01990 / Middle Ground Field, Sacrewell Farm	None	Negligible	Asset is a findspot and is indicative of archaeological potential. Impacts on archaeological potential are discussed separately.	No Change	Neutral
01991 / Waggon Hovel Field, Ro Villa site	None	Unknown	Asset is an archaeological investigation and is indicative of archaeological potential. Impacts on archaeological potential are discussed separately.	No Change	Neutral
01992 / Sacrewell Farm	None	Negligible	Asset is a findspot and is indicative of archaeological potential. Impacts on archaeological potential are discussed separately.	No Change	Neutral
01992a / Sacrewell Farm	None	Negligible	Asset is a findspot and is indicative of archaeological potential. Impacts on archaeological potential are discussed separately.	No Change	Neutral
02003 / Human Remains	None	Negligible	Asset is a findspot and is indicative of archaeological potential. Impacts on archaeological potential are discussed separately.	No Change	Neutral
02015 / Iron Spearhead	None	Negligible	Asset is a findspot and is indicative of archaeological potential. Impacts on archaeological potential are discussed separately.	No Change	Neutral



# A47 WANSFORD TO SUTTON DUALLING

## Appendix 6.1 Cultural Heritage Information

NHLE/ HER/ WAN Ref Name	Designation	Value / Sensitivity	Description of impact	Magnitude of impact	Significance
02039 / Roman Pottery	None	Negligible	Asset is a findspot and is indicative of archaeological potential. Impacts on archaeological potential are discussed separately.	No Change	Neutral
02133 / Roman Coins	None	Negligible	Asset is a findspot and is indicative of archaeological potential. Impacts on archaeological potential are discussed separately.	No Change	Neutral
02134 / Iron Cinders (slag)	None	Negligible	Asset is a findspot and is indicative of archaeological potential. Impacts on archaeological potential are discussed separately.	No Change	Neutral
02136 / small Anglo-Saxon settlement	None	Negligible	Asset within ZTV, Setting is not sensitive	No Change	Neutral
02137 / Slag	None	Negligible	Asset is a findspot and is indicative of archaeological potential. Impacts on archaeological potential are discussed separately.	No Change	Neutral
00217 / Roman Settlement Evidence	None	Low	Asset within ZTV, Setting is not sensitive	No Change	Neutral
51213 / Saxon cross shaft	None	Medium	Asset is not within the ZVI	No Change	Neutral
51265 / 9 Russell Hill, Thornhaugh	None	Negligible	Asset is an archaeological investigation and is indicative of archaeological potential. Impacts on archaeological potential are discussed separately.	No Change	Neutral
51163 / Thornhaugh Quarry	None	Negligible	Asset is a findspot and is indicative of archaeological potential. Impacts on archaeological potential are discussed separately.	No Change	Neutral
54016 / National Grid Refurbishment Cottam to St Neots	None	None	Asset is an archaeological investigation and is indicative of archaeological potential. Impacts on archaeological potential are discussed separately.	No Change	Neutral
09884 / Middle Ground Field, Sacrewell Farm	None	Low	Asset within ZTV, Setting is not sensitive	No Change	Neutral
09885 / Double Ditched Track with Parallel Ditches	None	Negligible	Asset within ZTV, Setting is not sensitive	No Change	Neutral
51116 / Wing to Peterborough Pipeline	None	Negligible	Asset is an archaeological investigation and is indicative of archaeological potential. Impacts on archaeological potential are discussed separately.	No Change	Neutral
54067 / The Grange, 15 Nene Way	None	None	Asset is an archaeological investigation and is indicative of archaeological potential. Impacts on archaeological potential are discussed separately.	No Change	Neutral
53784 / Russell Hill	None	Negligible	Asset is an archaeological investigation and is indicative of archaeological potential. Impacts on archaeological potential are discussed separately.	No Change	Neutral
53810 / Land adjacent to the former Little Chef, Great North Road, Wansford	None	Negligible	Asset is an archaeological investigation and is indicative of archaeological potential. Impacts on archaeological potential are discussed separately.	No Change	Neutral
53698 / Silk Fishery and Fishponds, Sacrewell	None	Medium	Assessed as part of Sacrewell Mill complex	No Change	Neutral

# A47 WANSFORD TO SUTTON DUALLING

## Appendix 6.1 Cultural Heritage Information

NHLE/ HER/ WAN Ref Name	Designation	Value / Sensitivity	Description of impact	Magnitude of impact	Significance
53699 / Site of former Smithy, Great North Road	None	Negligible	Asset is destroyed	No Change	Neutral
53717 / The Grange	None	Negligible	Asset not within ZTV, screened by trees	No Change	Neutral
53718 / Ridge and Furrow	None	Negligible	Asset not within ZTV, screened by trees and buildings	No Change	Neutral
53721 / St. Mary's Church, Wansford	None	Negligible	Asset is an archaeological investigation and is indicative of archaeological potential. Impacts on archaeological potential are discussed separately.	No Change	Neutral
53722 / St. Mary's Church, Wansford	None	Negligible	Asset is an archaeological investigation and is indicative of archaeological potential. Impacts on archaeological potential are discussed separately.	No Change	Neutral
53529 / Former Stamford and Wansford Railway	None	Low	Loss of group value through loss of station elements	Moderate Adverse	Slight Adverse
53534 / Sacrewell Mill, Sacrewell Farm, North Road	None	Negligible	Asset is an archaeological investigation and is indicative of archaeological potential. Impacts on archaeological potential are discussed separately.	No Change	Neutral
00095 / Roman Buildings and Potteries	None	Low	Asset within ZTV, Setting is not sensitive	No Change	Neutral
00096 / Roman Settlement Evidence	None	Negligible	Asset within ZTV, Setting is not sensitive	No Change	Neutral
09085 / Ring Ditch and Enclosure	None	Negligible	Asset within ZTV, Setting is not sensitive	No Change	Neutral
09086 / Sutton Crossways	None	Negligible	Asset within ZTV, Setting is not sensitive	No Change	Neutral
09087 / Ring Ditch	None	Negligible	Asset within ZTV, Setting is not sensitive	No Change	Neutral
09102 / Enclosure and associated earthworks	None	Negligible	Asset within ZTV, Setting is not sensitive	No Change	Neutral
09103 / Ditches and enclosure	None	Negligible	Asset within ZTV, Setting is not sensitive	No Change	Neutral
09113 / Ditch fragments	None	Negligible	Asset within ZTV, Setting is not sensitive	No Change	Neutral
09121 / Ditch Fragments	None	Negligible	Asset within ZTV, Setting is not sensitive	No Change	Neutral
09122 / Enclosure	None	Negligible	Asset within ZTV, Setting is not sensitive	No Change	Neutral
09166 / Bronze Age flints and ring ditches	None	Negligible	Asset within ZTV, Setting is not sensitive	No Change	Neutral
09167 / Trackway	None	Negligible	Asset within ZTV, Setting is not sensitive	No Change	Neutral
08465 / Castor/Ailsworth Bypass	None	Negligible	Asset is an archaeological investigation and is indicative of archaeological potential. Impacts on archaeological potential are discussed separately.	No Change	Neutral
08466 / Castor/Ailsworth Bypass	None	Negligible	Asset is an archaeological investigation and is indicative of archaeological potential. Impacts on archaeological potential are discussed separately.	No Change	Neutral
08468 / Castor/Ailsworth Bypass	None	Negligible	Asset is an archaeological investigation and is indicative of archaeological potential. Impacts on archaeological potential are discussed separately.	No Change	Neutral

# A47 WANSFORD TO SUTTON DUALLING

## Appendix 6.1 Cultural Heritage Information

NHLE/ HER/ WAN Ref Name	Designation	Value / Sensitivity	Description of impact	Magnitude of impact	Significance
08472 / Castor/Ailsworth Bypass	None	Negligible	Asset is an archaeological investigation and is indicative of archaeological potential. Impacts on archaeological potential are discussed separately.	No Change	Neutral
8474 / Castor/Ailsworth Bypass	None	Negligible	Asset is an archaeological investigation and is indicative of archaeological potential. Impacts on archaeological potential are discussed separately.	No Change	Neutral
08359 / Ring Ditches	None	Low	Asset within ZTV, Setting is not sensitive	No Change	Neutral
08368 / Pit alignment	None	Low	Construction activities are likely to remove any remains present in this area.	Major Adverse	Slight Adverse
08369 / Possible Roman Road	None	Negligible	Asset within ZTV, Setting is not sensitive	No Change	Neutral
08463 / Castor/Ailsworth Bypass	None	Negligible	Asset is an archaeological investigation and is indicative of archaeological potential. Impacts on archaeological potential are discussed separately.	No Change	Neutral
08144 / Ring Ditch	None	Negligible	Asset within ZTV, Setting is not sensitive	No Change	Neutral
07695 / Sacrewell farm	None	Negligible	Asset is a findspot and is indicative of archaeological potential. Impacts on archaeological potential are discussed separately.	No Change	Neutral
00227 / Ring Ditch	None	Low	Construction activities are likely to remove any remains present in this area.	Major Adverse	Moderate Adverse
00228 / Ridge and Furrow	None	Negligible	Asset is destroyed	No Change	Neutral
00229 / Flint findspots	None	Negligible	Asset is a findspot and is indicative of archaeological potential. Impacts on archaeological potential are discussed separately.	No Change	Neutral
00230 / Posthole	None	Negligible	Construction activities are likely to remove any remains present in this area.	No Change	Neutral
00040 / Deserted Medieval Village of Sibberton	None	Medium	Asset within ZTV, Setting is not sensitive	No Change	Neutral
00042 / Thornhaugh 'Henge'	None	Low	Asset is not within ZVI	No Change	Neutral
53555 / Thornhaugh Quarry, Peterborough	None	Negligible	Asset is an archaeological investigation and is indicative of archaeological potential. Impacts on archaeological potential are discussed separately.	No Change	Neutral
53556 / Thornhaugh Quarry, Peterborough	None	Negligible	Asset is an archaeological investigation and is indicative of archaeological potential. Impacts on archaeological potential are discussed separately.	No Change	Neutral
53557 / Thornhaugh Quarry, Peterborough	None	Negligible	Asset is an archaeological investigation and is indicative of archaeological potential. Impacts on archaeological potential are discussed separately.	No Change	Neutral
53558 / Thornhaugh Quarry, Peterborough	None	Negligible	Asset is an archaeological investigation and is indicative of archaeological potential. Impacts on archaeological potential are discussed separately.	No Change	Neutral
53603 / Medieval Village of Sibberton	None	Low	Asset within ZTV, Setting is not sensitive	No Change	Neutral
53604 / Thornhaugh Manor	None	Low	Asset within the ZTV, not ZVI. Site observations confirm the ZTV overlap is from inaccessible roof lines and from the tops of trees which otherwise screen the asset. Predicted changes in road noise are not significant	No Change	Neutral
52456 / Aircraft Crash Site	None	Low	Asset is a general location and not indicative of a known object	No Change	Neutral

# A47 WANSFORD TO SUTTON DUALLING

## Appendix 6.1 Cultural Heritage Information

NHLE/ HER/ WAN Ref Name	Designation	Value / Sensitivity	Description of impact	Magnitude of impact	Significance
52237 / Wansford Staunch, River Nene	None	Low	Asset within ZTV, Setting is not sensitive	No Change	Neutral
52242 / Flint Findspots	None	Negligible	Asset is a findspot and is indicative of archaeological potential. Impacts on archaeological potential are discussed separately.	No Change	Neutral
52318 / Aircraft Crash Site, Sacrewell Lodge	None	Low	Asset is a general location and not indicative of a known object	No Change	Neutral
52319 / Aircraft Crash Site	None	Low	Asset is a general location and not indicative of a known object	No Change	Neutral
52360 / Aircraft Crash Site	None	Low	Asset is a general location and not indicative of a known object	No Change	Neutral
52361 / Aircraft Crash Site	None	Low	Asset is a general location and not indicative of a known object	No Change	Neutral
52369 / Aircraft Crash Site	None	Low	Asset is a general location and not indicative of a known object	No Change	Neutral
52378 / Aircraft Crash Site	None	Low	Asset is a general location and not indicative of a known object	No Change	Neutral
52051 / St. Michael and All Angels Church, Sutton	None	Negligible	Asset is an archaeological investigation and is indicative of archaeological potential. Impacts on archaeological potential are discussed separately.	No Change	Neutral
52052 / St. Michael and All Angels Church, Sutton	None	Negligible	Asset is an archaeological investigation and is indicative of archaeological potential. Impacts on archaeological potential are discussed separately.	No Change	Neutral
52053 / St. Michael and All Angels Church, Sutton	None	Negligible	Asset is an archaeological investigation and is indicative of archaeological potential. Impacts on archaeological potential are discussed separately.	No Change	Neutral
52054 / St. Michael and All Angels, Sutton	None	Negligible	Asset is an archaeological investigation and is indicative of archaeological potential. Impacts on archaeological potential are discussed separately.	No Change	Neutral
52078 / Thornhaugh Quarry Eastern Extension, Thornhaugh	None	Negligible	Asset is an archaeological investigation and is indicative of archaeological potential. Impacts on archaeological potential are discussed separately.	No Change	Neutral
52109 / Ailsworth	None	Negligible	Asset is a findspot and is indicative of archaeological potential. Impacts on archaeological potential are discussed separately.	No Change	Neutral
52117 / Wansford	None	Negligible	Asset is a findspot and is indicative of archaeological potential. Impacts on archaeological potential are discussed separately.	No Change	Neutral
51946 / Church Street	None	Negligible	Asset is an archaeological investigation and is indicative of archaeological potential. Impacts on archaeological potential are discussed separately.	No Change	Neutral
07854 / Thumb pot	None	Negligible	Asset is a findspot and is indicative of archaeological potential. Impacts on archaeological potential are discussed separately.	No Change	Neutral
07856 / Dredging finds	None	Negligible	Asset is a findspot and is indicative of archaeological potential. Impacts on archaeological potential are discussed separately.	No Change	Neutral

# A47 WANSFORD TO SUTTON DUALLING

## Appendix 6.1 Cultural Heritage Information

NHLE/ HER/ WAN Ref Name	Designation	Value / Sensitivity	Description of impact	Magnitude of impact	Significance
07857 / iron findspot	None	Negligible	Asset is a findspot and is indicative of archaeological potential. Impacts on archaeological potential are discussed separately.	No Change	Neutral
07940 / Flint scatter	None	Negligible	Asset is a findspot and is indicative of archaeological potential. Impacts on archaeological potential are discussed separately.	No Change	Neutral
05648 / Mound	None	Low	Asset within ZTV, Setting is not sensitive	No Change	Neutral
05665 / Enclosure	None	Low	Asset within ZTV, Setting is not sensitive	No Change	Neutral
00057 / Holy Well	None	Low	Asset within ZTV, Setting is not sensitive	No Change	Neutral
00059 / Middle Ground Field, Sacrewell Farm	None	Low	Asset within ZTV, Setting is not sensitive	No Change	Neutral
00123 / Neolithic Handaxe	None	Negligible	Asset is a findspot and is indicative of archaeological potential. Impacts on archaeological potential are discussed separately.	No Change	Neutral
00125 / Gold Coin	None	Negligible	Asset is a findspot and is indicative of archaeological potential. Impacts on archaeological potential are discussed separately.	No Change	Neutral
00120a / Spearhead	None	Negligible	Asset is a findspot and is indicative of archaeological potential. Impacts on archaeological potential are discussed separately.	No Change	Neutral
00120b / Neolithic Axe	None	Negligible	Asset is a findspot and is indicative of archaeological potential. Impacts on archaeological potential are discussed separately.	No Change	Neutral
00120c / Anglo-Saxon spearhead	None	Negligible	Asset is a findspot and is indicative of archaeological potential. Impacts on archaeological potential are discussed separately.	No Change	Neutral
00121 / Cist burial	None	Low	Asset within ZTV, Setting is not sensitive	No Change	Neutral
00122 / Roman Buildings	None	Low	Asset within ZTV, Setting is not sensitive	No Change	Neutral
00129 / Anglo-Saxon spearhead	None	Negligible	Asset is a findspot and is indicative of archaeological potential. Impacts on archaeological potential are discussed separately.	No Change	Neutral
00130 / Mesolithic flint finds	None	Negligible	Asset is a findspot and is indicative of archaeological potential. Impacts on archaeological potential are discussed separately.	No Change	Neutral
00131 / Roman Building	None	Negligible	Asset is destroyed	No Change	Neutral
10044 / Field System	None	Low	Construction activities are likely to remove any remains present in this area.	Major Adverse	Slight Adverse
10050 / Linear Boundaries	None	Negligible	Asset not within ZTV	No Change	Neutral
01588 / Slag Scatter	None	Negligible	Asset is a findspot and is indicative of archaeological potential. Impacts on archaeological potential are discussed separately.	No Change	Neutral
01589 / Ridge and Furrow	None	Negligible	Asset within ZTV, Setting is not sensitive	No Change	Neutral
01590 / Early Iron-Age and Roman sherd scatter and slag heap.	None	Negligible	Asset not within ZVI	No Change	Neutral
01591 / Anglo-Saxon sherds and slag heap	None	Negligible	Asset within ZTV, Setting is not sensitive	No Change	Neutral
04389 / Sutton Heath, Romano-British site	None	Low	Asset within ZTV, Setting is not sensitive	No Change	Neutral

# A47 WANSFORD TO SUTTON DUALLING

## Appendix 6.1 Cultural Heritage Information

NHLE/ HER/ WAN Ref Name	Designation	Value / Sensitivity	Description of impact	Magnitude of impact	Significance
04389a / Sutton Heath, Romano-British site	None	Low	Asset within ZTV, Setting is not sensitive	No Change	Neutral
00044 / Thornhaugh 'Henge'	None	Negligible	Noted as destroyed	No Change	Neutral
04474 / Enclosure	None	Low	Asset within ZTV, Setting is not sensitive	No Change	Neutral
00045 / Limestone Quarry	None	Negligible	Asset within ZTV, Setting is not sensitive	No Change	Neutral
00046a / St Andrews Church	None	Low	Asset not within ZVI	No Change	Neutral
00476 / Roman quern	None	Negligible	Asset is a findspot and is indicative of archaeological potential. Impacts on archaeological potential are discussed separately.	No Change	Neutral
50010 / Pit alignment	None	Low	Asset within ZTV, Setting is not sensitive	No Change	Neutral
50012 / Ermine street	None	Medium	Construction Activities may remove small parts of this asset	Minor Adverse	Slight Adverse
50342 / Roman Building	None	Low	Asset not within ZVI	No Change	Neutral
50343 / Roman iron working	None	Negligible	Asset within ZTV, Setting is not sensitive	No Change	Neutral
51861 / Thornhaugh Quarry (Eastern Extension)	None	Negligible	Asset is a findspot and is indicative of archaeological potential. Impacts on archaeological potential are discussed separately.	No Change	Neutral
51862 / Thornhaugh Quarry (Eastern Extension)	None	Negligible	Asset is a findspot and is indicative of archaeological potential. Impacts on archaeological potential are discussed separately.	No Change	Neutral
51863 / Thornhaugh Quarry (Eastern Extension)	None	Negligible	Asset is a findspot and is indicative of archaeological potential. Impacts on archaeological potential are discussed separately.	No Change	Neutral
51905 / Stibbington, nr. Roman Drive	None	Negligible	Asset is a findspot and is indicative of archaeological potential. Impacts on archaeological potential are discussed separately.	No Change	Neutral
10250 / Roman Road	None	Medium	Asset within ZTV, Setting is not sensitive	No Change	Neutral
11038 / Excavation	None	Negligible	Asset is an archaeological investigation and is indicative of archaeological potential. Impacts on archaeological potential are discussed separately.	No Change	Neutral
11039 / Excavation	None	Negligible	Asset is an archaeological investigation and is indicative of archaeological potential. Impacts on archaeological potential are discussed separately.	No Change	Neutral
11837 / Anglo-Saxon moot	None	Medium	Asset within ZTV, Setting is not sensitive	No Change	Neutral
01570 / Roman Pottery	None	Negligible	Asset is a findspot and is indicative of archaeological potential. Impacts on archaeological potential are discussed separately.	No Change	Neutral
01571 / Roman Pottery	None	Negligible	Asset is a findspot and is indicative of archaeological potential. Impacts on archaeological potential are discussed separately.	No Change	Neutral
01584 / Bronze-Age flint scatter	None	Negligible	Asset is a findspot and is indicative of archaeological potential. Impacts on archaeological potential are discussed separately.	No Change	Neutral



# A47 WANSFORD TO SUTTON DUALLING

## Appendix 6.1 Cultural Heritage Information

NHLE/ HER/ WAN Ref Name	Designation	Value / Sensitivity	Description of impact	Magnitude of impact	Significance
01586 / Ridge and Furrow	None	Negligible	Asset not within ZTV	No Change	Neutral
01653 / Ring Ditch	None	Negligible	Asset within ZTV, Setting is not sensitive	No Change	Neutral
00173a / Stibbington Hall	None	Medium	Asset within the ZTV, not ZVI. Site observations confirm the ZTV overlap is from inaccessible roof lines and from the tops of trees which otherwise screen the asset	Negligible	Neutral
00173b / Stibbington Hall	None	Low	Asset within the ZTV, not ZVI. Site observations confirm the ZTV overlap is from inaccessible roof lines and from the tops of trees which otherwise screen the asset	No Change	Neutral
00174 / Burial	None	Negligible	Asset within the ZTV, not ZVI. Site observations confirm the ZTV overlap is from inaccessible roof lines and from the tops of trees which otherwise screen the asset	Negligible	Neutral
00176 / Burial	None	Low	Asset within ZTV, Setting is not sensitive	No Change	Neutral
00177 / Roman burials and finds	None	Medium	Asset within ZTV, Setting is not sensitive	No Change	Neutral
00178 / Barrow and ring ditch	None	Medium	Asset within ZTV, Setting is not sensitive	No Change	Neutral
00178a / Roman fort	None	Medium	Asset within ZTV, Setting is not sensitive	No Change	Neutral
00179 / Roman findspot	None	Negligible	Asset is a findspot and is indicative of archaeological potential. Impacts on archaeological potential are discussed separately.	No Change	Neutral
00180 / Roman findspot	None	Negligible	Asset is a findspot and is indicative of archaeological potential. Impacts on archaeological potential are discussed separately.	No Change	Neutral
MPB1974 / Iron Age Enclosure	None	Negligible	Asset within ZTV, Setting is not sensitive	No Change	Neutral
MPB5380 / Roman Road	None	Low	Asset within ZTV, Setting is not sensitive	No Change	Neutral
MPB5370 / Medieval Pottery Scatter	None	Negligible	Asset is a findspot and is indicative of archaeological potential. Impacts on archaeological potential are discussed separately.	No Change	Neutral
MPB5512 / double-ditched track/road	None	Negligible	Asset within ZTV, Setting is not sensitive	No Change	Neutral
MPB1408 / Medieval Earthworks	None	Negligible	Asset within ZTV, Setting is not sensitive	No Change	Neutral
MPB1689 / Neolithic Flint Scatter	None	Negligible	Asset is a findspot and is indicative of archaeological potential. Impacts on archaeological potential are discussed separately.	No Change	Neutral
MPB1686 / Medieval Slag Heap	None	Negligible	Asset within ZTV, Setting is not sensitive	No Change	Neutral
MPB3481 / Former site of Upton Village Hall	None	Negligible	Noted as destroyed	No Change	Neutral
MPB2229 / Upton Causewayed Enclosure	None	Medium	Construction activities are likely to remove any remains present in this area.	Moderate Adverse	Moderate Adverse

# A47 WANSFORD TO SUTTON DUALLING

## Appendix 6.1 Cultural Heritage Information

NHLE/ HER/ WAN Ref Name	Designation	Value / Sensitivity	Description of impact	Magnitude of impact	Significance
MPB1690 / Upton Lodge Finds	None	Negligible	Asset is a findspot and is indicative of archaeological potential. Impacts on archaeological potential are discussed separately.	No Change	Neutral
MPB5854 / Ridge and furrow project: Upton	None	Low	Asset is a study document but has been assessed at the value of the features recorded.	No Change	Neutral
MPB4420 / Findspot scatter - Roman to victorian	None	Negligible	Asset is a findspot and is indicative of archaeological potential. Impacts on archaeological potential are discussed separately.	No Change	Neutral
WAN1 / Former Wansford Road Station	Locally Listed Building	Medium	The station building is to be demolished.	Major Adverse	Large Adverse
WAN2 / Wansford Railway No6 Bridge	Locally Listed Building	Medium	The asset will suffer impacts to setting from the demolition of the Former Wansford Road Railway Station	Moderate Adverse	Moderate Adverse
WAN3 / Site of Milepost	None	Negligible	None	No Change	Neutral
WAN4 / Weir	None	Negligible	None	No Change	Neutral
WAN5 / Site of Milestone	None	Negligible	None	No Change	Neutral
WAN6 / Flaxen Ford	None	Negligible	None	No Change	Neutral
WAN7 / Site of Milestone	None	Negligible	None	No Change	Neutral
WAN8 / Site of Sutton Toll	None	Negligible	None	No Change	Neutral
WAN9 / Site of Milestone	None	Negligible	None	No Change	Neutral
WAN10 / Former quarry	None	Negligible	None	No Change	Neutral
WAN11 / Heath House	Locally Listed Building	Medium	Loss of group value due to demolition of WAN1	Moderate Adverse	Moderate Adverse
WAN12 / Former Quarry	None	Negligible	Removal during construction	Major Adverse	Slight Adverse
WAN13 / Roadhouse	Locally Listed Building	Medium	No significant changes to the road layout that forms the setting of the asset	No Change	Neutral
- / 19th-20th century woodland plantation	None	Negligible	None	No Change	Neutral
- / "Ancient" woodland	None	Low	None	No Change	Neutral
- / Built up areas – urban development	None	Negligible	None	No Change	Neutral

# A47 WANSFORD TO SUTTON DUALLING

## Appendix 6.1 Cultural Heritage Information

NHLE/ HER/ WAN Ref Name	Designation	Value / Sensitivity	Description of impact	Magnitude of impact	Significance
- / Communications – motorways, railways	None	Negligible	The original line of the existing network will be altered slightly but mostly preserved	Negligible	Neutral
- / Disused mineral extraction	None	Negligible	None	No Change	Neutral
- / Formal parliamentary style – 18th century and later enclosure	None	Negligible	Removal of field boundaries within the footprint of the Proposed Scheme during construction and presence of new roads and structures in this landscape type. As the new road layout will follow the broad line of the previous A47, which is a medieval route, and this landscape type is ubiquitous throughout the UK, the change is not considered significant.	Negligible	Neutral
- / Later enclosure – piecemeal by agreement	None	Negligible	Removal of field boundaries within the footprint of the Proposed Scheme during construction and presence of new roads and structures in this landscape type. As the new road layout will follow the broad line of the previous A47, which is a medieval route, and this landscape type is ubiquitous throughout the UK, the change is not considered significant.	Negligible	Neutral
- / Post 1950's enclosure	None	Negligible	Removal of field boundaries within the footprint of the Proposed Scheme during construction and presence of new roads and structures in this landscape type. As the new road layout will follow the broad line of the previous A47, which is a medieval route, and this landscape type is ubiquitous throughout the UK, the change is not considered significant.	Negligible	Neutral
- / 'Prairie fields' – post 1950's boundary loss	None	Negligible	Removal of field boundaries within the footprint of the Proposed Scheme during construction and presence of new roads and structures in this landscape type. As the new road layout will follow the broad line of the previous A47, which is a medieval route, and this landscape type is ubiquitous throughout the UK, the change is not considered significant.	Negligible	Neutral
- / 'Prairie fields' with relict elements – post 1950's boundary loss	None	Negligible	Removal of field boundaries within the footprint of the Proposed Scheme during construction and presence of new roads and structures in this landscape type. As the new road layout will follow the broad line of the previous A47, which is a medieval route, and this landscape type is ubiquitous throughout the UK, the change is not considered significant.	Negligible	Neutral
- / Site of special scientific interest	None	Negligible	None	No Change	Neutral
- / Water reservoir	None	Negligible	None	No Change	Neutral
- / Waterway – major river	None	Low	None	No Change	Neutral

## References

### Bibliography

- Ancient Monuments and Archaeological Areas Act (1979)
- Bradley, Richard (2007) *The Prehistory of Britain and Ireland*, Cambridge University Press
- British Geological Society (BGS) (2018). *Geology of Britain viewer*. [online] available at: <http://mapapps.bgs.ac.uk/geologyofbritain/home.html> (last accessed May 2020)
- CAMUS project (2004) *Five Parishes, Their People and Places: A History of the Villages of Castor, Ailsworth, Marholm with Milton, Upton and Sutton*
- Chartered Institute for Archaeologists (2014, updated 2017) *Standard and guidance for desk-based assessment* [online] available at: <https://www.archaeologists.net/codes/cifa> (last accessed May 2020)
- Cranfield Soil and Agrifood Institute (2018) *Soilscapes*. Available at: <http://www.landis.org.uk/soilscapes> [access May 2020]
- Department for Communities and Local Government (2018) *National Planning Policy Framework* [online] available at: [https://assets.publishing.service.gov.uk/government/uploads/system/uploads/attachment\\_data/file/733637/National\\_Planning\\_Policy\\_Framework\\_web\\_accessible\\_version.pdf](https://assets.publishing.service.gov.uk/government/uploads/system/uploads/attachment_data/file/733637/National_Planning_Policy_Framework_web_accessible_version.pdf) (last accessed May 2020)
- Department for Transport (2014) *National Policy Statement for National Networks* [online] available at: [https://assets.publishing.service.gov.uk/government/uploads/system/uploads/attachment\\_data/file/387223/npsnn-web.pdf](https://assets.publishing.service.gov.uk/government/uploads/system/uploads/attachment_data/file/387223/npsnn-web.pdf) (last accessed May 2020)
- Highways Agency (2020) *Design Manual for Roads and Bridges (DMRB)*, Volume 11, Section 3, Part 2
- Historic England (2008) *Conservation principles policies and guidance for the sustainable management of the historic environment* [online] available at <https://content.historicengland.org.uk/images-books/publications/conservation-principles-sustainable-management-historic-environment/conservationprinciplespoliciesguidanceapr08web.pdf/> (last accessed May 2020)

- Historic England (2015) Historic Environment Good Practice Advice in Planning Note 2 Managing Significance in Decision Taking in the Historic Environment [online] available at: <https://content.historicengland.org.uk/images-books/publications/gpa2-managing-significance-in-decision-taking/gpa2.pdf/> (last accessed May 2020)
- Historic England (2016) Understanding Historic Buildings: a guide to good recording practice [online] available at: <https://content.historicengland.org.uk/images-books/publications/understanding-historic-buildings/heag099-understanding-historic-buildings.pdf/> (last accessed May 2020)
- Historic England (2017) Historic Environment Good Practice Advice in Planning Note 3 The Setting of Heritage Assets 2nd ed. [online] <https://historicengland.org.uk/images-books/publications/gpa3-setting-of-heritage-assets/> (last accessed May 2020)
- Meaney, P, Gazetteer of Hundred and Wapentake meeting places in the Cambridge region, Proceedings of the Cambridge Antiquarian Society 82, 67-92
- Open Domesday (2018a) *Stibbington* [online] available at: <http://opendomesday.org/place/TL0898/stibbington/> (last accessed May 2020)
- Open Domesday (2018b) *Ailsworth* [online] available at: <http://opendomesday.org/place/TL1199/ailsworth/> (last accessed May 2020)
- Open Domesday (2018b) *Water Newton* [online] available at: <http://opendomesday.org/place/TL1097/water-newton/> (last accessed May 2020)
- Planning (Listed Building and Conservation Areas) Act (1990)

## Cartographic Sources

- (1886) County series 1<sup>st</sup> Edition, Nottinghamshire 1:2 500
- (1888-1892) County series 1<sup>st</sup> Edition, Nottinghamshire 1:10,560
- (1889) County series 1<sup>st</sup> Edition, Huntingdonshire 1:2 500
- (1889-1891) County Series 1st Edition, Huntingdonshire 1:10 560
- (1900-1901) County Series 1st Revision, Nottinghamshire 1:2 500
- (1901) County Series 1st Revision, Huntingdonshire 1:2 500
- (1901) County Series 2nd Revision, Lincolnshire 1:10,560

- (1901) County Series 2nd Revision, Nottinghamshire 1:10,560
- (1902) County Series 2nd Revision, Huntingdonshire 1:10,560
- (1926) County Series 2nd Revision, Huntingdonshire 1:2 500
- (1926) County Series 2nd Revision, Nottinghamshire 1:2 500
- (1927) County Series 2nd Revision, Nottinghamshire 1:10,560
- (1928) County Series 2nd Revision, Huntingdonshire 1:10,560
- (1952) County Series 3rd Revision, Huntingdonshire 1:10 560
- (1952-1953) County Series 3rd Revision, Nottinghamshire 1:10 560
- (1958) National Grid 1st Imperial Edition 1:10 560
- (1969-1979) National Grid 1st Revision, 1:10 560
- (1970-1977) National Grid 1st Edition, 1:2500
- (1977-1980) National Grid 1:10 000 1st Metric Edition
- (1977-1996) National Grid 1:10 000
- (1992) National Grid 1:10 000 1st Revision

## 6.6. Glossary

Term	Description
Artefact	An item of archaeological interest
Baseline	In EIA, 'baseline conditions' are the environmental conditions in existence just before the occurrence of an impact – i.e. they are the conditions that would be affected. Baseline conditions are not the same as existing conditions, which are those in existence at the time of carrying out the EIA, because, this may be some time in advance of the occurrence of an impact and environmental conditions may change in the intervening period.
Bronze Age	The period of human activity between 2,500 BCE and 700 BCE
Construction Environmental Management Plan (CEMP)	A plan prepared by a Principal Contractor before the start of construction work, detailing 'environmental aspects' that may be affected by the construction work and management methods to prevent any such effects. The CEMP would include methods and site management practices to be applied to prevent generation of nuisance dust, accidental pollution events and a range of other potential sources of accidental damage to the environment, and response and reporting procedures to minimise the damage in the event of a pollution incident.



Term	Description
Construction activity	Vegetation removal, topsoil stripping, temporary storage of materials, ground excavation and remodelling, bare earth, movement of construction vehicles and tall features such as cranes and other construction plant.
Desk study	A collation and review of relevant existing information available from published, archival or online sources, including for instance geological and hydrogeological mapping, historical maps, environmental records etc., allowing an assessment of risks to the human and environmental receptors to be undertaken.
Design Manual for Roads and Bridges (DMRB)	The 15 volumes of DMRB provide a standard for all aspects of the design of roads and bridges in the UK. Volume 10 covers environmental mitigation and Volume 11 governs environmental impact assessment. Other volumes cover other aspects of the design and preparation of highways projects.
Earthworks	The moving of soil or rock to reconfigure the topography of a site.
Environmental Impact Assessment (EIA)	An assessment of certain types of major project of the significant effects that the project could have on the environment. The applicant is required to carry out the assessment by law, in this case under the Infrastructure Planning (Environmental Impact Assessment) Regulations, 2017.
Environmental Statement (ES)	The report on the results of the EIA.
Fieldwalking survey	Method of systematic non-intrusive survey involving walking across a plough field along transects to collect archaeological artefacts.
Geology	Geology is the study of solid earth, the material of which it is composed (principally rocks) and the processes by which they evolve.
Geophysical survey	Method of non-intrusive investigation involving the use of magnetometers to identify fluctuations in the earth's magnetic field which might indicate the presence of archaeological remains. Burnt remains and metals are best identified through this method of survey.
Grade Separated	Refers to a junction where one road has been elevated or lowered to a different level so that the main flow of traffic is separated.
Heritage asset	An item of heritage interest, for example an historic building or an archaeological find.
Hibernacula	The place/ structure/ shelter chosen by an animal for hibernation.
Highways England	The applicant and government company charged with operating, maintaining and improving England's motorway and major A roads. Formerly the Highways Agency.
Historic Environment Records (HER)	A database maintained by individual counties or local authorities, containing records of archaeological sites, historic buildings and other aspects.
Historic landscape character types (HLCT)	Historic landscape character types are distinctive and repeated combinations of components defining generic historic landscapes such as 'ancient woodland' or 'parliamentary enclosure'. The types used in this study were defined based on evidence from historic maps and other sources.
Iron Age	The period of human activity between 700 BCE and 43 ACE
Made Ground	Ground created by infilling an area with material taken from elsewhere; typically, reworked soils, rubble, gravel, sand or former waste material e.g. ash.
Medieval	The period of human activity between 1066 ACE and 1550 ACE

Term	Description
Mesolithic	Middle Stone Age. The period of human activity between 10,000 BCE and 4,500 BCE.
Metal detector survey	Method of intrusive investigation involving the use of metal detectors to locate buried metal objects.
Mitigation	Measures which have the purpose of avoiding, reducing or compensating for adverse environmental impacts. It may also include measures to create environmental benefits.
Modern	The period of human activity from 1900 to the present day
National Mapping Programme (NMP)	A project funded by Historic England and local councils involving assessment and interpretation of aerial photographs and other remote sensing data, such as LiDAR.
Neolithic	New Stone Age. The period of human activity between 4,500 BCE and 2,500 BCE
Walkers, cyclists and horse riders (WCH)	Includes walkers, cyclists and horse riders.
Ordnance Datum	The standard measure of sea level in the UK, from which all heights are measured for mapping purposes.
Palaeolithic	Old Stone Age. The period of human and pre-human activity before around 10,000 BC
Photomontage	A photorealistic image of the scheme, based on a 3D computer model of the scheme, overlaid onto a base photograph to visually represent the scheme. Features that would be removed as part of the scheme are removed from the base photograph.
Post-medieval	The period of human activity between 1550 ACE and 1900 ACE
Prehistoric	The period before the year 43 ACE
Receptor	The existing environmental feature that would be affected by an impact – for instance, the population of a protected species, or a specific archaeological site, or the occupants of a residential property.
Requirement	A requirement listed in the Development Consent Order which is a condition of the grant of development consent.  In this instance Schedule 2 of the A47 Blofield to North Burlingham Development Consent Order
Roman	The period of human activity between 43 ACE and 410 ACE
Saxon	The period of human activity between 410 ACE and 1066 ACE
Statutory Consultation	Community and stakeholder consultation carried out in line with the statutory requirements set out in s42, s47 and s48 of the Planning Act 2008
Statutory consultees	Organisations that Highways England is required to consult under s42 of the Planning Act 2008. Statutory consultees are listed in Schedule 1 of the APFP 2009
Zone of Theoretical Visibility (ZTV)	The zone from which the scheme is theoretically visible over 'bare earth'.